



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
857-5203
 Component
Diesel Engine
 Fluid
CHEVRON DELO 400 SAE 10W30 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		RPL0014605	---	---
Sample Date		Client Info		30 Nov 2023	---	---
Machine Age	hrs	Client Info		667	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	54	---	---
Chromium	ppm	ASTM D5185m	>20	<1	---	---
Nickel	ppm	ASTM D5185m	>4	0	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m	>3	<1	---	---
Aluminum	ppm	ASTM D5185m	>20	24	---	---
Lead	ppm	ASTM D5185m	>40	1	---	---
Copper	ppm	ASTM D5185m	>330	47	---	---
Tin	ppm	ASTM D5185m	>15	2	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

CONTAMINATION








Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	47	---	---
Potassium	ppm	ASTM D5185m	>20	98	---	---
Fuel		WC Method	>5	<1.0	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol	%	*ASTM D2982		NEG	---	---
Soot %	%	*ASTM D7844	>3	0.2	---	---
Nitration	Abs/cm	*ASTM D7624	>20	10.4	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	21.1	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		5	---	---
Boron	ppm	ASTM D5185m		33	---	---
Barium	ppm	ASTM D5185m		0	---	---
Molybdenum	ppm	ASTM D5185m		10	---	---
Manganese	ppm	ASTM D5185m		4	---	---
Magnesium	ppm	ASTM D5185m		733	---	---
Calcium	ppm	ASTM D5185m		1300	---	---
Phosphorus	ppm	ASTM D5185m	1260	736	---	---
Zinc	ppm	ASTM D5185m	1400	798	---	---
Sulfur	ppm	ASTM D5185m		3027	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	16.2	---	---
Base Number (BN)	mg KOH/g	ASTM D2896	10.1	6.2	---	---
Visc @ 100°C	cSt	ASTM D445	11.1	11.4	---	---

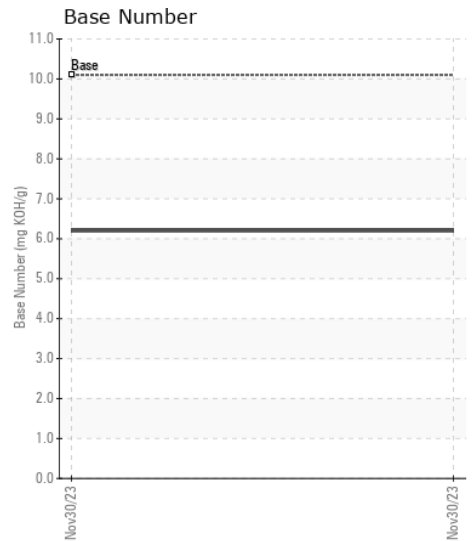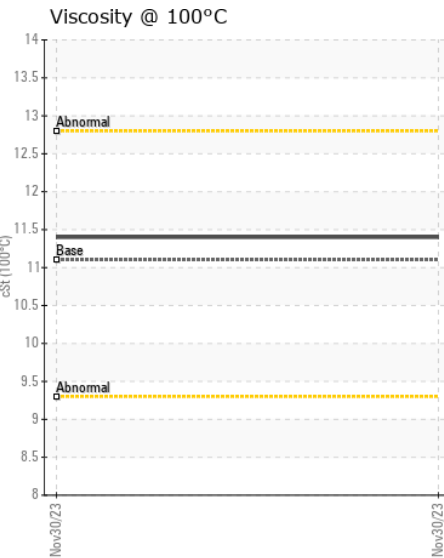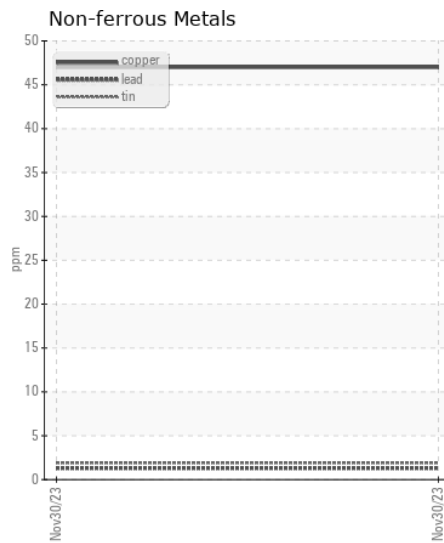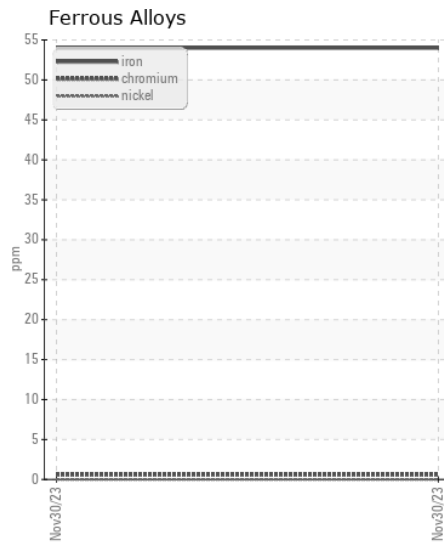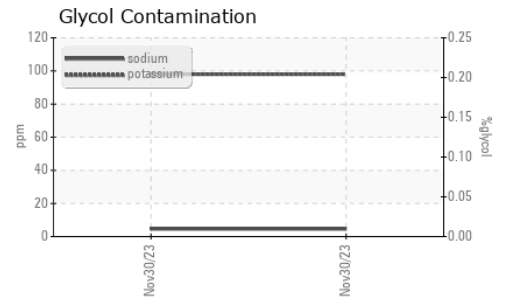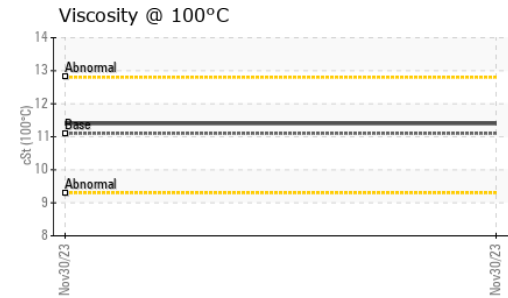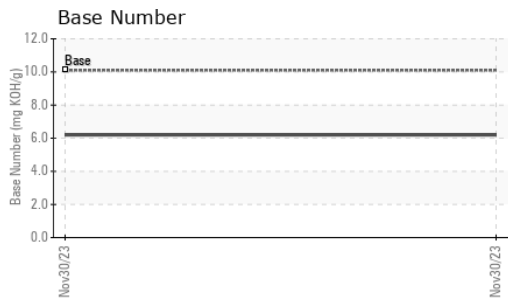

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : RPL0014605 **Received** : 10 Jan 2024
Lab Number : 06056215 **Diagnosed** : 11 Jan 2024
Unique Number : 10822164 **Diagnostician** : Angela Borella
Test Package : FLEET (Additional Tests: Glycol)

RTL PACLEASE - 7001 - Houston
 6300 N. Loop East
 Houston, TX
 US 77026
 Contact: RODNEY BRIGGS
 briggsr@rushenterprises.com
 T:
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)