

Machine Id
Wampler Ridge 4
Component
Natural Gas Engine
Fluid
PETRO CANADA SENTRON LD 3000 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		PCA0103418	PCA0103438	PCA0103433
Sample Date		Client Info		02 Jan 2024	01 Dec 2023	02 Nov 2023
Machine Age	hrs	Client Info		125710	124938	124280
Oil Age	hrs	Client Info		124938	19661	19003
Filter Age	hrs	Client Info		0	19661	19003
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>50	6	2	3
Chromium	ppm	ASTM D5185m	>4	0	<1	<1
Nickel	ppm	ASTM D5185m	>2	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m	>3	0	0	0
Aluminum	ppm	ASTM D5185m	>9	2	<1	<1
Lead	ppm	ASTM D5185m	>30	15	13	13
Copper	ppm	ASTM D5185m	>35	2	<1	<1
Tin	ppm	ASTM D5185m	>4	<1	<1	<1
Vanadium	ppm	ASTM D5185m		0	0	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE

CONTAMINATION













Tests indicate that there is no fuel present in the oil. There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>+100	3	1	1
Potassium	ppm	ASTM D5185m	>20	2	<1	0
Fuel	%	ASTM D3524	>4.0	0.0	0.0	0.0
Water		WC Method	>0.1	NEG	NEG	NEG
Soot %	%	*ASTM D7844		0	0	0
Nitration	Abs/cm	*ASTM D7624	>20	5.6	5.6	5.7
Sulfation	Abs/.1mm	*ASTM D7415	>30	19.0	18.8	19.0
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	NEG

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		0	0	<1
Boron	ppm	ASTM D5185m	5	<1	0	<1
Barium	ppm	ASTM D5185m	1	0	0	0
Molybdenum	ppm	ASTM D5185m	2	2	0	<1
Manganese	ppm	ASTM D5185m	1	0	0	<1
Magnesium	ppm	ASTM D5185m	5	15	16	15
Calcium	ppm	ASTM D5185m	1220	1533	1462	1448
Phosphorus	ppm	ASTM D5185m	298	356	320	313
Zinc	ppm	ASTM D5185m	350	399	412	401
Sulfur	ppm	ASTM D5185m	1995	2525	2429	2372
Oxidation	Abs/.1mm	*ASTM D7414	>25	14.7	13.9	13.9
Acid Number (AN)	mg KOH/g	ASTM D8045	0.86	1.44	1.45	1.32
Base Number (BN)	mg KOH/g	ASTM D2896	3.85	2.83	2.12	2.34
Visc @ 100°C	cSt	ASTM D445	13.7	13.7	13.6	13.6

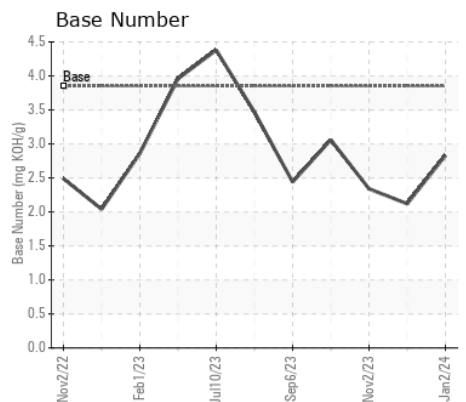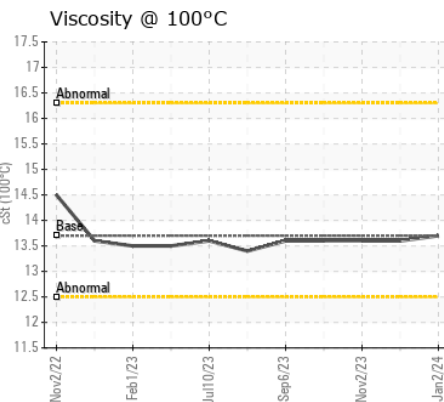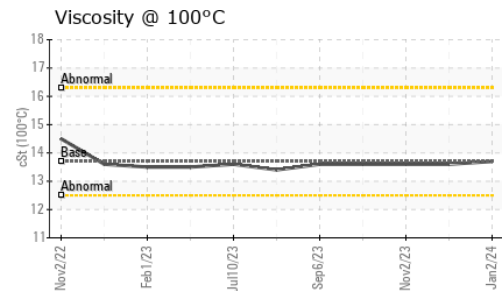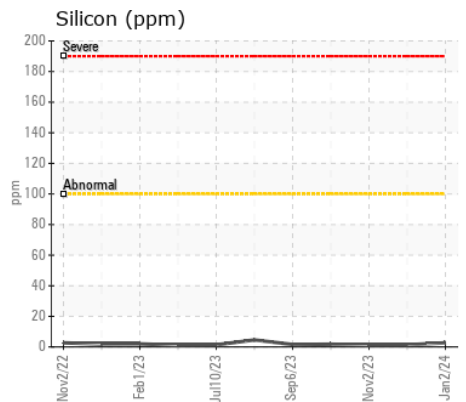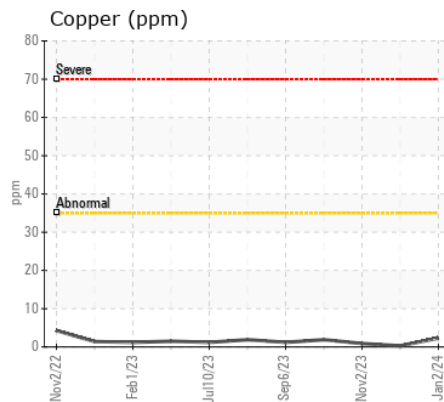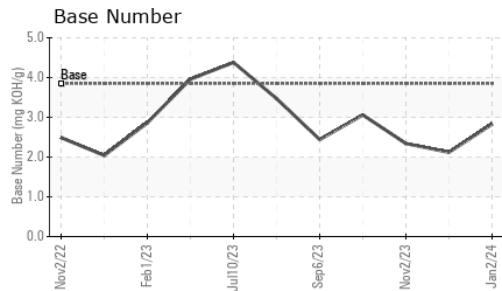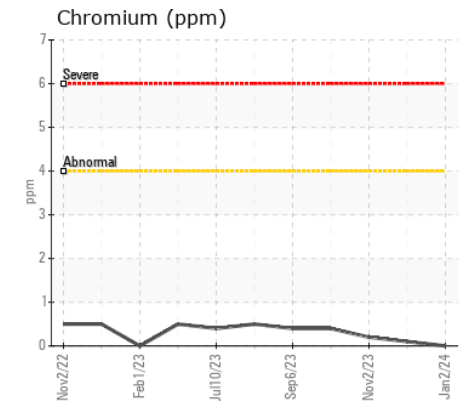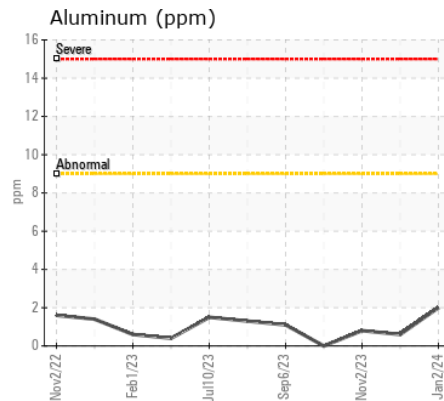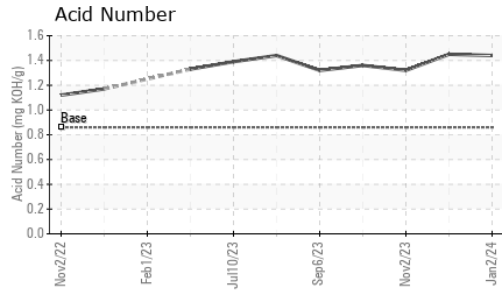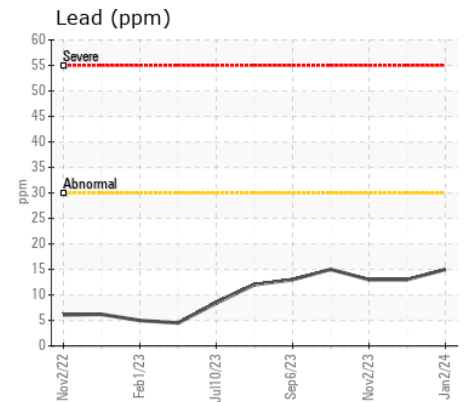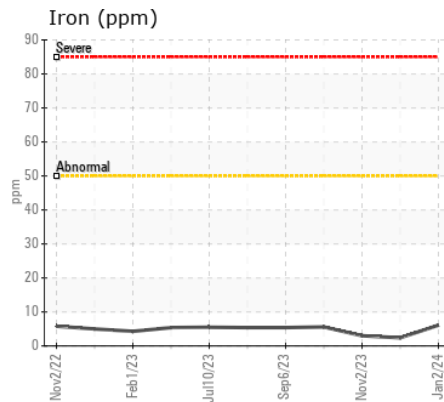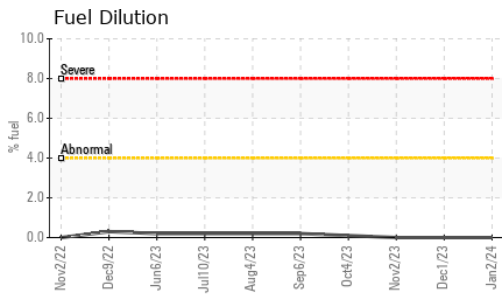

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0103418 **Received** : 10 Jan 2024
Lab Number : 06057438 **Diagnosed** : 12 Jan 2024
Unique Number : 10823387 **Diagnostician** : Sean Felton
Test Package : MOB 2 (Additional Tests: FuelDilution, PercentFuel)

ENERVEST OPERATING - WAMPLER RIDGE
 1958 COUNTS RIDGE
 DANTE, VA
 US 24237
 Contact: Service Manager

Certificate L2367
 To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: