



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area
BOWERMAN - ORANGE COUNTY CA

Machine Id
BOW-282-1

Component
Refrigeration Compressor

Fluid
VILTER 717 COMPRESSOR OIL ISO 68 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0848277	WC0649936	WC0649918
Sample Date		Client Info		09 Jan 2024	25 Sep 2023	14 Jun 2023
Machine Age	hrs	Client Info		65284	62768	60351
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	1769	0
Oil Changed		Client Info		N/A	Not Changd	Not Changd
Filter Changed		Client Info		N/A	Not Changd	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>8	8	6	2
Chromium	ppm	ASTM D5185m	>2	<1	0	0
Nickel	ppm	ASTM D5185m		<1	0	0
Titanium	ppm	ASTM D5185m		<1	<1	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>3	2	2	0
Lead	ppm	ASTM D5185m	>2	0	0	0
Copper	ppm	ASTM D5185m	>8	<1	0	0
Tin	ppm	ASTM D5185m	>4	0	0	<1
Vanadium	ppm	ASTM D5185m		0	0	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE

CONTAMINATION













The water content is negligible. There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>15	4	<1	0
Potassium	ppm	ASTM D5185m	>20	1	0	<1
Water	%	ASTM D6304	>0.01	0.004	0.00	0.002
ppm Water	ppm	ASTM D6304	>100	43	0.00	22.2
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.01	NEG	NEG	NEG

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		0	<1	<1
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0	0
Manganese	ppm	ASTM D5185m		0	0	<1
Magnesium	ppm	ASTM D5185m	0	0	0	0
Calcium	ppm	ASTM D5185m	0	2	<1	0
Phosphorus	ppm	ASTM D5185m	0	20	0	0
Zinc	ppm	ASTM D5185m	0	0	0	0
Sulfur	ppm	ASTM D5185m		0	154	18
Acid Number (AN)	mg KOH/g	ASTM D974	0.2	0.084	0.013	0.015
Visc @ 40°C	cSt	ASTM D445	68	72.6	71.3	71.2

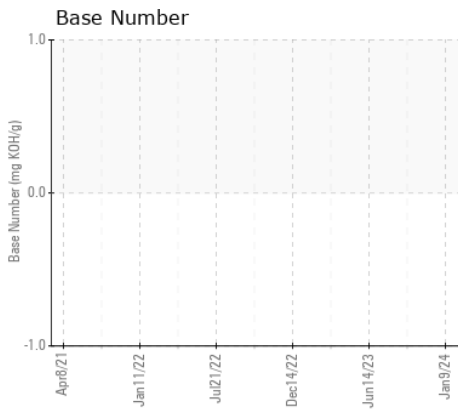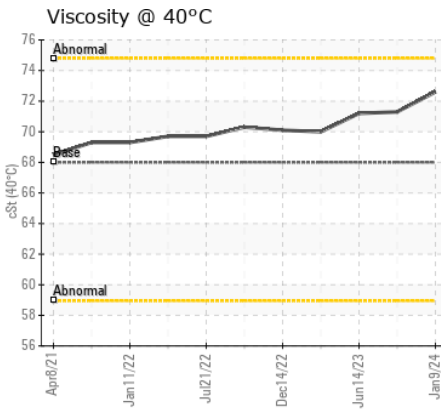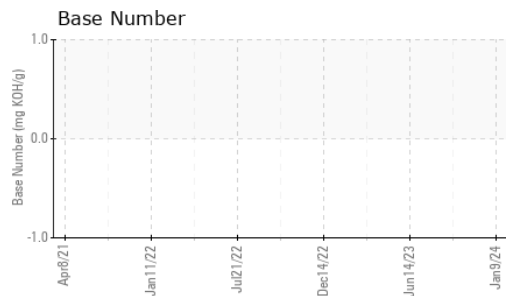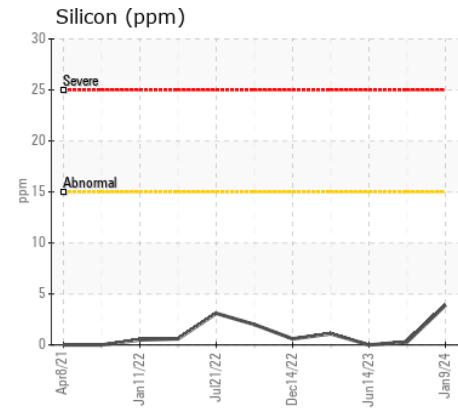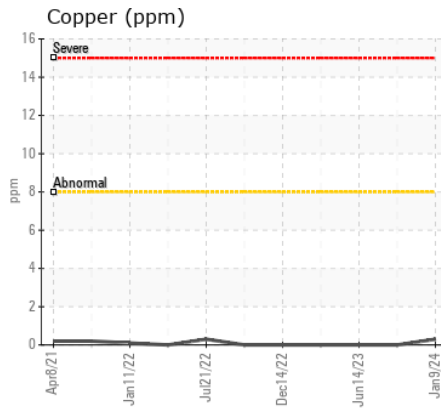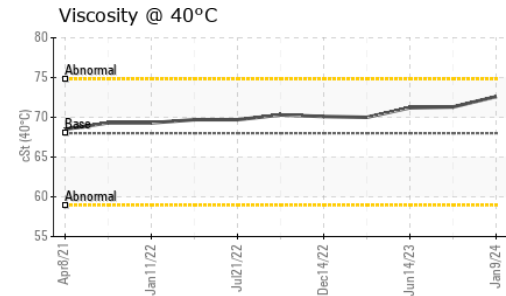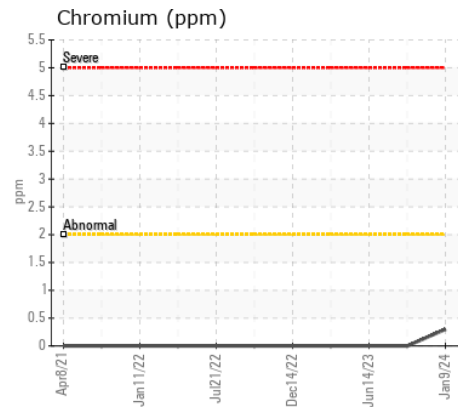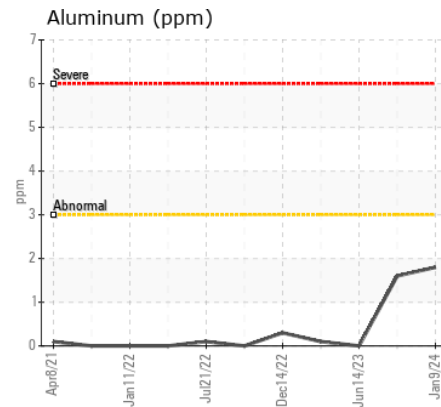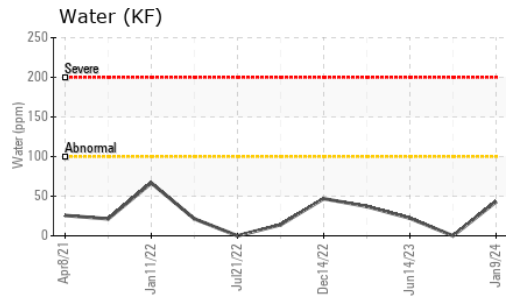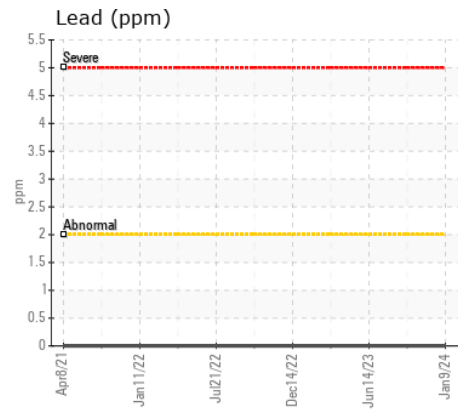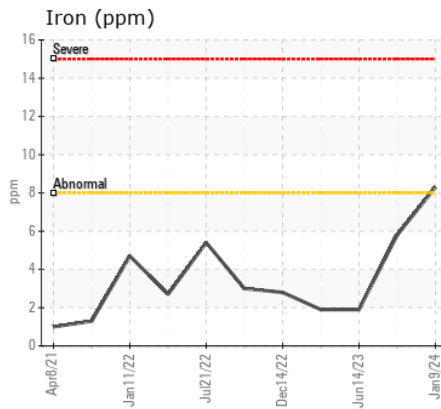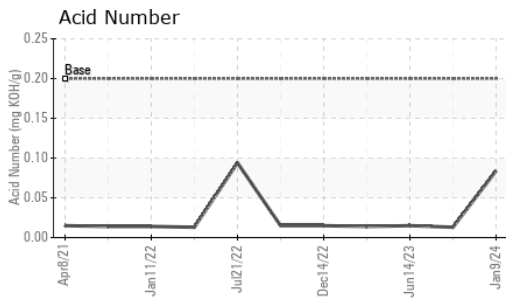

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0848277 **Received** : 11 Jan 2024
Lab Number : 06058776 **Diagnosed** : 16 Jan 2024
Unique Number : 10830158 **Diagnostician** : Jonathan Hester
Test Package : MOB 2 (Additional Tests: KF, TBN)

MONTAUK ENERGY CAPITAL LLC (TEXAS) LP
 1412 N SAM HOUSTON PKWY E, SUITE 100
 HOUSTON, TX
 US 77032
 Contact: DAMON MCCLENAN
 dmcclenan@montaukenergy.com
 T: (713)781-1126
 F: (713)781-1127

Certificate L2367
 To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)