



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**Off Road**  
Machine Id  
**CATERPILLAR 730 AD410 (S/N OAGF00691)**  
Component  
**Center Right Final Drive**  
Fluid  
**DURALENE Dura-Trans TO-4 50 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>WC0674842</b>	WC0615305	WC0395389
Sample Date		Client Info		<b>10 Nov 2023</b>	25 Mar 2022	07 May 2020
Machine Age	hrs	Client Info		<b>17605</b>	17240	16824
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Changd</b>	Not Changd	Not Changd
Filter Changed		Client Info		<b>N/A</b>	N/A	Not Changd
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>800	<b>75</b>	65	67
Chromium	ppm	ASTM D5185m	>10	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185m	>5	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185m	>15	<b>&lt;1</b>	<1	0
Silver	ppm	ASTM D5185m	>2	<b>0</b>	<1	0
Aluminum	ppm	ASTM D5185m	>75	<b>2</b>	5	4
Lead	ppm	ASTM D5185m	>10	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185m	>75	<b>4</b>	4	3
Tin	ppm	ASTM D5185m	>8	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION





There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>400	<b>66</b>	48	50
Potassium	ppm	ASTM D5185m	>20	<b>2</b>	0	1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>0</b>	3	3
Boron	ppm	ASTM D5185m		<b>6</b>	8	7
Barium	ppm	ASTM D5185m		<b>3</b>	0	0
Molybdenum	ppm	ASTM D5185m		<b>&lt;1</b>	1	<1
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	1	1
Magnesium	ppm	ASTM D5185m		<b>18</b>	19	11
Calcium	ppm	ASTM D5185m		<b>3641</b>	3794	3430
Phosphorus	ppm	ASTM D5185m		<b>989</b>	901	790
Zinc	ppm	ASTM D5185m		<b>1155</b>	998	928
Sulfur	ppm	ASTM D5185m		<b>13057</b>	9553	10497
Visc @ 40°C	cSt	ASTM D445		<b>165</b>	168	175

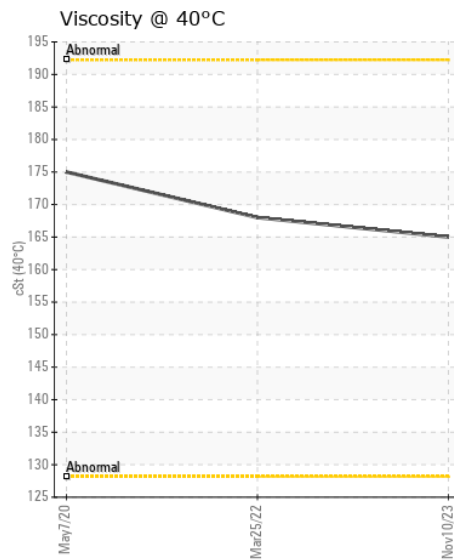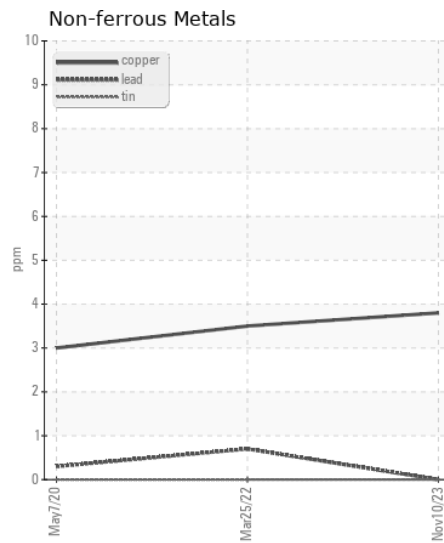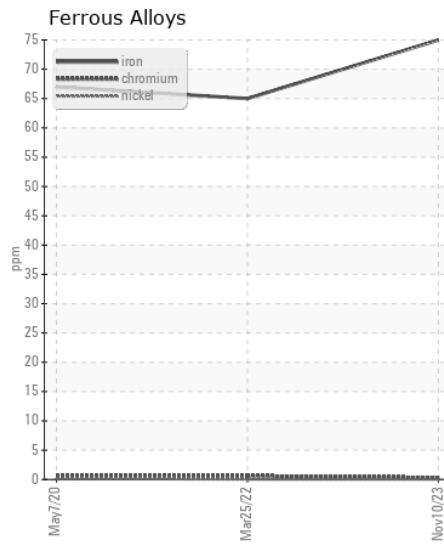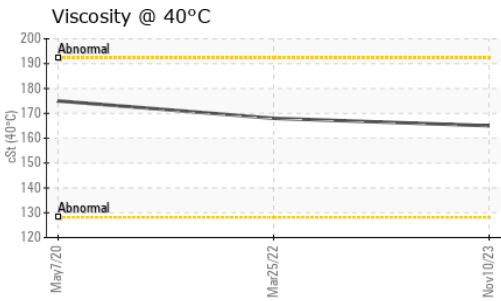

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : WC0674842 **Received** : 17 Jan 2024  
**Lab Number** : 06063219 **Diagnosed** : 18 Jan 2024  
**Unique Number** : 10834601 **Diagnostician** : Wes Davis  
**Test Package** : CONST

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**GRAY & SON INC**  
 430 W PADONIA RD  
 TIMONIUM, MD  
 US 21093-2274  
 Contact: DON WIMER  
 dwimer@graynson.com  
 T: (410)771-4311  
 F: (410)560-0394