



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Area  
**Store 3 - Norton**  
 Machine Id  
**JOHN DEERE 850L D18 (S/N F446525)**  
 Component  
**Transmission**  
 Fluid  
**JOHN DEERE HYDRAU (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LEC0047726</b>	---	---
Sample Date		Client Info		<b>04 Jan 2024</b>	---	---
Machine Age	hrs	Client Info		<b>521</b>	---	---
Oil Age	hrs	Client Info		<b>521</b>	---	---
Filter Age	hrs	Client Info		<b>521</b>	---	---
Oil Changed		Client Info		<b>Not Chngd</b>	---	---
Filter Changed		Client Info		<b>Changed</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

## WEAR

All component wear rates are normal.

PQ		ASTM D8184	>100	<b>13</b>	---	---
Iron	ppm	ASTM D5185m	>61	<b>6</b>	---	---
Chromium	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Nickel	ppm	ASTM D5185m		<b>0</b>	---	---
Titanium	ppm	ASTM D5185m		<b>0</b>	---	---
Silver	ppm	ASTM D5185m		<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>20	<b>0</b>	---	---
Lead	ppm	ASTM D5185m	>9	<b>0</b>	---	---
Copper	ppm	ASTM D5185m	>100	<b>3</b>	---	---
Tin	ppm	ASTM D5185m	>3	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

## CONTAMINATION







There is no indication of any contamination in the fluid.

Silicon	ppm	ASTM D5185m	>21	<b>&lt;1</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>3</b>	---	---
Water		WC Method	>0.075	<b>NEG</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.075	<b>NEG</b>	---	---

## FLUID CONDITION

The condition of the fluid is acceptable for the time in service.

Sodium	ppm	ASTM D5185m	>30	<b>&lt;1</b>	---	---
Boron	ppm	ASTM D5185m		<b>0</b>	---	---
Barium	ppm	ASTM D5185m		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>0</b>	---	---
Manganese	ppm	ASTM D5185m		<b>0</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Calcium	ppm	ASTM D5185m	87	<b>97</b>	---	---
Phosphorus	ppm	ASTM D5185m	727	<b>660</b>	---	---
Zinc	ppm	ASTM D5185m	900	<b>834</b>	---	---
Sulfur	ppm	ASTM D5185m	1500	<b>1728</b>	---	---
Visc @ 40°C	cSt	ASTM D445	65	<b>59.5</b>	---	---

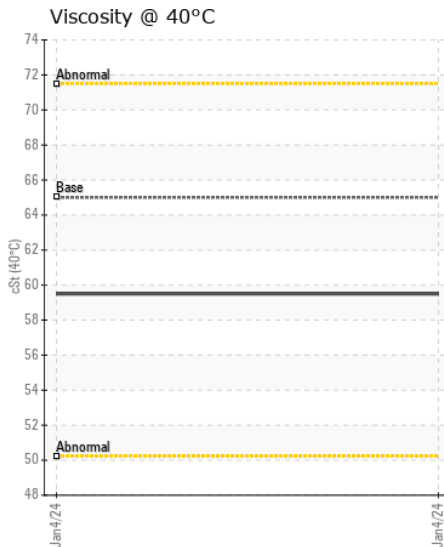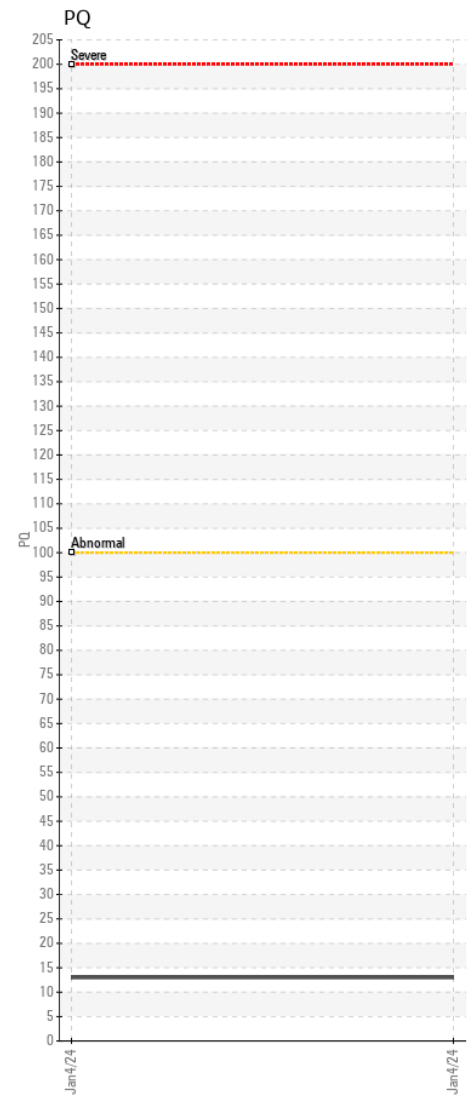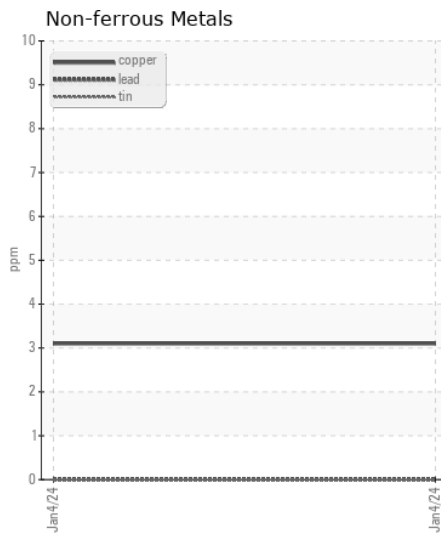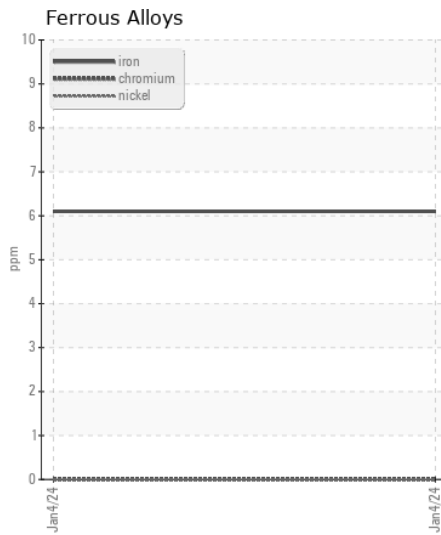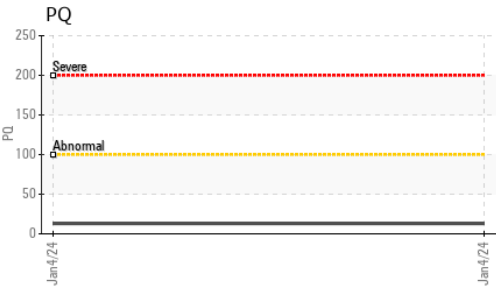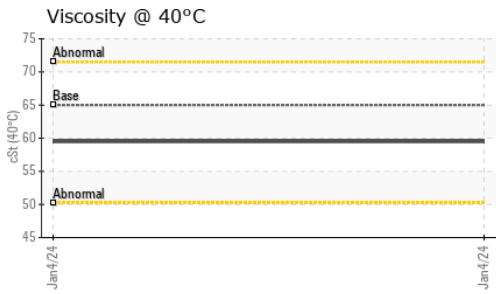

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : LEC0047726 **Received** : 17 Jan 2024  
**Lab Number** : 06063817 **Diagnosed** : 19 Jan 2024  
**Unique Number** : 10835199 **Diagnostician** : Wes Davis  
**Test Package** : CONST ( Additional Tests: PQ )

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**LANE PIPELINE**  
 2946 E MAIN ST  
 BRIDGEPORT, WV  
 US 26330

Contact: JESSE WILBURN  
 jessewilburn@gmail.com

T: (740)440-0927

F: