WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL NORMAL

THOMAS GILLINGHAM [SAM] **VOLVO PENTA 3950008373**


Port IPS

GEAR OIL SAE 75W90 (6 GAL)					.,		
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.	Sample Number		Client Info		VPA059088		
	Sample Date		Client Info		10 Jan 2024		
	Machine Age	hrs	Client Info		352		
	Oil Age	hrs	Client Info		192		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	PQ		ASTM D8184		15		
All component wear rates are normal.	Iron	ppm	ASTM D5185m	>200	48		
	Chromium	ppm	ASTM D5185m	>10	<1		
	Nickel	ppm	ASTM D5185m	>10	0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		2		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		8		
	Tin	ppm	ASTM D5185m		0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION The water content is negligible. There is no indication of any contamination in the oil.	Silicon	ppm	ASTM D5185m		4		
	Potassium	ppm	ASTM D5185m	>20	5		
	Water	%	ASTM D6304	>0.2	0.148		
	ppm Water	ppm	ASTM D6304	>2000	1480		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	0.2%		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		0		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	400	301		
	Barium	ppm	ASTM D5185m	200	0		
	Molybdenum	ppm	ASTM D5185m	12	0		
	Manganese	ppm	ASTM D5185m		3		
	Magnesium	ppm	ASTM D5185m		43		
	Calcium	ppm	ASTM D5185m		8		
	Phosphorus	ppm	ASTM D5185m		1333		
	Zinc	ppm	ASTM D5185m		0		
	Sulfur	ppm	ASTM D5185m	22500	25015		

Visc @ 40°C

102

ASTM D445 109

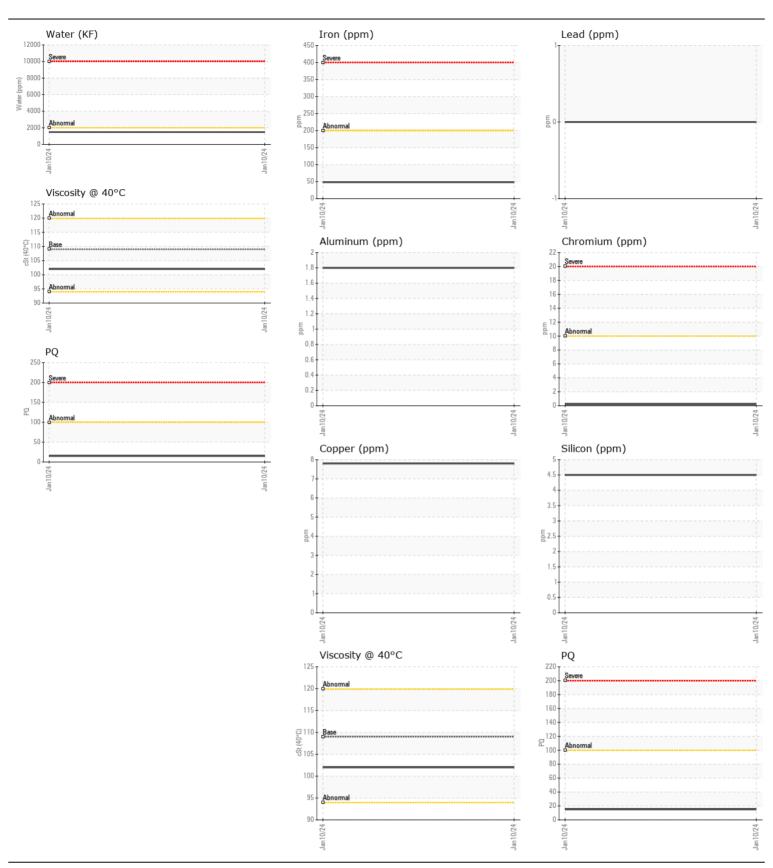



Laboratory Sample No.

Lab Number **Unique Number**

: VPA059088 : 06065177 : 10836559

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 18 Jan 2024 : 22 Jan 2024 Diagnosed

: Sean Felton Diagnostician Test Package : MOB 1 (Additional Tests: KF, PQ)

Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. Endor Marine LLC - Coastal Marine - 152124

4300 11th Ave. NW SEATTLE, WA US 98107

Contact: WILLOW YANARELLA service@coastalmarineengine.com T: (206)784-3703

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (206)784-8823