WEAR CONTAMINATION **FLUID CONDITION**


NORMAL NORMAL NORMAL


Machine Id


CR-6609 - OUTER


Component Rear Left Track Drive

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number	OOW	Client Info	LIIIIU/ADII	WC0873371		
Resample at the next service interval to monitor. Please specify the component make and model with your next sample. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Date		Client Info		08 Jan 2024		
	Machine Age	hrs	Client Info		17421		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
VEA D							
VEAR	Iron	ppm	ASTM D5185m		26		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		<1		
	Nickel	ppm	ASTM D5185m	>7	0		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		2		
	Lead	ppm	ASTM D5185m		<1		
	Copper	ppm	ASTM D5185m		8		
	Tin	ppm	ASTM D5185m	>5	<1		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>150	<1		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	2		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	LIGHT		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
THIR CONDITION							
FLUID CONDITION	Sodium	ppm	ASTM D5185m	F.0	0		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		7		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m	15	<1		
	Manganese	ppm	ASTM D5185m	F0	0		
	Magnesium	ppm	ASTM D5185m		0		
	Calcium	ppm	ASTM D5185m	50	3		
	Phosphorus	ppm	ASTM D5185m		335		
	Zinc	ppm		100	0		
	Sulfur	ppm	ASTM D5185m		6289		
	Visc @ 40°C	cSt	ASTM D445	220	216		

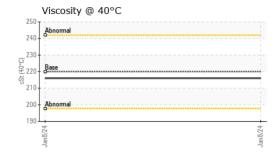

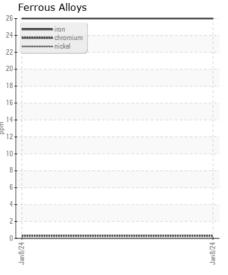

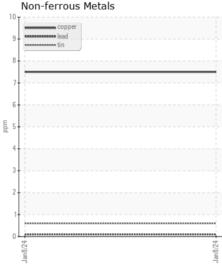

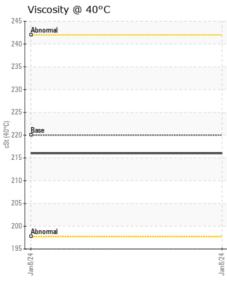



Certificate L2367

Laboratory Sample No. Lab Number

: WC0873371 : 06074178 Unique Number : 10856269 Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 30 Jan 2024 Diagnosed : 31 Jan 2024 Diagnostician : Wes Davis

BUCKNER HEAVY LIFT 4732 NC 54 EAST GRAHAM, NC US 27253-9215

Contact: MICHAEL LAWSON michaell@bucknercompanies.com

T: (336)376-8888 F: (336)376-4090

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)