

## JOHN DEERE 944X 03734

## Component Rear Left Final Drive

JOHN DEERE HY-GARD HYD/TRANS (--- GAL)

JOHN DEERE HT-GARD HTD/TRANS ( G	<b>AL</b> )						
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		MT0005813		
	Sample Date		Client Info		24 Jan 2024		
	Machine Age	hrs	Client Info		469		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	PQ		ASTM D8184	>1250	15		
All component wear rates are normal.	Iron	ppm	ASTM D5185m	>750	6		
	Chromium	ppm	ASTM D5185m	>9	<1		
	Nickel	ppm	ASTM D5185m	>10	0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>40	2		
	Lead	ppm	ASTM D5185m	>15	0		
	Copper	ppm	ASTM D5185m	>40	8		
	Tin	ppm	ASTM D5185m	>10	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION There is no indication of any contamination in the oil.	Silicon	ppm	ASTM D5185m		18		
	Potassium	ppm	ASTM D5185m		2		
	Water		WC Method	>0.075	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.075	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m	>51	0		
	Boron	ppm	ASTM D5185m		2		
The condition of the oil is acceptable for the time in service.	Barium	ppm	ASTM D5185m		4		
	Molybdenum	ppm	ASTM D5185m		<1		
	Manganese	ppm	ASTM D5185m	v	<1		
	Magnesium	ppm	ASTM D5185m	145	102		
	Calcium		ASTM D5185m		3362		
		ppm					
	Phosphorus	ppm	ASTM D5185m		1017		
	Zinc	ppm	ASTM D5185m	1040	1226		
	Sulfur	ppm	ASTM D5185m		4000		


Visc @ 40°C

cSt

ASTM D445 57.0

Contact/Location: DUSTIN DAILEY - MURCAM

57.4

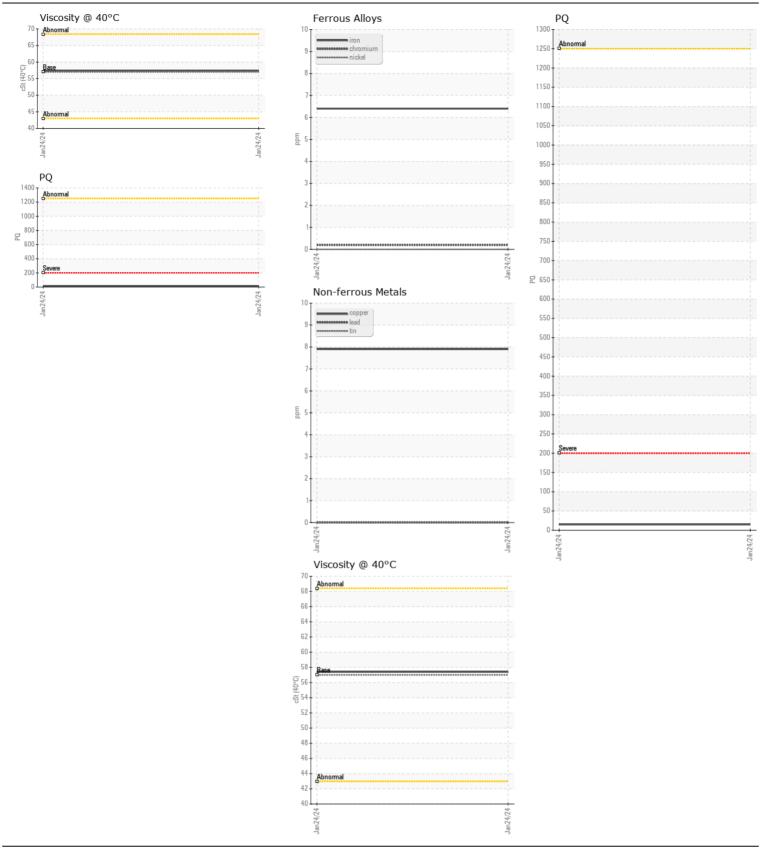

**MURPHY TRACTOR - CAMBRIDGE** Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. Recieved : 31 Jan 2024 60611 HULSE DRIVE : MT0005813 Lab Number :01 Feb 2024 CAMBRIDGE, OH : 06076044 Diagnosed : 10858135 Diagnostician : Sean Felton US 43725 Unique Number Test Package : CONST (Additional Tests: PQ) Contact: DUSTIN DAILEY Certificate L2367 DDAILEY@MURPHYTRACTOR.COM To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (740)439-2325

Contact/Location: DUSTIN DAILEY - MURCAM

Page 2 of 2