
**WEAR** CONTAMINATION **FLUID CONDITION** 


**NORMAL NORMAL NORMAL** 


Machine Id **933033** 


Component Transmission (Auto)

PETRO CANADA DuraDrive HD Synthetic 668	( GAL)						
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		GFL0092163		
	Sample Date		Client Info		05 Feb 2024		
	Machine Age	hrs	Client Info		2403		
	Oil Age	hrs	Client Info		600		
	Filter Age	hrs	Client Info		600		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>160	68		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>5	<1		
	Nickel	ppm	ASTM D5185m	>5	<1		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m	>5	<1		
	Aluminum	ppm	ASTM D5185m	>50	18		
	Lead	ppm	ASTM D5185m	>50	23		
	Copper	ppm	ASTM D5185m	>225	11		
	Tin	ppm	ASTM D5185m	>10	2		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>20	4		
There is no indication of any contamination in the fluid.	Potassium	ppm	ASTM D5185m		2		
	Water	1-1-	WC Method		NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		5		
	Boron	ppm	ASTM D5185m		87		
The condition of the fluid is acceptable for the time in service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		1		
	Magnesium	ppm	ASTM D5185m		8		
	Calcium	ppm	ASTM D5185m		0		
	Phosphorus	ppm	ASTM D5185m		258		
	Zinc	ppm	ASTM D5185m		2		
	Sulfur	ppm	ASTM D5185m		1195		
	Visc @ 40°C	cSt	ASTM D445	3/1	34.7		

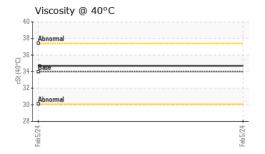

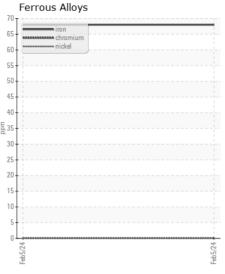

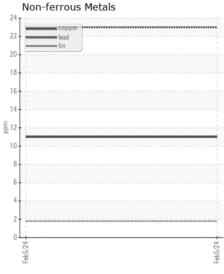

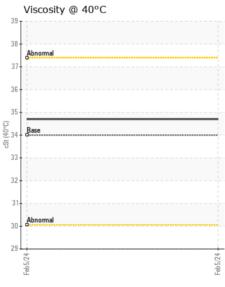



Certificate L2367

Laboratory Sample No.

: GFL0092163 Lab Number : 06082867 Unique Number : 10870312 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 07 Feb 2024 **Tested** : 08 Feb 2024

Diagnosed : 09 Feb 2024 - Don Baldridge

GFL Environmental - 856 - Houston South

8515 Highway 6 South Houston, TX US 77083

Contact: Apolinar Zacarias pzacariascano@gflenv.com

T:

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: