



| | |
|-----------------|---------------|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |



Machine Id
MACK 732000
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|----------------|-----|-------------|-----------|--------------------|-------------|-------------|
| Sample Number | | Client Info | | GFL0109584 | GFL0087502 | GFL0087468 |
| Sample Date | | Client Info | | 07 Feb 2024 | 30 Nov 2023 | 14 Sep 2023 |
| Machine Age | hrs | Client Info | | 5241 | 4696 | 4165 |
| Oil Age | hrs | Client Info | | 545 | 1174 | 643 |
| Filter Age | hrs | Client Info | | 545 | 1174 | 643 |
| Oil Changed | | Client Info | | Not Changd | Changed | Not Changd |
| Filter Changed | | Client Info | | Not Changd | Changed | Not Changd |
| Sample Status | | | | NORMAL | NORMAL | NORMAL |

WEAR

All component wear rates are normal.

| | | | | | | |
|--------------|--------|-------------|------|--------------|------|------|
| Iron | ppm | ASTM D5185m | >75 | 8 | 11 | 8 |
| Chromium | ppm | ASTM D5185m | >5 | <1 | 1 | 1 |
| Nickel | ppm | ASTM D5185m | >4 | <1 | <1 | <1 |
| Titanium | ppm | ASTM D5185m | >2 | <1 | <1 | <1 |
| Silver | ppm | ASTM D5185m | >2 | 0 | 0 | 0 |
| Aluminum | ppm | ASTM D5185m | >15 | 2 | 3 | 2 |
| Lead | ppm | ASTM D5185m | >25 | 1 | 3 | 2 |
| Copper | ppm | ASTM D5185m | >100 | 1 | 2 | 1 |
| Tin | ppm | ASTM D5185m | >4 | <1 | <1 | 2 |
| Vanadium | ppm | ASTM D5185m | | 0 | <1 | 0 |
| White Metal | scalar | *Visual | NONE | NONE | NONE | NONE |
| Yellow Metal | scalar | *Visual | NONE | NONE | NONE | NONE |

CONTAMINATION







There is no indication of any contamination in the oil.

| | | | | | | |
|------------------|----------|-------------|-------|----------------|-------|-------|
| Silicon | ppm | ASTM D5185m | >25 | 3 | 4 | 5 |
| Potassium | ppm | ASTM D5185m | >20 | 4 | 0 | 4 |
| Fuel | | WC Method | >3.0 | <1.0 | <1.0 | <1.0 |
| Water | | WC Method | >0.2 | NEG | NEG | NEG |
| Glycol | | WC Method | | NEG | NEG | NEG |
| Soot % | % | *ASTM D7844 | >6 | 0 | 0 | 0.1 |
| Nitration | Abs/cm | *ASTM D7624 | >20 | 11.6 | 12.6 | 10.6 |
| Sulfation | Abs/.1mm | *ASTM D7415 | >30 | 22.2 | 26.9 | 21.6 |
| Silt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Debris | scalar | *Visual | NONE | NONE | NONE | NONE |
| Sand/Dirt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Appearance | scalar | *Visual | NORML | NORML | NORML | NORML |
| Odor | scalar | *Visual | NORML | NORML | NORML | NORML |
| Emulsified Water | scalar | *Visual | >0.2 | NEG | NEG | NEG |

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

| | | | | | | |
|------------------|----------|-------------|------|--------------|------|------|
| Sodium | ppm | ASTM D5185m | | 3 | 11 | 7 |
| Boron | ppm | ASTM D5185m | 0 | 7 | 8 | 7 |
| Barium | ppm | ASTM D5185m | 0 | <1 | <1 | 44 |
| Molybdenum | ppm | ASTM D5185m | 60 | 54 | 65 | 60 |
| Manganese | ppm | ASTM D5185m | 0 | <1 | <1 | 1 |
| Magnesium | ppm | ASTM D5185m | 1010 | 546 | 585 | 533 |
| Calcium | ppm | ASTM D5185m | 1070 | 1543 | 1768 | 1514 |
| Phosphorus | ppm | ASTM D5185m | 1150 | 695 | 765 | 670 |
| Zinc | ppm | ASTM D5185m | 1270 | 974 | 970 | 937 |
| Sulfur | ppm | ASTM D5185m | 2060 | 2484 | 2327 | 2565 |
| Oxidation | Abs/.1mm | *ASTM D7414 | >25 | 19.0 | 22.4 | 17.6 |
| Base Number (BN) | mg KOH/g | ASTM D2896 | 9.8 | 4.3 | 3.8 | 4.5 |
| Visc @ 100°C | cSt | ASTM D445 | 15.4 | 15.1 | 14.6 | 14.4 |

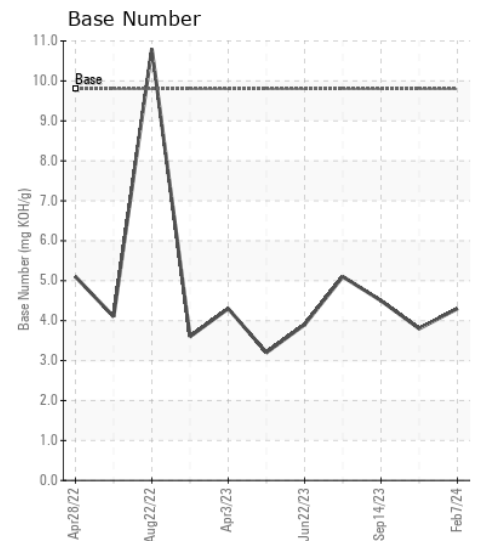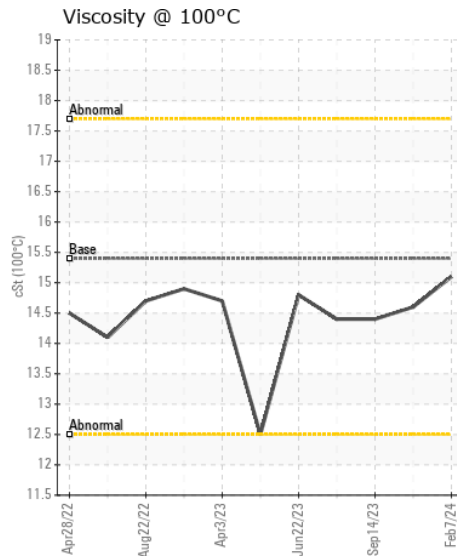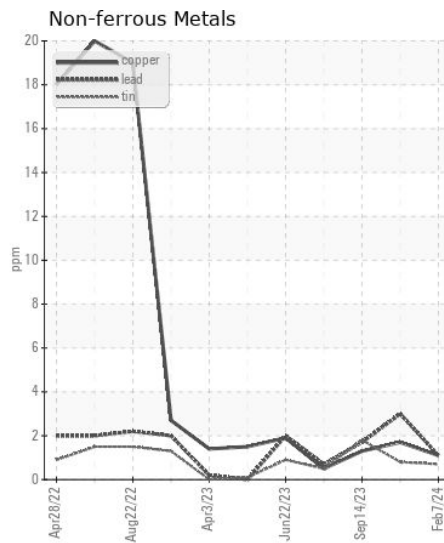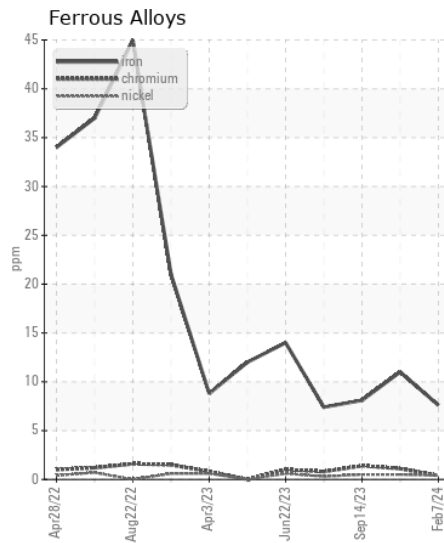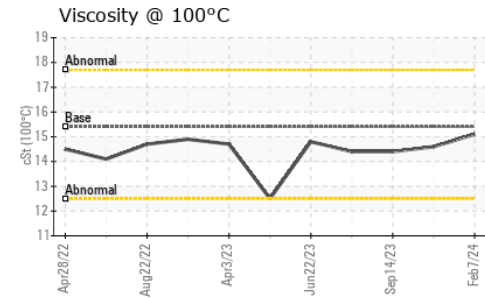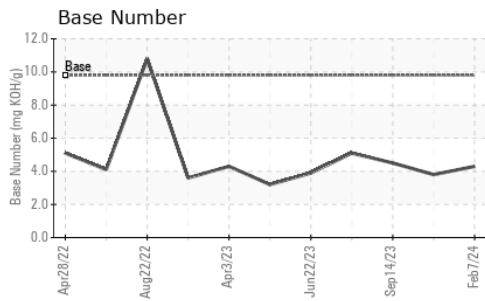

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : GFL0109584
Lab Number : 06083346
Unique Number : 10870791
Test Package : FLEET

Received : 08 Feb 2024
Tested : 08 Feb 2024
Diagnosed : 09 Feb 2024 - Don Baldrige

GFL Environmental - 331 - Columbus
 180 Ada Moore Rd
 Columbus, NC
 US 28722

Contact: Matt Segars
 matt.segars@gflenv.com
 T: (800)207-6618
 F: (252)617-2494

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)