
WEAR CONTAMINATION FLUID CONDITION **NORMAL NORMAL NORMAL**

[W20998-FASTRAC]

JOHN DEERE 245G 1FF245GXLNF802923

Component Rear Left Final Drive

JOHN DEERE GL-5 80W90 (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		JR0204481		
	Sample Date		Client Info		05 Feb 2024		
	Machine Age	hrs	Client Info		427		
	Oil Age	hrs	Client Info		427		
	Filter Age	hrs	Client Info		427		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
WEAR	PQ		ASTM D8184	>1250	264		
All component wear rates are normal.	Iron	ppm	ASTM D5185m		376		
	Chromium	ppm	ASTM D5185m		6		
	Nickel	ppm	ASTM D5185m	>10	<1		
	Titanium	ppm	ASTM D5185m		1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>40	6		
	Lead	ppm	ASTM D5185m	>15	0		
	Copper	ppm	ASTM D5185m	>40	1		
	Tin	ppm	ASTM D5185m	>10	0		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION There is no indication of any contamination in the oil.	Silicon	ppm	ASTM D5185m	>75	45		
	Potassium	ppm	ASTM D5185m	>20	<1		
	Water		WC Method	>0.075	NEG		
	Silt	scalar	*Visual	NONE	LIGHT		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.075	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m	>51	2		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		57		
	Barium	ppm	ASTM D5185m		5		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		7		
	Magnesium	ppm	ASTM D5185m		1		
	Calcium	ppm	ASTM D5185m		53		
	Phosphorus	ppm	ASTM D5185m		422		
	Zinc	ppm	ASTM D5185m		30		
	Sulfur	ppm	ASTM D5185m		15231		
	Visc @ 40°C	cSt	ASTM D445		188		

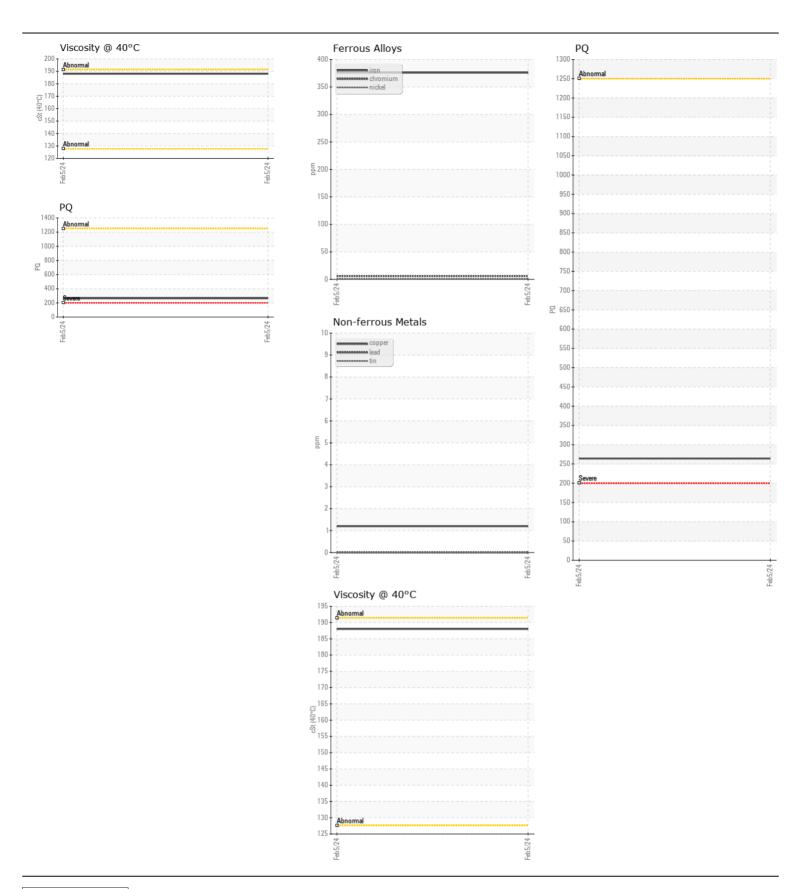



Laboratory Sample No.

Lab Number : 06085484 Unique Number: 10872929

: JR0204481

Test Package : CONST (Additional Tests: PQ)

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 09 Feb 2024 : 12 Feb 2024 **Tested**

Diagnosed

: 13 Feb 2024 - Jonathan Hester

JRE - BURKEVILLE 510 WEST COLONIAL DR BURKEVILLE, VA US 23922

Contact: BRANDON BOLLING bbolling@jamesriverequipment.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

T: (434)767-5578 F: (434)767-3774