

**WEAR** CONTAMINATION **FLUID CONDITION**  **NORMAL NORMAL NORMAL** 


Machine Id **612003** 


Component Left Planetary

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Number		Client Info		WC06087758		
	Sample Date		Client Info		12 Feb 2024		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR	Iron	nnm	ACTM DE10Em	· E00	26		
All component wear rates are normal.	Iron Chromium	ppm	ASTM D5185m ASTM D5185m		26		
	Nickel	ppm	ASTM D5185m		<1 0		
	Titanium	ppm	ASTM D5185m	>10	0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>25	1		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		1		
	Tin	ppm	ASTM D5185m		- <1		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m		10		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		0		
	Water		WC Method		NEG		
	Silt	scalar	*Visual	NONE	MODER		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		3		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		14		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		2		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		15		
	Calcium	ppm	ASTM D5185m		3293		
	Phosphorus	ppm	ASTM D5185m		921		
	Zinc	ppm	ASTM D5185m		1242		
	Sulfur	ppm	ASTM D5185m		12219		

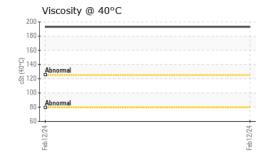

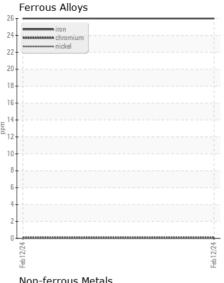

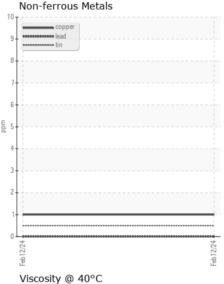

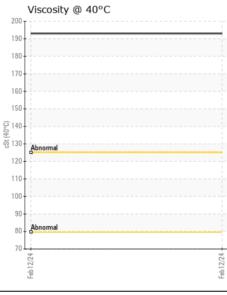



Certificate L2367

Laboratory Sample No. Unique Number : 10875203

Lab Number : 06087758

: WC06087758

Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 13 Feb 2024 : 14 Feb 2024 **Tested** 

> : 15 Feb 2024 - Jonathan Hester Diagnosed

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

LANCASTER DEVELOPMENT

145 PODPADIC ROAD RICHMONDVILLE, NY

US 12149

Contact: Service Manager

T:

F: