


Machine Id **1457** Component **Diesel Engine** Fluid **PETRO CANADA DURON SHP 15W40 (--- GAL)**

	<i>l</i>						
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. Please specify the component make and model with your next sample.	Sample Number		Client Info		GFL0103561		
	Sample Date		Client Info		07 Feb 2024		
	Machine Age	hrs	Client Info		9164		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR All component wear rates are normal.							
	Iron	ppm	ASTM D5185m		11		
	Chromium	ppm	ASTM D5185m		<1		
	Nickel	ppm	ASTM D5185m	>4	0		
	Titanium	ppm	ASTM D5185m	0	0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		4		
	Lead	ppm	ASTM D5185m		<1		
	Copper	ppm	ASTM D5185m		1		
	Tin	ppm	ASTM D5185m	>15	<1		
	Vanadium	ppm	ASTM D5185m	NONE	0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	-	8		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		<1		
	Fuel		WC Method		<1.0		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method		NEG		
	Soot %	%	*ASTM D7844		0.5		
	Nitration	Abs/cm	*ASTM D7624	>20	10.1		
	Sulfation	Abs/.1mm	*ASTM D7415		23.1		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		7		
	Boron	ppm	ASTM D5185m	0	1		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.	Barium	ppm	ASTM D5185m	0	0		
	Molybdenum	ppm	ASTM D5185m	60	57		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		958		
	Calcium	ppm	ASTM D5185m		991		
	Phosphorus	ppm	ASTM D5185m		932		
	Zinc	ppm	ASTM D5185m		1185		
	Sulfur	ppm	ASTM D5185m		2778		
	Oxidation	Abs/.1mm	*ASTM D7414		21.5		
	Base Number (BN)				5.2		
	. , ,	÷ 0					

Visc @ 100°C cSt

13.0

ASTM D445 15.4

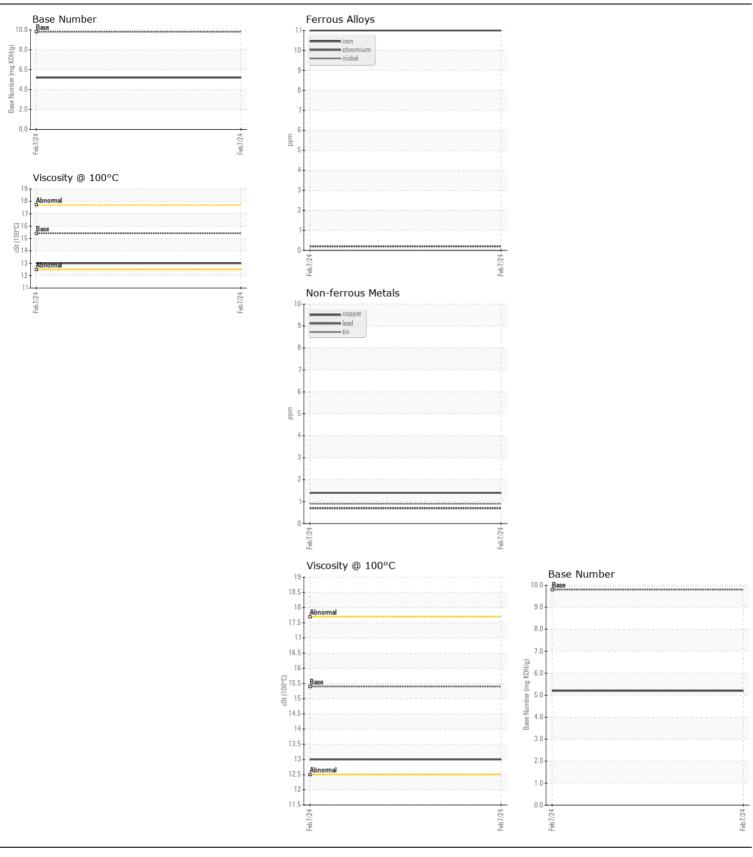

GFL Environmental - 958 - Tri County HC Morton Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : GFL0103561 Received : 14 Feb 2024 1090 W. Jefferson St. Morton, IL Lab Number : 06089310 Tested : 15 Feb 2024 Unique Number : 10876755 Diagnosed : 15 Feb 2024 - Wes Davis US 61550 Test Package : FLEET Contact: Erika Downs Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F:

Contact/Location: See also GFL961 - Erika Downs - GFL958