



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Area  
**[HILLS CREEK TIMBER]**  
 Machine Id  
**JOHN DEERE 748L-II 717487**  
 Component  
**Rear Differential**  
 Fluid  
**{not provided} (--- QTS)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>JR0177094</b>	---	---
Sample Date		Client Info		<b>21 Feb 2024</b>	---	---
Machine Age	hrs	Client Info		<b>481</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Changed</b>	---	---
Filter Changed		Client Info		<b>Changed</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

### WEAR

All component wear rates are normal.

PQ		ASTM D8184		<b>45</b>	---	---
Iron	ppm	ASTM D5185m	>500	<b>115</b>	---	---
Chromium	ppm	ASTM D5185m	>10	<b>&lt;1</b>	---	---
Nickel	ppm	ASTM D5185m	>10	<b>1</b>	---	---
Titanium	ppm	ASTM D5185m		<b>0</b>	---	---
Silver	ppm	ASTM D5185m		<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>25	<b>1</b>	---	---
Lead	ppm	ASTM D5185m	>25	<b>3</b>	---	---
Copper	ppm	ASTM D5185m	>100	<b>20</b>	---	---
Tin	ppm	ASTM D5185m	>10	<b>1</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

### CONTAMINATION







There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>75	<b>9</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>3</b>	---	---
Water		WC Method	>.2	<b>NEG</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>.2	<b>NEG</b>	---	---

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>3</b>	---	---
Boron	ppm	ASTM D5185m		<b>3</b>	---	---
Barium	ppm	ASTM D5185m		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>2</b>	---	---
Manganese	ppm	ASTM D5185m		<b>6</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>117</b>	---	---
Calcium	ppm	ASTM D5185m		<b>4188</b>	---	---
Phosphorus	ppm	ASTM D5185m		<b>1246</b>	---	---
Zinc	ppm	ASTM D5185m		<b>1496</b>	---	---
Sulfur	ppm	ASTM D5185m		<b>4947</b>	---	---
Visc @ 40°C	cSt	ASTM D445		<b>55.2</b>	---	---

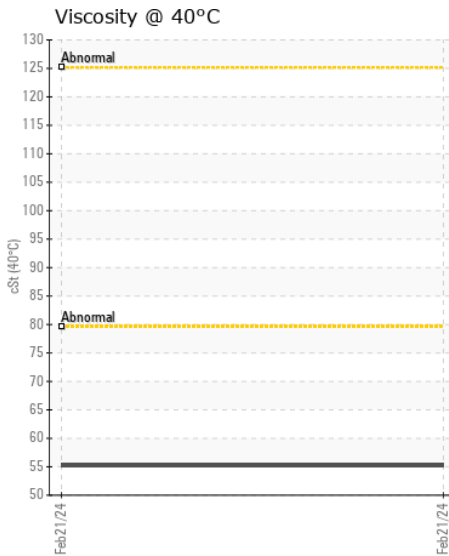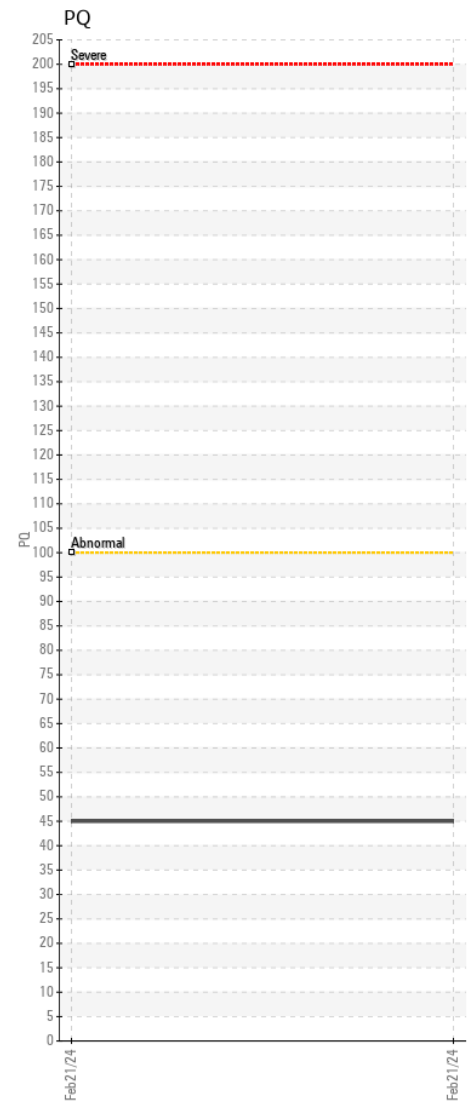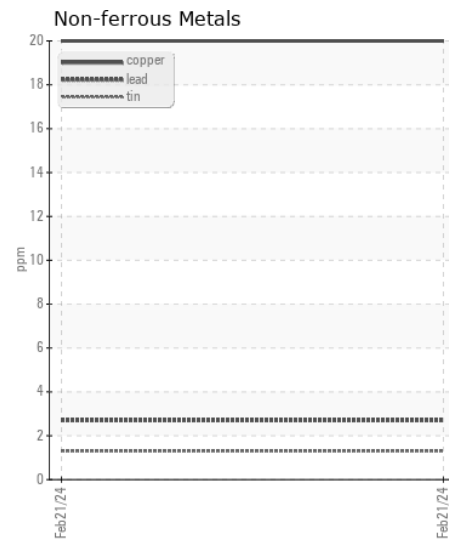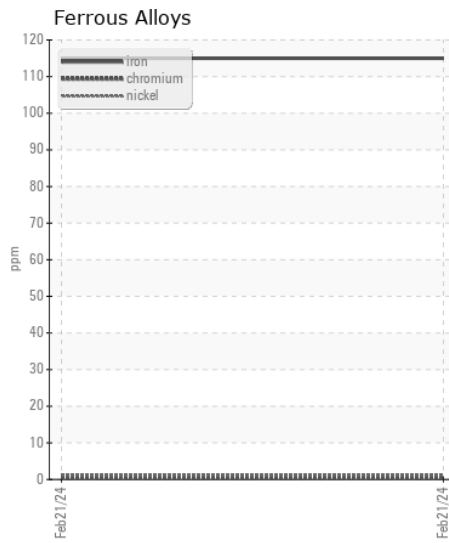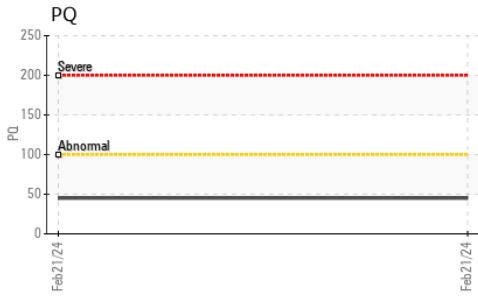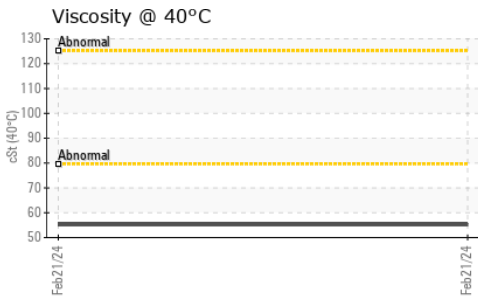

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : JR0177094 **Received** : 23 Feb 2024  
**Lab Number** : 06099381 **Tested** : 26 Feb 2024  
**Unique Number** : 10897611 **Diagnosed** : 27 Feb 2024 - Don Baldrige  
**Test Package** : CONST ( Additional Tests: PQ )

**JRE - MOUNT GILEAD**  
 305 NORTH MAIN STREET  
 MOUNT GILEAD, NC  
 US 27306

Contact: ADAM CRUMP  
 adam.crump@jamesriverequipment.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (910)439-4568