WEAR CONTAMINATION FLUID CONDITION


NORMAL NORMAL NORMAL



JOHN DEERE 250D 1DW250DXTDE652468

Component Rear Right Final Drive

JOHN DEERE GL-5 80W90 (GAL)						
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		JR0200442	JR0049223	
	Sample Date		Client Info		22 Feb 2024	08 Jun 2020	
	Machine Age	hrs	Client Info		7964	5972	
	Oil Age	hrs	Client Info		0	0	
	Filter Age	hrs	Client Info		0	0	
	Oil Changed		Client Info		Changed	Changed	
	Filter Changed		Client Info		N/A	N/A	
	Sample Status				NORMAL	NORMAL	
WEAR	PQ		ASTM D8184	>1250	18	68	
All component wear rates are normal.	Iron	ppm	ASTM D5185m	>750	150	194	
	Chromium	ppm	ASTM D5185m	>9	1	2	
	Nickel	ppm	ASTM D5185m	>10	2	3	
	Titanium	ppm	ASTM D5185m		<1	<1	
	Silver	ppm	ASTM D5185m		0	0	
	Aluminum	ppm	ASTM D5185m	>40	<1	3	
	Lead	ppm	ASTM D5185m	>15	0	0	
	Copper	ppm	ASTM D5185m		2	2	
	Tin	ppm	ASTM D5185m	>10	0	<1	
	Vanadium	ppm	ASTM D5185m		0	0	
	White Metal	scalar	*Visual	NONE	NONE	VLITE	
	Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
CONTAMINATION There is no indication of any contamination in the oil.	Silicon	ppm	ASTM D5185m	>75	4	8	
	Potassium	ppm	ASTM D5185m	>20	<1	2	
	Water		WC Method	>0.075	NEG	NEG	
	Silt	scalar	*Visual	NONE	NONE	NONE	
	Debris	scalar	*Visual	NONE	NONE	VLITE	
	Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
	Appearance	scalar	*Visual	NORML	NORML	NORML	
	Odor	scalar	*Visual	NORML	NORML	NORML	
	Emulsified Water	scalar	*Visual	>0.075	NEG	NEG	
FLUID CONDITION	Sodium	ppm	ASTM D5185m	>51	3	1	
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		35	26	
	Barium	ppm	ASTM D5185m		0	0	
	Molybdenum	ppm	ASTM D5185m		14	16	
	Manganese	ppm	ASTM D5185m		2	2	
	Magnesium	ppm	ASTM D5185m		4	<1	
	Calcium	ppm	ASTM D5185m		15	20	
	Phosphorus	ppm	ASTM D5185m		2437	1103	
	Zinc	ppm	ASTM D5185m		2	23	
	Sulfur	ppm	ASTM D5185m		29764	17068	
	Visc @ 40°C	cSt	ASTM D445		151	133	

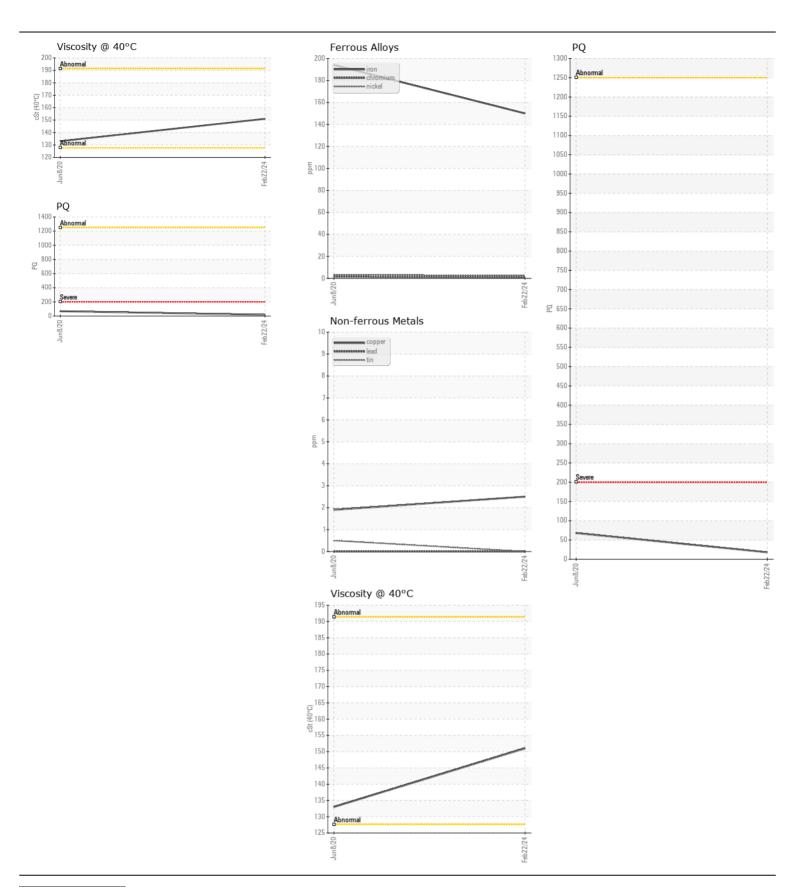



Report Id: HENWILJR [WUSCAR] 06101965 (Generated: 02/29/2024 15:22:18) Rev: 1

Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Lab Number : 06101965 Unique Number : 10900195

: JR0200442

To discuss this sample report, contact Customer Service at 1-800-237-1369.

Received : 27 Feb 2024 **Tested** Diagnosed

Test Package : CONST (Additional Tests: PQ)

: 28 Feb 2024 : 29 Feb 2024 - Sean Felton 5806 MOORETOWN RD WILLIAMSBURG, VA US 23188

HENDERSON INC

Contact: TERRY THOMPSON terry@hendersoninc.com T: (757)603-0418

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: TERRY THOMPSON - HENWILJR