WEAR CONTAMINATION FLUID CONDITION


NORMAL NORMAL





VOLVO EC550E 550E310264


Component Swing Drive

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		ASC0007661		
	Sample Date		Client Info		23 Feb 2024		
	Machine Age	hrs	Client Info		488		
	Oil Age	hrs	Client Info		488		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>1200	264		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		5		
	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>25	2		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m	>50	37		
	Tin	ppm	ASTM D5185m	>10	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTANUNATION							
CONTAMINATION	Silicon	ppm	ASTM D5185m	>100	23		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		1		
	Water		WC Method	>0.25	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual *Visual	NORML	NORML		
<u></u>	Emulsified Water	Sudiai	VISUAI	>0.25	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		2		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		0		
	Barium	ppm	ASTM D5185m		2		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		6		
	Magnesium	ppm	ASTM D5185m		1		
	Calcium	ppm	ASTM D5185m		10		
	Phosphorus	ppm	ASTM D5185m		327		
	Zinc	ppm	ASTM D5185m		19		
	Sulfur	ppm	ASTM D5185m		14719		
	Visc @ 40°C	cSt	ASTM D445		176	J	

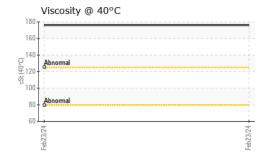

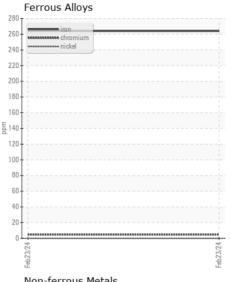

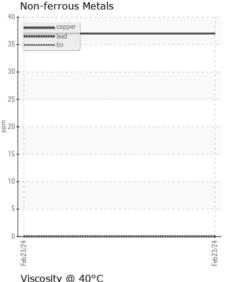

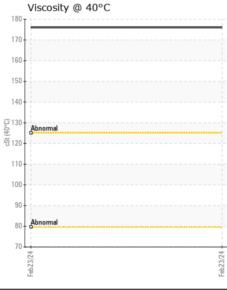



Certificate L2367

Laboratory Sample No.

: ASC0007661 Lab Number : 06102071 Unique Number : 10900301 Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 27 Feb 2024 **Tested**

: 28 Feb 2024 : 29 Feb 2024 - Jonathan Hester Diagnosed

PARAGON SITE SOLUTIONS LLC 665 SEWARD AVE NW #301

CHARLOTTE, NC US 28273

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: