
WEAR CONTAMINATION **FLUID CONDITION**

NORMAL ABNORMAL SEVERE

MATTEI 10019251

Component Compressor

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number	OOW	Client Info	LITTIONOTT	AN37233		
Recommend drain oil if not already done and flush with cleaner before refilling with oil. We recommend an early resample to monitor this condition.	Sample Date		Client Info		16 Feb 2024		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				SEVERE		
WEAR	Iron	ppm	ASTM D5185m		13		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>10	0		
	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m	0.5	0		
	Aluminum	ppm	ASTM D5185m		5		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		9		
	Tin	ppm	ASTM D5185m	>15	<1		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>25	2		
There is a light concentration of water present in the oil.	Potassium	ppm	ASTM D5185m	>20	0		
	Water	%	ASTM D6304	>0.1	△ 0.107		
	ppm Water	ppm	ASTM D6304	>1000	<u> </u>		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
FLUID CONDITION	Sodium	nnm	ASTM D5185m		11		
The AN level is above the recommended limit. TAN level indicates possible presence of varnish. The oil is no longer serviceable.	Boron	ppm	ASTM D5185m		<1		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		0		
	Magnesium	ppm	ASTM D5185m		<1		
	Calcium	ppm	ASTM D5185m		3		
	Phosphorus	ppm	ASTM D5185m		741		
	Zinc	ppm	ASTM D5185m		85		
	Sulfur	ppm	ASTM D5185m		32		
		PP.11					
	Acid Number (AN)	mg KOH/g	ASTM D8045		8.128		

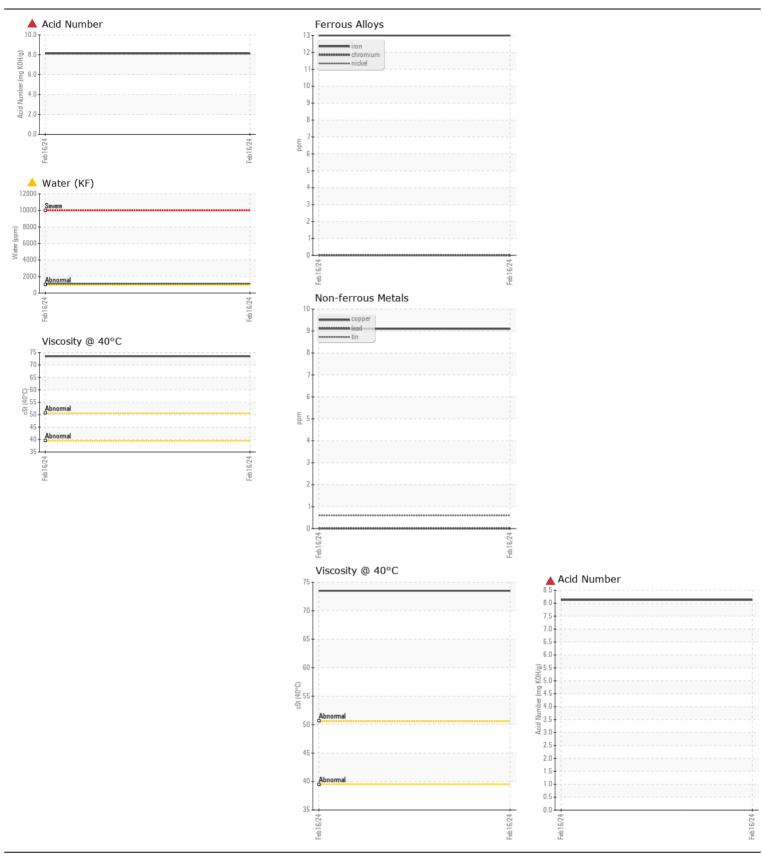





Certificate L2367

Laboratory Sample No.

: AN37233 Lab Number : 06103058 Unique Number: 10901288 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 28 Feb 2024 : 01 Mar 2024 **Tested**

: 01 Mar 2024 - Jonathan Hester Diagnosed

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

MATTEI COMPRESSORS--OEM

9635 LIBERTY ROAD, SUITE E RANDALLSTOWN, MD

US 21133 Contact: MARTY WARD

jward@matteicomp.com T: (410)521-7020

F: (410)521-7024