



WEAR	ABNORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area
BEALETON

Machine Id
JOHN DEERE 944K M02-0913 1DW944KXKML703638

Component
Front Left Final Drive

Fluid
JOHN DEERE HYDRAU (--- GAL)

RECOMMENDATION

The oil change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		JR0175984	JR0146445	JR0123222
Sample Date		Client Info		01 Feb 2024	13 Oct 2022	12 Apr 2022
Machine Age	hrs	Client Info		3563	1626	500
Oil Age	hrs	Client Info		2000	1403	500
Filter Age	hrs	Client Info		300	1403	500
Oil Changed		Client Info		Changed	Changed	Not Changd
Filter Changed		Client Info		Changed	Changed	Not Changd
Sample Status				ABNORMAL	ABNORMAL	NORMAL

WEAR

The copper level is abnormal. All other component wear rates are normal.

PQ		ASTM D8184	>1250	24	13	21
Iron	ppm	ASTM D5185m	>750	26	33	11
Chromium	ppm	ASTM D5185m	>9	0	0	<1
Nickel	ppm	ASTM D5185m	>10	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	<1
Aluminum	ppm	ASTM D5185m	>40	<1	<1	<1
Lead	ppm	ASTM D5185m	>15	2	0	<1
Copper	ppm	ASTM D5185m	>40	▲ 124	▲ 132	3
Tin	ppm	ASTM D5185m	>10	<1	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE

CONTAMINATION








There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>75	27	49	15
Potassium	ppm	ASTM D5185m	>20	0	2	0
Water		WC Method	>0.075	NEG	NEG	NEG
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.075	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m	>51	2	1	0
Boron	ppm	ASTM D5185m		11	8	0
Barium	ppm	ASTM D5185m		0	3	0
Molybdenum	ppm	ASTM D5185m		8	2	5
Manganese	ppm	ASTM D5185m		0	<1	<1
Magnesium	ppm	ASTM D5185m		118	90	116
Calcium	ppm	ASTM D5185m	87	3169	3433	3558
Phosphorus	ppm	ASTM D5185m	727	958	990	1062
Zinc	ppm	ASTM D5185m	900	1129	1199	1125
Sulfur	ppm	ASTM D5185m	1500	3217	3926	3209
Visc @ 40°C	cSt	ASTM D445	65	365	52.9	55.3

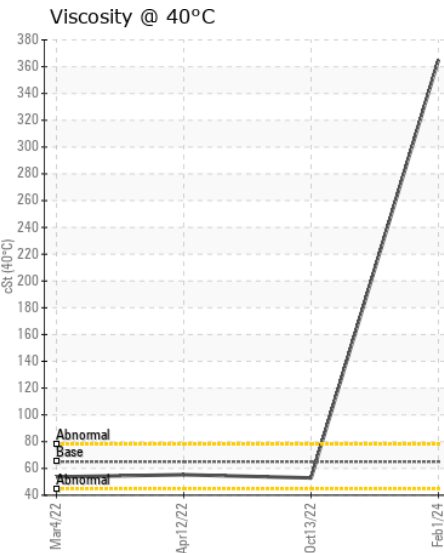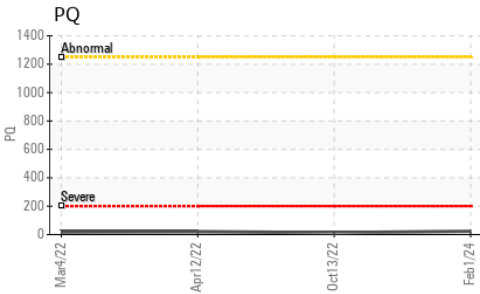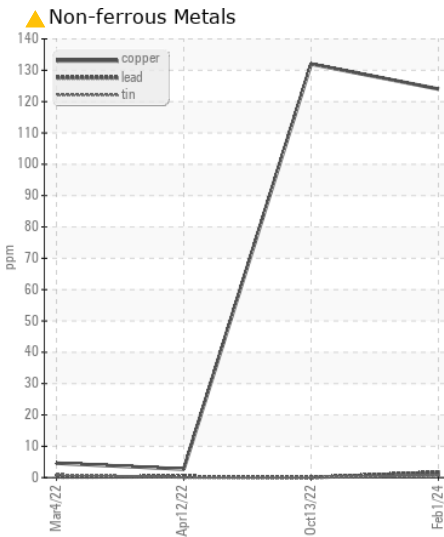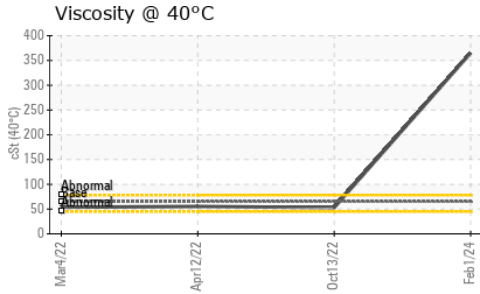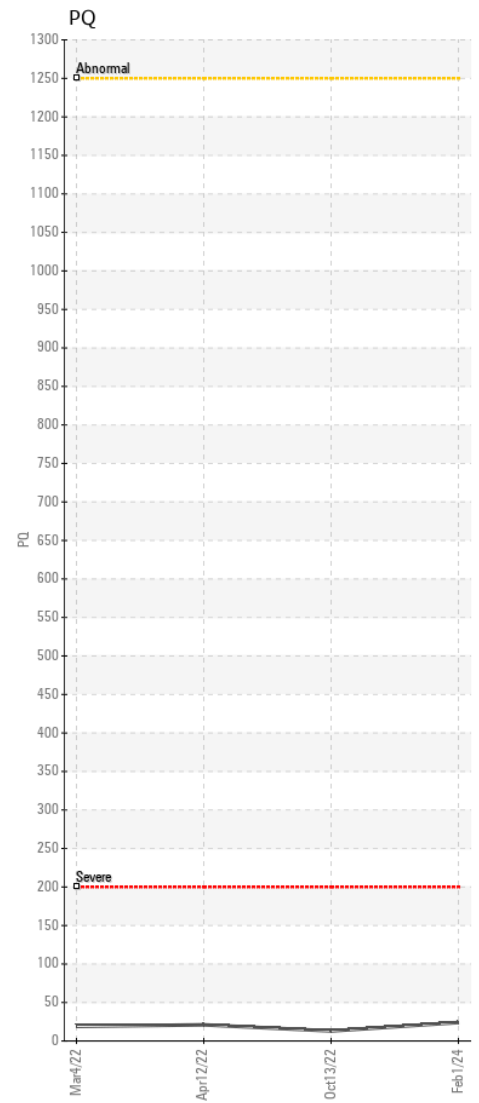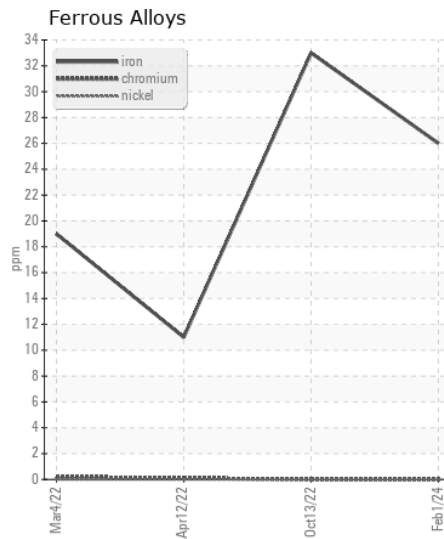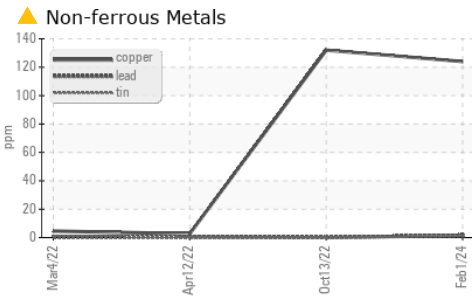

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : JR0175984 **Received** : 28 Feb 2024
Lab Number : 06103207 **Tested** : 01 Mar 2024
Unique Number : 10901437 **Diagnosed** : 01 Mar 2024 - Sean Felton
Test Package : CONST (Additional Tests: PQ)

LUCK STONE
 19380 RICHMOND TURNPIKE
 MILFORD, VA
 US 22514
 Contact: BRYAN MORRIS
 bmorris@luckstone.com
 T: (804)400-3630
 F: x:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)