

**WEAR CONTAMINATION FLUID CONDITION** 

**SEVERE NORMAL NORMAL** 

## LIEBHERR LR1600 CR-6607 - OUTER (S/N 074580)

Rear Left Final Drive							
GEAR OIL ISO 220 ( GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
The oil change at the time of sampling has been noted. We advise that you inspect for the source(s) of wear. We recommend an early resample to monitor this condition.	Sample Number		Client Info		WC0823568		
	Sample Date		Client Info		22 Feb 2024		
	Machine Age	hrs	Client Info		15138		
	Oil Age	hrs	Client Info		1397		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				SEVERE		
WEAR	Iron	ppm	ASTM D5185m	>500	51		
Bearing and/or bushing wear is indicated.	Chromium	ppm	ASTM D5185m	>10	<1		
	Nickel	ppm	ASTM D5185m	>10	1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>25	<1		
	Lead	ppm	ASTM D5185m	>25	15		
	Copper	ppm	ASTM D5185m	>50	<b>232</b>		
	Tin	ppm	ASTM D5185m	>10	1		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	MODER		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>75	6		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	2		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		0		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	50	13		
	Barium	ppm	ASTM D5185m	15	1		
	Molybdenum	ppm	ASTM D5185m	15	1		
	Manganese	ppm	ASTM D5185m		1		
	Magnesium	ppm	ASTM D5185m	50	<1		
	Calcium	ppm	ASTM D5185m	50	4		
	Phosphorus	ppm	ASTM D5185m	350	441		
	Zinc	ppm	ASTM D5185m	100	167		
	Sulfur	ppm	ASTM D5185m	12500	8256		
	Visc @ 40°C	cSt	ASTM D445	220	208		

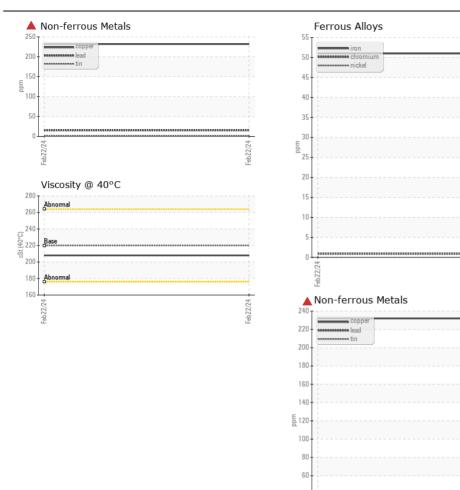

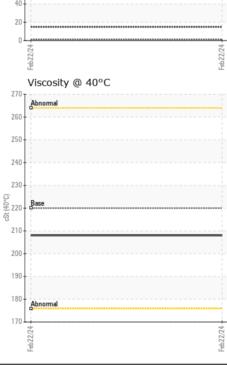



Certificate L2367

Laboratory

Sample No.

: WC0823568 Lab Number : 06103887 Unique Number : 10902117 Test Package : CONST

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 28 Feb 2024 **Tested** : 29 Feb 2024

> : 01 Mar 2024 - Don Baldridge Diagnosed

**BUCKNER HEAVY LIFT** 

4732 NC 54 EAST GRAHAM, NC US 27253-9215

F: (336)376-4090

Contact: MICHAEL LAWSON

michaell@bucknercompanies.com T: (336)376-8888

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)