
**WEAR CONTAMINATION FLUID CONDITION** 


**NORMAL NORMAL NORMAL** 


## LIEBHERR LR1600 CR-6607 - INNER (S/N 074580)


Component Rear Left Final Drive

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number	CON	Client Info	Little/tori	WC0823569		
Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Date		Client Info		22 Feb 2024		
	Machine Age	hrs	Client Info		15138		
	Oil Age	hrs	Client Info		1397		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
	·						
VEAR	Iron	ppm	ASTM D5185m		174		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>10	2		
	Nickel	ppm	ASTM D5185m	>10	1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		1		
	Lead	ppm	ASTM D5185m		<1		
	Copper	ppm	ASTM D5185m		12		
	Tin	ppm	ASTM D5185m	>10	<1		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>75	10		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	2		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	<b>Emulsified Water</b>	scalar	*Visual	>0.2	NEG		
LUID CONDITION	Ca di		ACTM DE105		•		
	Sodium	ppm	ASTM D5185m	EO	0		
The condition of the oil is acceptable for the time in service.	Boron Barium	ppm	ASTM D5185m ASTM D5185m		17		
		ppm			1		
	Molybdenum	ppm	ASTM D5185m	15	1		
	Manganese	ppm	ASTM D5185m	50	2		
	Magnesium Calcium	ppm	ASTM D5185m		10		
		ppm	ASTM D5185m	50	19		
	Phosphorus	ppm	ASTM D5185m		407		
	Zino	nnm		7/1/1			
	Zinc Sulfur	ppm	ASTM D5185m ASTM D5185m		16 6994		

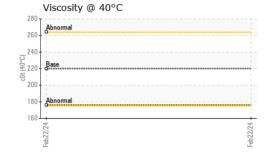

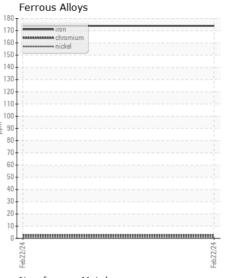

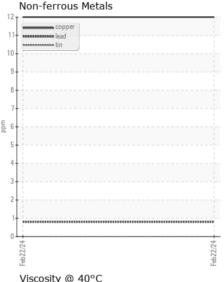

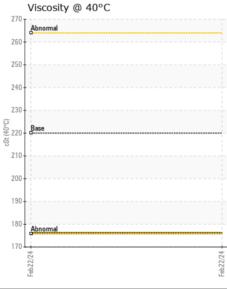



Certificate L2367

Laboratory Sample No.

: WC0823569 Lab Number : 06103888 Unique Number : 10902118 Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 28 Feb 2024 : 29 Feb 2024 **Tested** Diagnosed

: 29 Feb 2024 - Wes Davis

**BUCKNER HEAVY LIFT** 4732 NC 54 EAST

GRAHAM, NC US 27253-9215

Contact: MICHAEL LAWSON michaell@bucknercompanies.com

T: (336)376-8888 F: (336)376-4090

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)