



VOLVO

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	ABNORMAL
FLUID CONDITION	NORMAL



Area
[688229 WASTE CONN]
Machine Id
VOLVO L150 7318
Component
Hydraulic System
Fluid
VOLVO SUPER HYDRAULIC OIL 46 (--- GAL)

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP455290	---	---
Sample Date		Client Info		15 Mar 2024	---	---
Machine Age	hrs	Client Info		250	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		Not Changed	---	---
Filter Changed		Client Info		Not Changed	---	---
Sample Status				ABNORMAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>50	0	---	---
Chromium	ppm	ASTM D5185m	>20	0	---	---
Nickel	ppm	ASTM D5185m	>10	0	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m		0	---	---
Aluminum	ppm	ASTM D5185m	>20	0	---	---
Lead	ppm	ASTM D5185m	>20	0	---	---
Copper	ppm	ASTM D5185m	>20	<1	---	---
Tin	ppm	ASTM D5185m	>20	<1	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

CONTAMINATION







Moderate concentration of visible dirt/debris present in the oil.

Silicon	ppm	ASTM D5185m	>20	<1	---	---
Potassium	ppm	ASTM D5185m	>20	0	---	---
Water		WC Method	>0.2	NEG	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	▲ MODER	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<1	---	---
Boron	ppm	ASTM D5185m	14	0	---	---
Barium	ppm	ASTM D5185m	0.0	0	---	---
Molybdenum	ppm	ASTM D5185m	0.0	0	---	---
Manganese	ppm	ASTM D5185m	0.0	<1	---	---
Magnesium	ppm	ASTM D5185m	2.6	<1	---	---
Calcium	ppm	ASTM D5185m	49	53	---	---
Phosphorus	ppm	ASTM D5185m	354	333	---	---
Zinc	ppm	ASTM D5185m	419	436	---	---
Sulfur	ppm	ASTM D5185m	3719	1498	---	---
Acid Number (AN)	mg KOH/g	ASTM D8045		0.51	---	---
Visc @ 40°C	cSt	ASTM D445	46	43.0	---	---

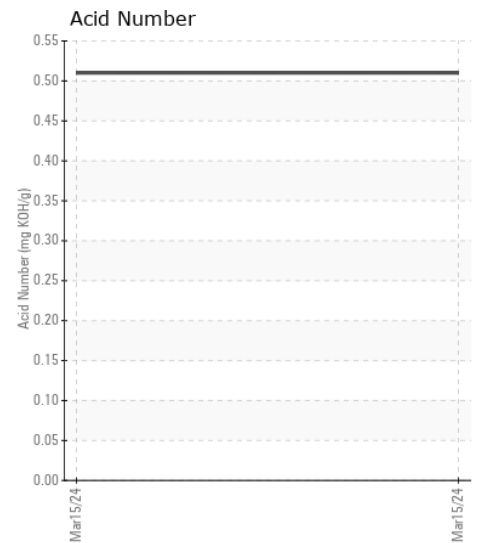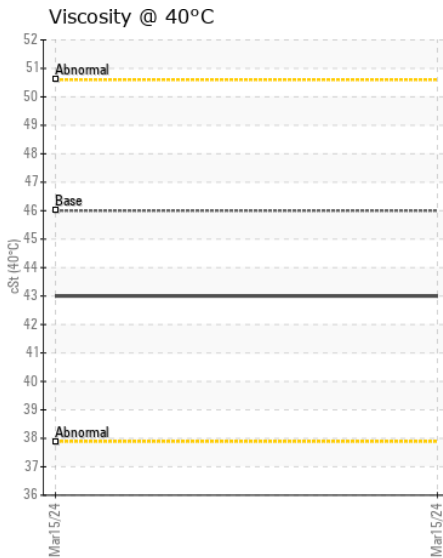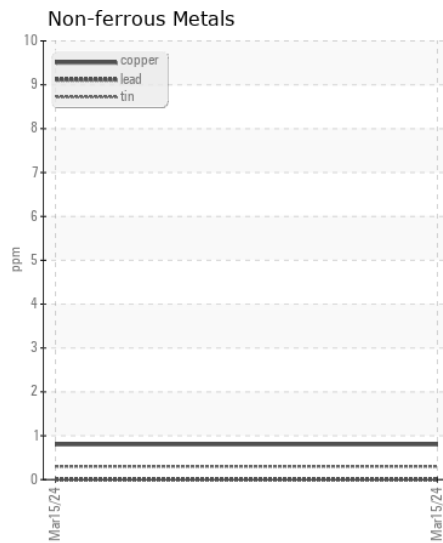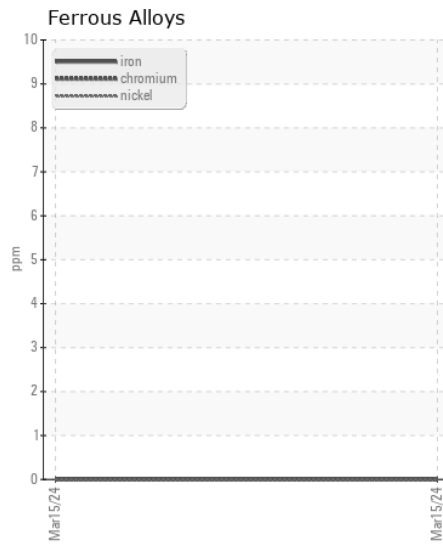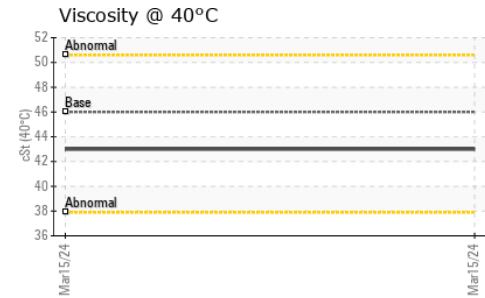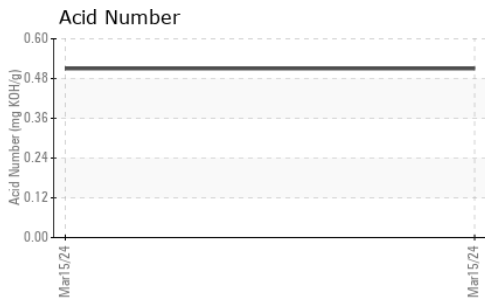

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP455290
Lab Number : 06123584
Unique Number : 10937735
Test Package : MOB 2

Received : 20 Mar 2024
Tested : 25 Mar 2024
Diagnosed : 25 Mar 2024 - Jonathan Hester

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC
 8418 PALM RIVER ROAD
 TAMPA, FL
 US 33619

Contact: KENNY HANEY
 khaney@flaglerce.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (813)630-0077
 F: (813)630-2233