



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**WIRTGEN WR250i 11WR0260**  
 Component  
**Rear Right Final Drive**  
 Fluid  
**JOHN DEERE GL-5 80W90 (--- GAL)**

### RECOMMENDATION

The oil change at the time of sampling has been noted. Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>JR0179524</b>	---	---
Sample Date		Client Info		<b>19 Mar 2024</b>	---	---
Machine Age	hrs	Client Info		<b>458</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Changed</b>	---	---
Filter Changed		Client Info		<b>N/A</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

### WEAR

Metal levels are typical for a new component breaking in.

PQ		ASTM D8184		<b>164</b>	---	---
Iron	ppm	ASTM D5185m	>500	<b>577</b>	---	---
Chromium	ppm	ASTM D5185m	>10	<b>12</b>	---	---
Nickel	ppm	ASTM D5185m	>10	<b>2</b>	---	---
Titanium	ppm	ASTM D5185m		<b>1</b>	---	---
Silver	ppm	ASTM D5185m		<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>25	<b>2</b>	---	---
Lead	ppm	ASTM D5185m	>25	<b>0</b>	---	---
Copper	ppm	ASTM D5185m	>50	<b>8</b>	---	---
Tin	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>MODER</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

### CONTAMINATION







There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>75	<b>8</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>1</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	---	---

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>16</b>	---	---
Boron	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Barium	ppm	ASTM D5185m		<b>164</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>0</b>	---	---
Manganese	ppm	ASTM D5185m		<b>8</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Calcium	ppm	ASTM D5185m		<b>85</b>	---	---
Phosphorus	ppm	ASTM D5185m		<b>1799</b>	---	---
Zinc	ppm	ASTM D5185m		<b>25</b>	---	---
Sulfur	ppm	ASTM D5185m		<b>30217</b>	---	---
Visc @ 40°C	cSt	ASTM D445		<b>156</b>	---	---

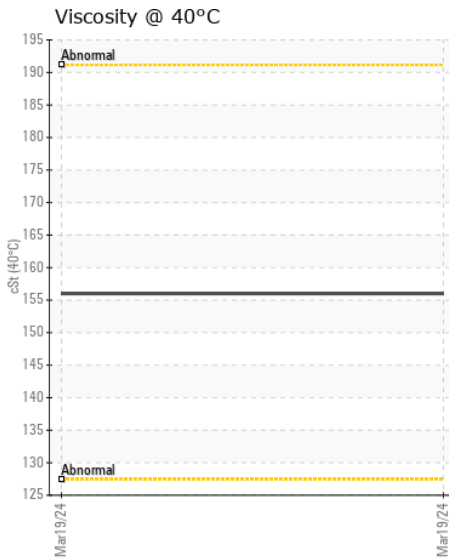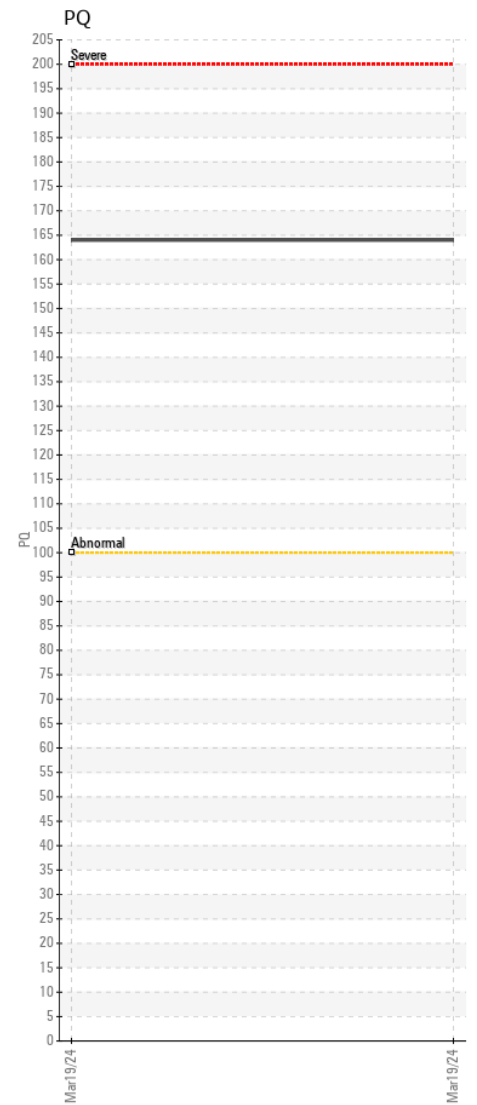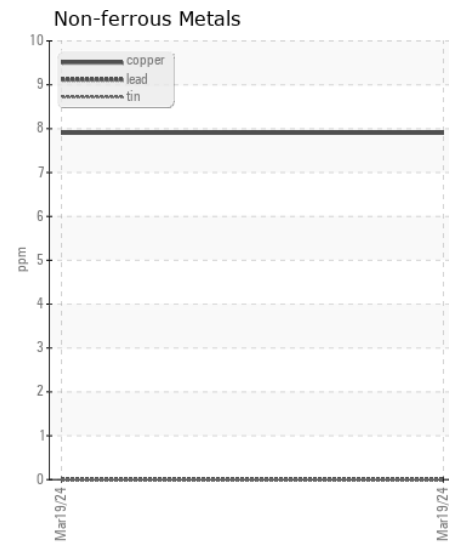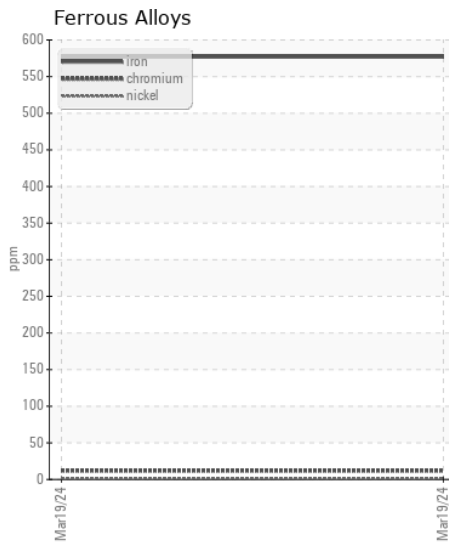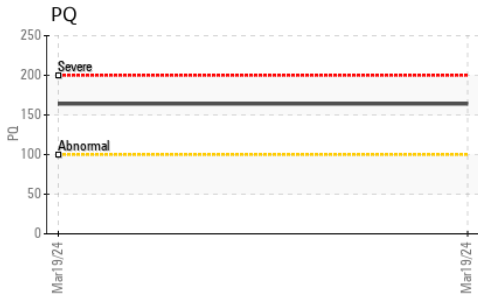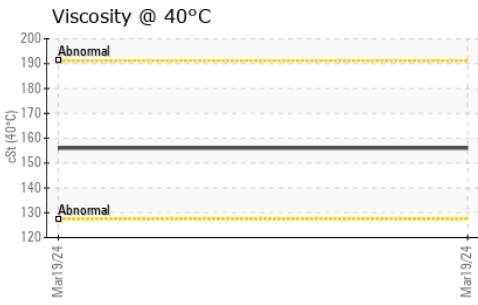

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : JR0179524 **Received** : 21 Mar 2024  
**Lab Number** : 06125843 **Tested** : 25 Mar 2024  
**Unique Number** : 10939994 **Diagnosed** : 25 Mar 2024 - Don Baldrige  
**Test Package** : CONST ( Additional Tests: PQ )

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**JRE - ASHLAND**  
 11047 LEADBETTER RD  
 ASHLAND, VA  
 US 23005  
 Contact: DAVID ZIEG  
 dzieg@jamesriverequipment.com  
 T: (804)798-6001  
 F: (804)798-0292