



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**LIEBHERR LH50M 141510**  
Component  
**Rear Differential**  
Fluid  
**GEAR OIL SAE 80W90 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>DJJ0021895</b>	---	---
Sample Date		Client Info		<b>05 Apr 2024</b>	---	---
Machine Age	hrs	Client Info		<b>3823</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Changed</b>	---	---
Filter Changed		Client Info		<b>N/A</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>150	<b>23</b>	---	---
Chromium	ppm	ASTM D5185m	>2	<b>0</b>	---	---
Nickel	ppm	ASTM D5185m	>2	<b>0</b>	---	---
Titanium	ppm	ASTM D5185m		<b>0</b>	---	---
Silver	ppm	ASTM D5185m	>4	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>7	<b>0</b>	---	---
Lead	ppm	ASTM D5185m	>4	<b>0</b>	---	---
Copper	ppm	ASTM D5185m	>135	<b>70</b>	---	---
Tin	ppm	ASTM D5185m	>3	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

## CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>30	<b>1</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>0</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>LIGHT</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	---	---

## FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m	>170	<b>2</b>	---	---
Boron	ppm	ASTM D5185m	400	<b>5</b>	---	---
Barium	ppm	ASTM D5185m	200	<b>5</b>	---	---
Molybdenum	ppm	ASTM D5185m	12	<b>8</b>	---	---
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Magnesium	ppm	ASTM D5185m	12	<b>1</b>	---	---
Calcium	ppm	ASTM D5185m	150	<b>376</b>	---	---
Phosphorus	ppm	ASTM D5185m	1650	<b>493</b>	---	---
Zinc	ppm	ASTM D5185m	125	<b>190</b>	---	---
Sulfur	ppm	ASTM D5185m	22500	<b>18525</b>	---	---
Visc @ 40°C	cSt	ASTM D445	143	<b>103</b>	---	---

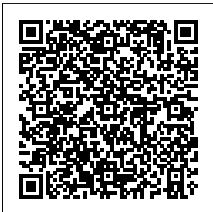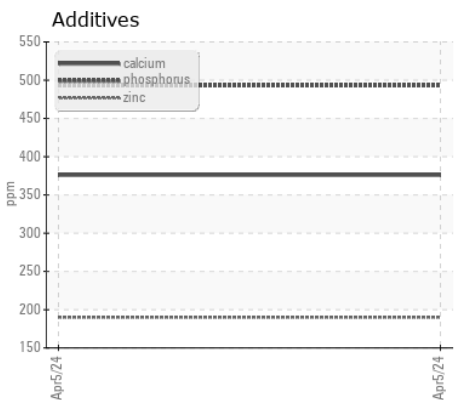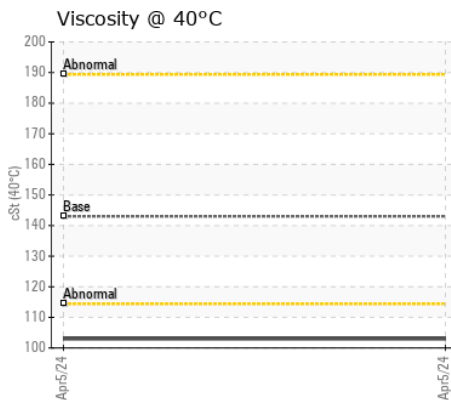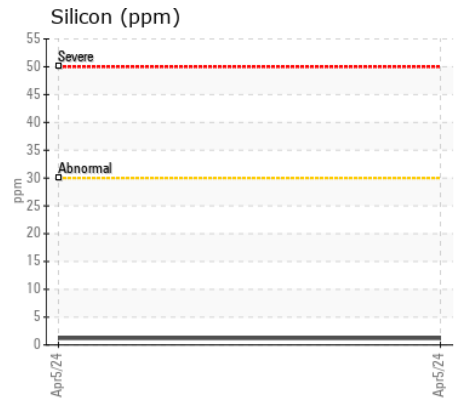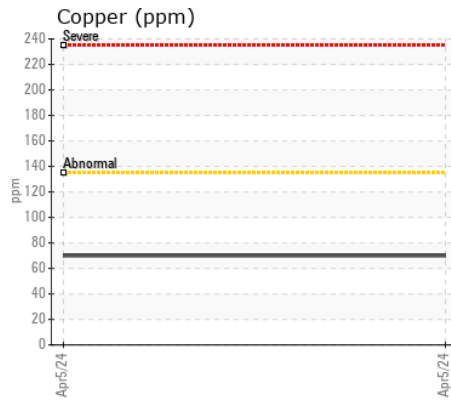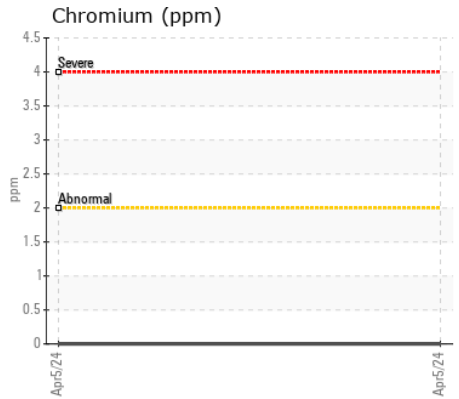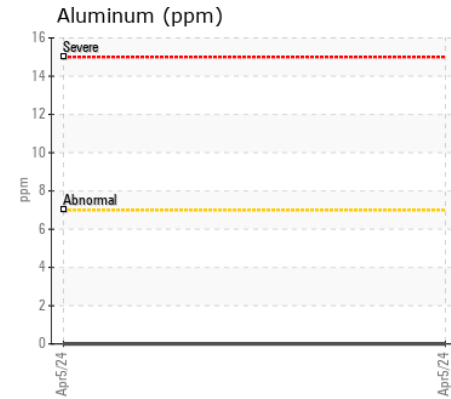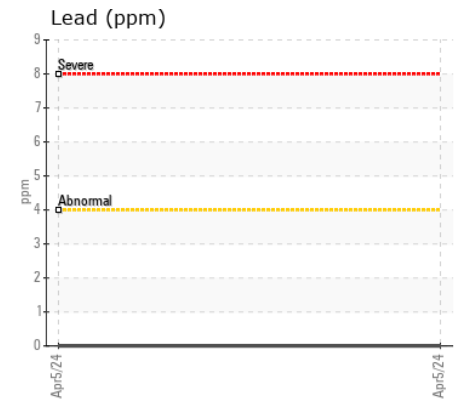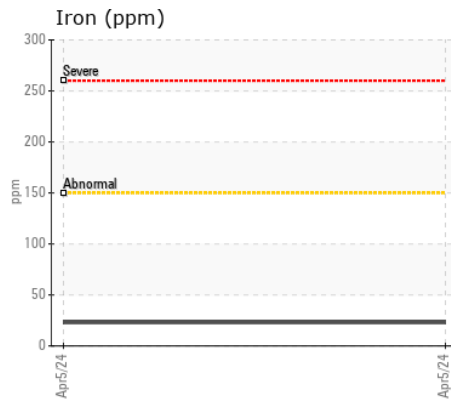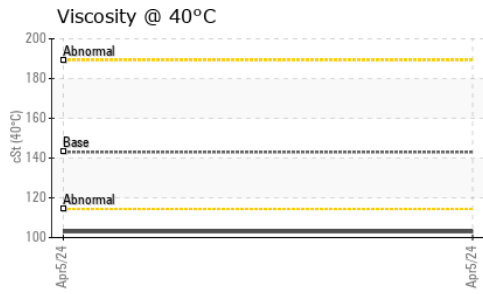

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : DJJ0021895 **Received** : 11 Apr 2024  
**Lab Number** : 06146805 **Tested** : 12 Apr 2024  
**Unique Number** : 10976883 **Diagnosed** : 15 Apr 2024 - Sean Felton  
**Test Package** : MOBCE

**RECO EQUIPMENT INC**  
 8075 PRODUCTION DRIVE  
 FLORENCE, KY  
 US 41042

Contact: TRACEY EDGERTON  
 tedgerton@recoequip.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
 F: (859)727-7974