



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**AMR-Topeka**  
Machine Id  
**112146 LIEBHERR A924C 063247-1049**  
Component  
**Rear Left Wheel Hub**  
Fluid  
**LIEBHERR GEAR BASIC 90 LS (3 LTR)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>DJJ0023252</b>	DJJ0019406	DJJ0017154
Sample Date		Client Info		<b>02 Apr 2024</b>	20 Jun 2023	20 Oct 2022
Machine Age	hrs	Client Info		<b>8606</b>	8076	0
Oil Age	hrs	Client Info		<b>500</b>	500	7037
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Not Changd
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>1000	<b>18</b>	20	23
Chromium	ppm	ASTM D5185m	>8	<b>&lt;1</b>	0	0
Nickel	ppm	ASTM D5185m	>4	<b>&lt;1</b>	<1	0
Titanium	ppm	ASTM D5185m	>4	<b>&lt;1</b>	0	0
Silver	ppm	ASTM D5185m		<b>&lt;1</b>	<1	0
Aluminum	ppm	ASTM D5185m	>30	<b>2</b>	0	<1
Lead	ppm	ASTM D5185m	>4	<b>&lt;1</b>	0	0
Copper	ppm	ASTM D5185m	>40	<b>1</b>	1	18
Tin	ppm	ASTM D5185m	>4	<b>&lt;1</b>	<1	0
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	LIGHT
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION






There is no indication of any contamination in the component.

Silicon	ppm	ASTM D5185m	>120	<b>2</b>	1	4
Potassium	ppm	ASTM D5185m	>20	<b>1</b>	<1	0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>4</b>	1	3
Boron	ppm	ASTM D5185m	0	<b>11</b>	25	20
Barium	ppm	ASTM D5185m	0	<b>&lt;1</b>	0	0
Molybdenum	ppm	ASTM D5185m	0	<b>&lt;1</b>	0	0
Manganese	ppm	ASTM D5185m	0	<b>&lt;1</b>	<1	<1
Magnesium	ppm	ASTM D5185m	<1	<b>2</b>	1	1
Calcium	ppm	ASTM D5185m	<1	<b>16</b>	11	13
Phosphorus	ppm	ASTM D5185m	2143	<b>3623</b>	2229	1985
Zinc	ppm	ASTM D5185m	<1	<b>21</b>	23	16
Sulfur	ppm	ASTM D5185m	23468	<b>44586</b>	27992	20507
Visc @ 40°C	cSt	ASTM D445	170	<b>193</b>	192	189

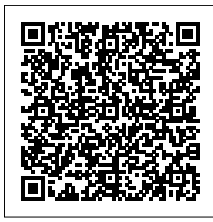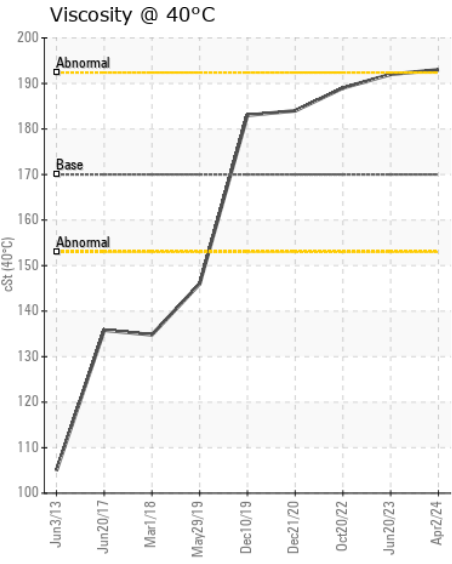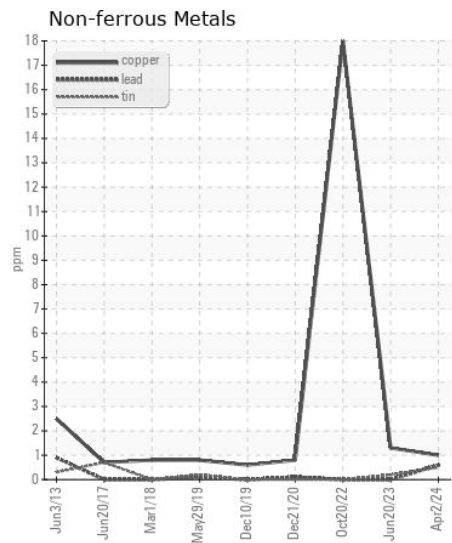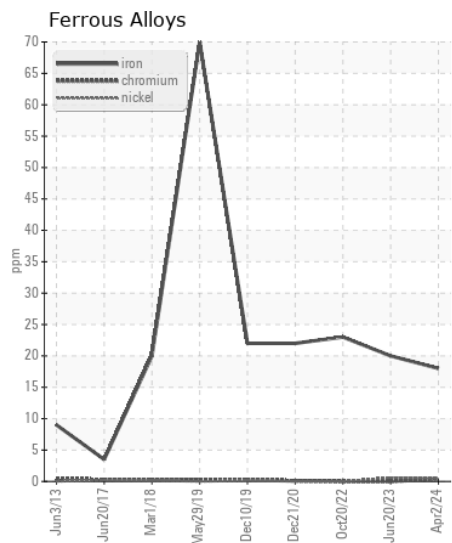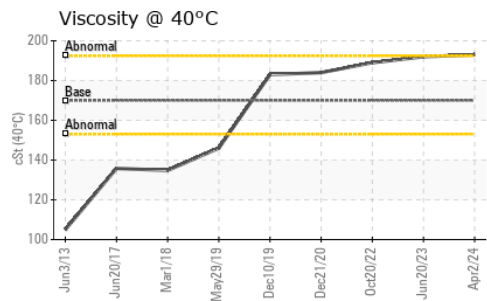

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : DJJ0023252  
**Lab Number** : 06147797  
**Unique Number** : 10977875  
**Test Package** : CONST  
**Received** : 12 Apr 2024  
**Tested** : 15 Apr 2024  
**Diagnosed** : 16 Apr 2024 - Don Baldrige

**ADVANTAGE METALS RECYCLING - TOPEKA**  
 1628 NW GORDON ST  
 TOPEKA, KS  
 US 66608  
 Contact: SETH WATSON  
 SETH.WATSON@ADVANTAGERECYCLING.COM  
 T: (913)621-2711  
 F: (785)235-0002

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)