

Machine Id

1.

VOLVO A45G 752203

Diesel Engine

VOLVO ULTRA DIESEL ENGINE OIL 15W40 VDS-3 (--- GAL)


RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.	Sample Number		Client Info		VCP436750		
	Sample Date		Client Info		09 Apr 2024		
	Machine Age	hrs	Client Info		654		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				ABNORMAL		
WEAR	Iron	ppm	ASTM D5185m	>100	28		
The copper level is abnormal. The nickel level is abnormal. In the absence of other significant wear metals, suspect copper due to sources other than wear (i.e. cooling core). All other metal levels are typical for a new component breaking in.	Chromium	ppm	ASTM D5185m		2		
	Nickel	ppm	ASTM D5185m		_ ▲ 8		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m	>2	0		
	Aluminum	ppm	ASTM D5185m		4		
	Lead	ppm	ASTM D5185m		2		
	Copper	ppm	ASTM D5185m		▲ 356		
	Tin	ppm	ASTM D5185m		6		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION Fuel content negligible. Elemental level of silicon (Si) above normal indicating ingress of seal material.	Silicon	ppm	ASTM D5185m		33		
	Potassium	ppm	ASTM D5185m		4		
	Fuel	%	ASTM D3524		0.3		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method	-	NEG		
	Soot %	%	*ASTM D7844		0.4		
	Nitration	Abs/cm	*ASTM D7624		9.8		
	Sulfation	Abs/.1mm	*ASTM D7415		20.4		
	Silt Debris	scalar	*Visual	NONE	NONE NONE		
	Sand/Dirt	scalar	*Visual *Visual	NONE	NONE		
	Appearance	scalar scalar	*Visual	NONE	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
			10000	20.L			
FLUID CONDITION The oil viscosity is lower than normal. The BN result indicates that there is suitable alkalinity remaining in the oil. Confirm oil type.	Sodium	ppm	ASTM D5185m		2		
	Boron	ppm	ASTM D5185m	2.5	37		
	Barium	ppm	ASTM D5185m	0.0	0		
	Molybdenum	ppm	ASTM D5185m	0.7	97		
	Manganese	ppm	ASTM D5185m		2		
	Magnesium	ppm	ASTM D5185m		27		
	Calcium	ppm	ASTM D5185m		2474		
	Phosphorus	ppm	ASTM D5185m		1122		
	Zinc	ppm	ASTM D5185m		1299		
	Sulfur	ppm	ASTM D5185m		4400		
	Oxidation	Abs/.1mm	*ASTM D7414		14.8		
	Base Number (BN)	mg KOH/g	ASTM D2896	10	5.3		

ASTM D445 15.0

Visc @ 100°C cSt

FLUID CONDITION

10.9

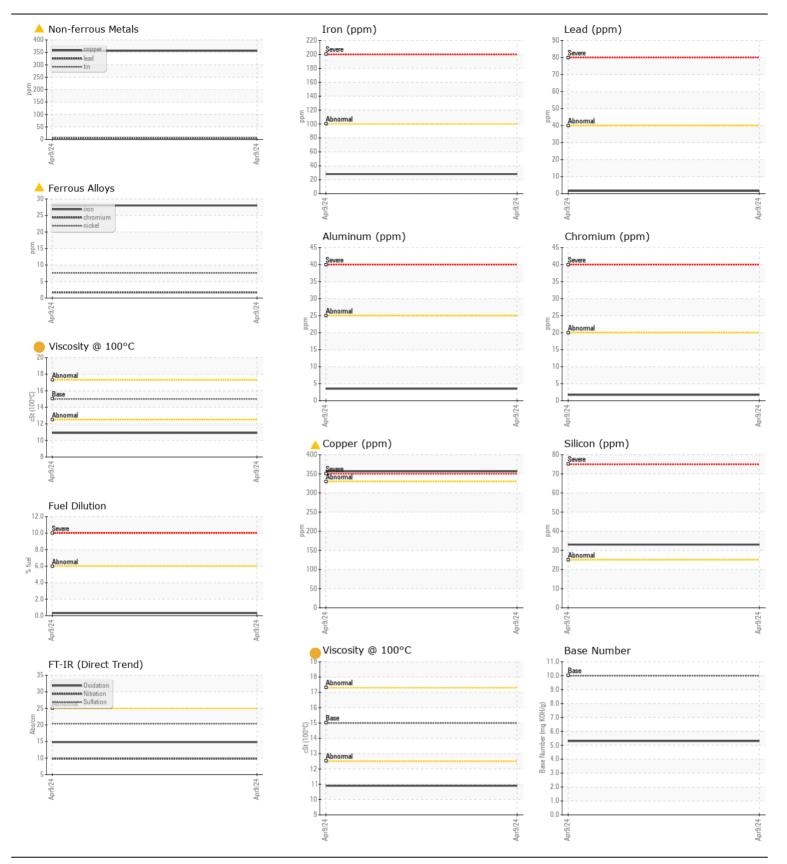

ALTA EQUIPMENT COMPANY Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : VCP436750 Received 5151 DR MARTIN LUTHER KING BLVD : 15 Apr 2024 Lab Number : 06148376 Tested : 19 Apr 2024 FORT MYERS, FL US 33905 Unique Number : 10978454 Diagnosed : 19 Apr 2024 - Jonathan Hester Test Package : MOB 1 (Additional Tests: FuelDilution, PercentFuel, TBN) Contact: TODD LARK Certificate L2367 tlark@altaequipfl.com To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (239)481-3302

Contact/Location: TODD LARK - VOLVO0090 Page 2 of 2