



OIL ANALYSIS REPORT

| | |
|-----------------|--------|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |

Machine Id
16
 Component
Diesel Engine
 Fluid
PETRO CANADA DURON HP 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|----------------|-----|-------------|-----------|--------------------|-------------|----------|
| Sample Number | | Client Info | | WC0850975 | WC0867903 | --- |
| Sample Date | | Client Info | | 15 Mar 2024 | 08 Nov 2023 | --- |
| Machine Age | mls | Client Info | | 204377 | 199390 | --- |
| Oil Age | mls | Client Info | | 0 | 0 | --- |
| Filter Age | mls | Client Info | | 0 | 0 | --- |
| Oil Changed | | Client Info | | Not Changd | Not Changd | --- |
| Filter Changed | | Client Info | | Not Changd | Not Changd | --- |
| Sample Status | | | | NORMAL | NORMAL | --- |

WEAR

All component wear rates are normal.

| | | | | | | |
|--------------|--------|-------------|------|--------------|------|-----|
| Iron | ppm | ASTM D5185m | >100 | 10 | 41 | --- |
| Chromium | ppm | ASTM D5185m | >20 | <1 | 1 | --- |
| Nickel | ppm | ASTM D5185m | >4 | 0 | <1 | --- |
| Titanium | ppm | ASTM D5185m | | 0 | <1 | --- |
| Silver | ppm | ASTM D5185m | >3 | 0 | 0 | --- |
| Aluminum | ppm | ASTM D5185m | >20 | 4 | 12 | --- |
| Lead | ppm | ASTM D5185m | >40 | 0 | <1 | --- |
| Copper | ppm | ASTM D5185m | >330 | <1 | 6 | --- |
| Tin | ppm | ASTM D5185m | >15 | 0 | <1 | --- |
| Vanadium | ppm | ASTM D5185m | | 0 | 0 | --- |
| White Metal | scalar | *Visual | NONE | NONE | NONE | --- |
| Yellow Metal | scalar | *Visual | NONE | NONE | NONE | --- |

CONTAMINATION












There is no indication of any contamination in the oil.

| | | | | | | |
|------------------|----------|-------------|-------|----------------|-------|-----|
| Silicon | ppm | ASTM D5185m | >25 | 3 | 7 | --- |
| Potassium | ppm | ASTM D5185m | >20 | 4 | 23 | --- |
| Fuel | | WC Method | >5 | <1.0 | <1.0 | --- |
| Water | | WC Method | >0.2 | NEG | NEG | --- |
| Glycol | | WC Method | | NEG | NEG | --- |
| Soot % | % | *ASTM D7844 | >3 | 0.2 | 0.4 | --- |
| Nitration | Abs/cm | *ASTM D7624 | >20 | 7.0 | 10.5 | --- |
| Sulfation | Abs/.1mm | *ASTM D7415 | >30 | 18.6 | 21.9 | --- |
| Silt | scalar | *Visual | NONE | NONE | NONE | --- |
| Debris | scalar | *Visual | NONE | NONE | NONE | --- |
| Sand/Dirt | scalar | *Visual | NONE | NONE | NONE | --- |
| Appearance | scalar | *Visual | NORML | NORML | NORML | --- |
| Odor | scalar | *Visual | NORML | NORML | NORML | --- |
| Emulsified Water | scalar | *Visual | >0.2 | NEG | NEG | --- |

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

| | | | | | | |
|------------------|----------|-------------|------|--------------|------|-----|
| Sodium | ppm | ASTM D5185m | | <1 | 3 | --- |
| Boron | ppm | ASTM D5185m | | 10 | 12 | --- |
| Barium | ppm | ASTM D5185m | | 0 | 9 | --- |
| Molybdenum | ppm | ASTM D5185m | | 63 | 69 | --- |
| Manganese | ppm | ASTM D5185m | | <1 | <1 | --- |
| Magnesium | ppm | ASTM D5185m | | 918 | 571 | --- |
| Calcium | ppm | ASTM D5185m | | 1215 | 1410 | --- |
| Phosphorus | ppm | ASTM D5185m | | 1131 | 962 | --- |
| Zinc | ppm | ASTM D5185m | | 1316 | 1173 | --- |
| Sulfur | ppm | ASTM D5185m | | 3827 | 3461 | --- |
| Oxidation | Abs/.1mm | *ASTM D7414 | >25 | 15.0 | 20.3 | --- |
| Base Number (BN) | mg KOH/g | ASTM D2896 | 9.8 | 8.3 | 6.2 | --- |
| Visc @ 100°C | cSt | ASTM D445 | 15.6 | 13.0 | 12.7 | --- |

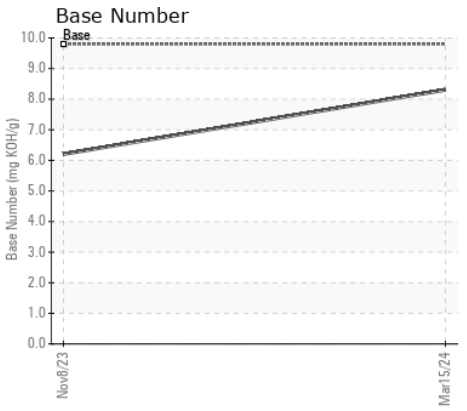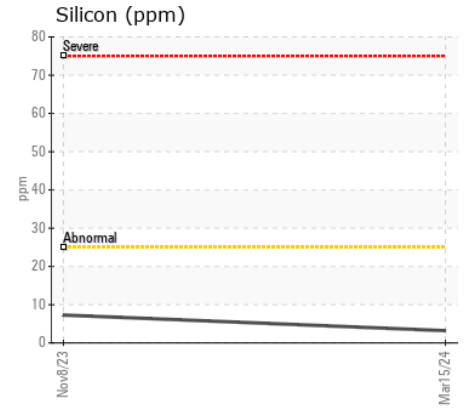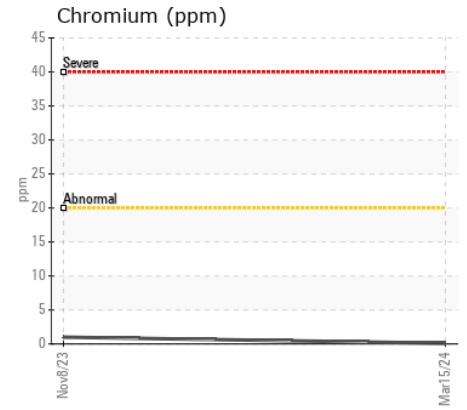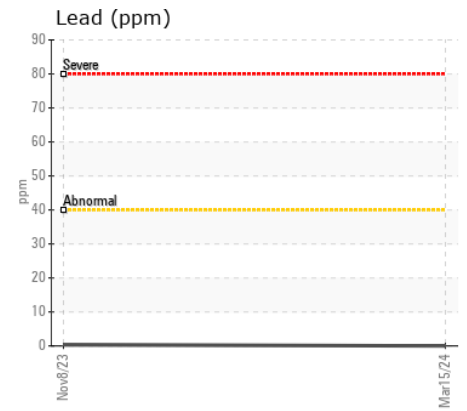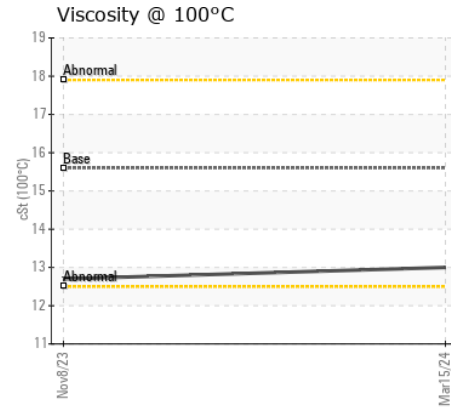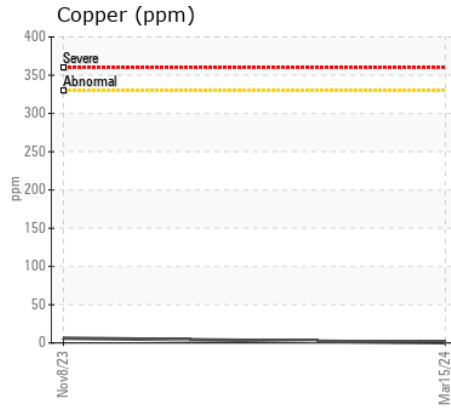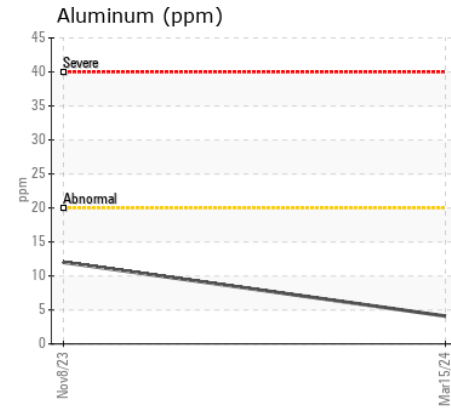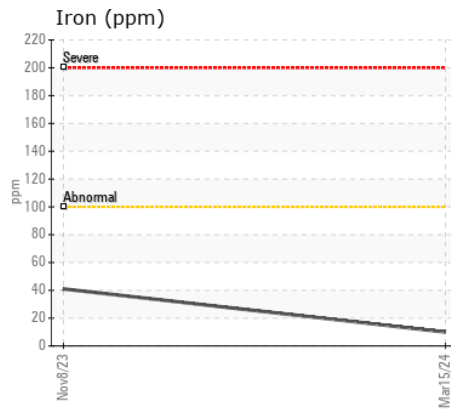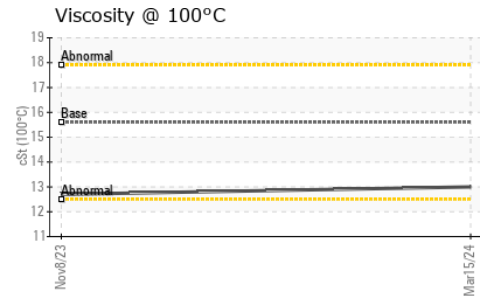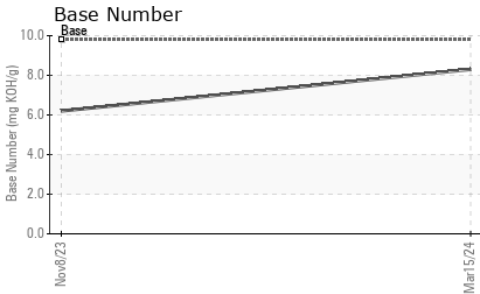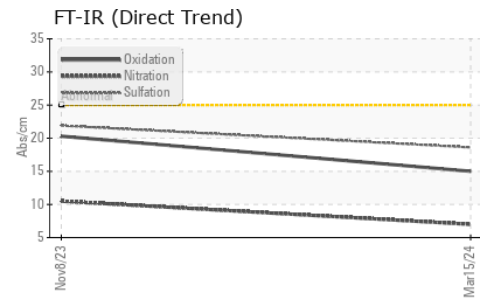

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0850975 **Received** : 15 Apr 2024
Lab Number : 06149342 **Tested** : 16 Apr 2024
Unique Number : 10979420 **Diagnosed** : 16 Apr 2024 - Wes Davis
Test Package : MOB 1 (Additional Tests: TBN)

ANSON CO SCHOOL BUS GARAGE
 89 BOGGAN CUT RD
 WADESBORO, NC
 US 28135
 Contact: MATT POWELL
 powell.berkeley@anson.k12.nc.us

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: