



WEAR CHECK

OIL ANALYSIS REPORT

| | |
|-----------------|--------|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |

Machine Id
34069
 Component
Diesel Engine
 Fluid
MOBIL 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|----------------|-----|-------------|-----------|--------------------|-------------|-------------|
| Sample Number | | Client Info | | WC0881731 | WC0730573 | WC0640937 |
| Sample Date | | Client Info | | 07 Mar 2024 | 29 Oct 2022 | 27 Apr 2022 |
| Machine Age | mls | Client Info | | 405998 | 264445 | 207640 |
| Oil Age | mls | Client Info | | 39046 | 25000 | 25000 |
| Filter Age | mls | Client Info | | 39046 | 25000 | 25000 |
| Oil Changed | | Client Info | | Changed | Changed | Changed |
| Filter Changed | | Client Info | | Changed | Changed | Changed |
| Sample Status | | | | NORMAL | NORMAL | NORMAL |

WEAR

All component wear rates are normal.

| | | | | | | |
|--------------|--------|-------------|------|--------------|------|------|
| Iron | ppm | ASTM D5185m | >100 | 21 | 24 | 36 |
| Chromium | ppm | ASTM D5185m | >20 | <1 | 1 | 2 |
| Nickel | ppm | ASTM D5185m | >4 | 0 | 0 | 0 |
| Titanium | ppm | ASTM D5185m | | 0 | 0 | 0 |
| Silver | ppm | ASTM D5185m | >3 | 0 | 0 | 0 |
| Aluminum | ppm | ASTM D5185m | >20 | 15 | 10 | 15 |
| Lead | ppm | ASTM D5185m | >40 | 0 | <1 | <1 |
| Copper | ppm | ASTM D5185m | >330 | 4 | 7 | 18 |
| Tin | ppm | ASTM D5185m | >15 | 0 | <1 | 1 |
| Vanadium | ppm | ASTM D5185m | | 0 | 0 | 0 |
| White Metal | scalar | *Visual | NONE | NONE | NONE | NONE |
| Yellow Metal | scalar | *Visual | NONE | NONE | NONE | NONE |

CONTAMINATION

There is no indication of any contamination in the oil.


| | | | | | | |
|------------------|----------|-------------|-------|----------------|-------|-------|
| Silicon | ppm | ASTM D5185m | >25 | 6 | 10 | 6 |
| Potassium | ppm | ASTM D5185m | >20 | 2 | 5 | 12 |
| Fuel | | WC Method | >5 | <1.0 | <1.0 | <1.0 |
| Water | | WC Method | >0.2 | NEG | NEG | NEG |
| Glycol | | WC Method | | NEG | NEG | NEG |
| Soot % | % | *ASTM D7844 | >3 | 0.7 | 1 | 1 |
| Nitration | Abs/cm | *ASTM D7624 | >20 | 9.6 | 12.5 | 11.3 |
| Sulfation | Abs/.1mm | *ASTM D7415 | >30 | 24.4 | 27.3 | 24.7 |
| Silt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Debris | scalar | *Visual | NONE | NONE | NONE | NONE |
| Sand/Dirt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Appearance | scalar | *Visual | NORML | NORML | NORML | NORML |
| Odor | scalar | *Visual | NORML | NORML | NORML | NORML |
| Emulsified Water | scalar | *Visual | >0.2 | NEG | NEG | NEG |

FLUID CONDITION


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

| | | | | | | |
|------------------|----------|-------------|------|-------------|------|------|
| Sodium | ppm | ASTM D5185m | >118 | 1 | <1 | <1 |
| Boron | ppm | ASTM D5185m | | 56 | 4 | 3 |
| Barium | ppm | ASTM D5185m | | 0 | 0 | 0 |
| Molybdenum | ppm | ASTM D5185m | | 86 | 68 | 69 |
| Manganese | ppm | ASTM D5185m | | 0 | <1 | <1 |
| Magnesium | ppm | ASTM D5185m | | 768 | 994 | 1134 |
| Calcium | ppm | ASTM D5185m | | 1402 | 1200 | 1334 |
| Phosphorus | ppm | ASTM D5185m | | 1117 | 1034 | 1146 |
| Zinc | ppm | ASTM D5185m | | 1402 | 1339 | 1420 |
| Sulfur | ppm | ASTM D5185m | | 3624 | 3232 | 2475 |
| Oxidation | Abs/.1mm | *ASTM D7414 | >25 | 19.7 | 23.2 | 21.2 |
| Base Number (BN) | mg KOH/g | ASTM D2896 | | 6.5 | 7.3 | 6.5 |
| Visc @ 100°C | cSt | ASTM D445 | | 14.0 | 14.6 | 14.6 |


FT-IR (Direct Trend)

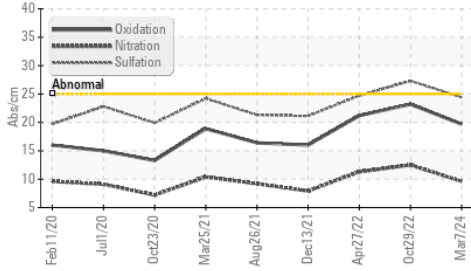


Base Number

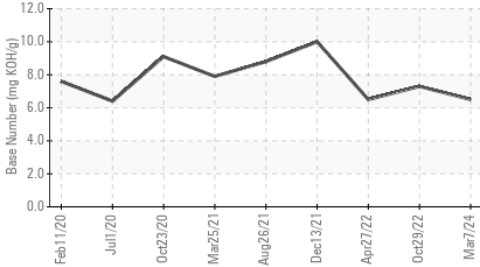


Viscosity @ 100°C

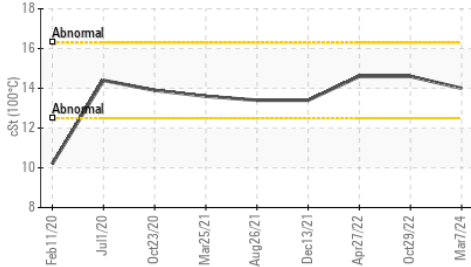


Ferrous Alloys

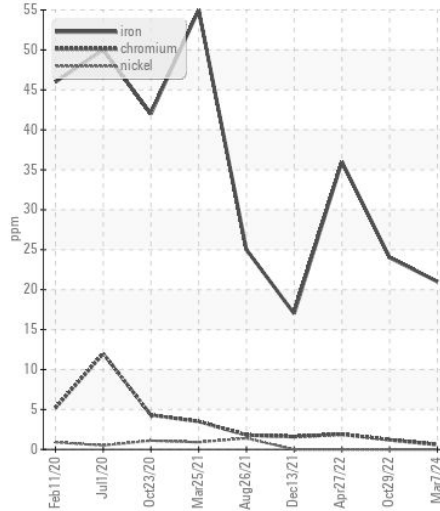


Non-ferrous Metals

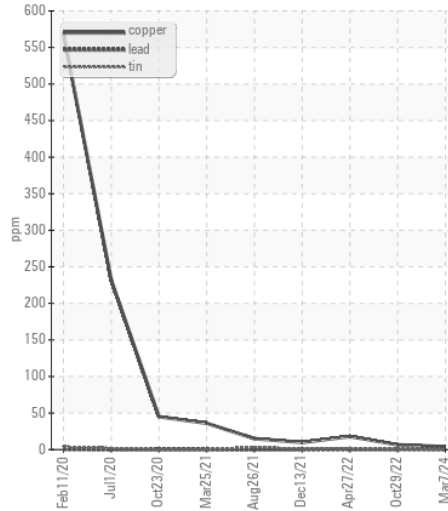

Viscosity @ 100°C

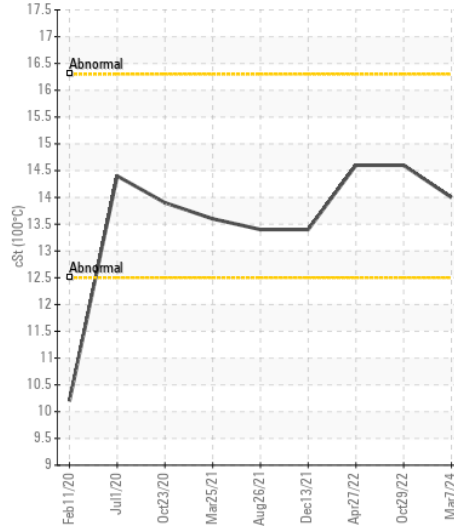

Base Number

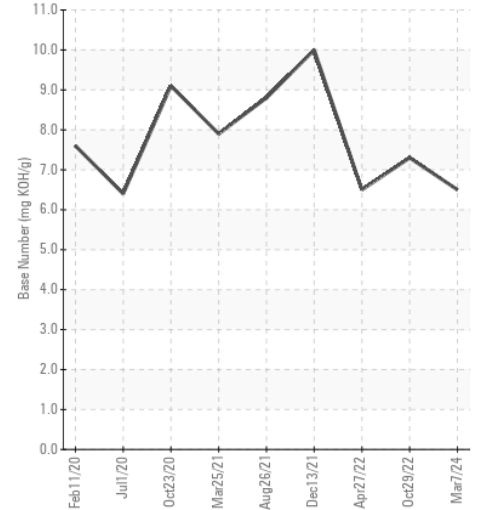

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0881731
Lab Number : 06159723
Unique Number : 10995146
Test Package : FLEET

Received : 24 Apr 2024
Tested : 25 Apr 2024
Diagnosed : 25 Apr 2024 - Wes Davis

SALEM NATIONALEASE CORPORATION
 198 PARK PLAZA DRIVE
 WINSTON SALEM, NC
 US 27105

Contact: Audrey Hopkins
 Audrey.Hopkins@salemcorp.com

T: (336)767-9642

F: x:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)