
WEAR CONTAMINATION FLUID CONDITION **NORMAL NORMAL NORMAL**


[W02008268]


VOLVO ECR355 314451


Rear Right Final Drive

VOLVO PREMIUM GEAR OIL 85W-140 GL-5 (2	(GAL)						
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
The oil change at the time of sampling has been noted. Resample at the next service interval to monitor. (Customer Sample Comment: W02008268)	Sample Number		Client Info		ML0001061		
	Sample Date		Client Info		02 May 2024		
	Machine Age	hrs	Client Info		2007		
	Oil Age	hrs	Client Info		500		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>500	273		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>10	5		
	Nickel	ppm	ASTM D5185m	>10	<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>25	2		
	Lead	ppm	ASTM D5185m	>25	0		
	Copper	ppm	ASTM D5185m	>50	<1		
	Tin	ppm	ASTM D5185m	>10	0		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>75	11		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		3		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		2		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	111	0		
	Barium	ppm	ASTM D5185m	0.0	1		
	Molybdenum	ppm	ASTM D5185m	0.9	<1		
	Manganese	ppm	ASTM D5185m	0.0	4		
	Magnesium	ppm	ASTM D5185m	39	2		
	Calcium	ppm	ASTM D5185m	93	7		
	Phosphorus	ppm	ASTM D5185m	920	371		
	Zinc	ppm	ASTM D5185m	104	11		
	Sulfur	ppm	ASTM D5185m	20179	16278		
	Visc @ 40°C	cSt	ASTM D445	333	164		

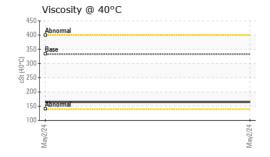

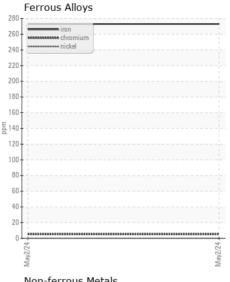

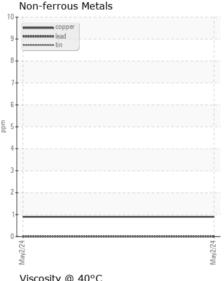

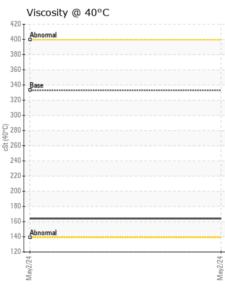



Certificate L2367

Laboratory Sample No.

Lab Number : 06174374 Unique Number : 11020427 Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : ML0001061 Received : 09 May 2024 **Tested** : 10 May 2024

Diagnosed : 13 May 2024 - Don Baldridge

MCCLUNG-LOGAN EQUIPMENT CO - MANASSAS 8450 QUARRY ROAD MANASSAS, VA

US 20110 Contact: DARRELL ANDES

dandes@mcclung-logan.com T:

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (703)393-7844