WEAR CONTAMINATION **FLUID CONDITION**


NORMAL NORMAL NORMAL


Machine Id


ROSENBAUER LADDER 1


Hydraulic System

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) AW HYDRAULIC OIL ISO 32. Please confirm.	Sample Number		Client Info		WC0917752		
	Sample Date		Client Info		10 Apr 2024		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
VEAR	Iron	ppm	ASTM D5185m	>20	<1		
	Chromium	ppm	ASTM D5185m		0		
All component wear rates are normal.	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>10	0		
	Lead	ppm	ASTM D5185m	>10	0		
	Copper	ppm	ASTM D5185m	>75	2		
	Tin	ppm	ASTM D5185m	>10	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>20	0		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	0		
	Water		WC Method	>0.1	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
LUID CONDITION	Sodium	ppm	ASTM D5185m		<1		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	5	0		
	Barium	ppm	ASTM D5185m	5	0		
	Molybdenum	ppm	ASTM D5185m	5	0		
	Manganese	ppm	ASTM D5185m		0		
	Magnesium	ppm	ASTM D5185m	25	2		
	Calcium	ppm	ASTM D5185m	200	67		
	Phosphorus	ppm	ASTM D5185m		397		
	Zinc	ppm	ASTM D5185m	370	391		
	Sulfur	ppm	ASTM D5185m		1143		
	Visc @ 40°C	cSt	ASTM D445	32	35.4		

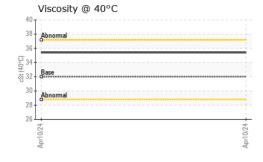

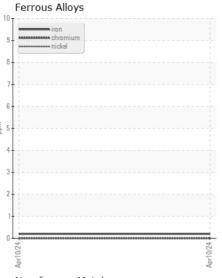

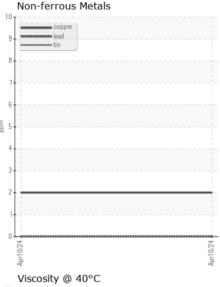

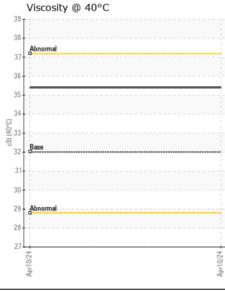



Certificate L2367

Laboratory Sample No.

Lab Number : 06176383 Unique Number : 11022436 Test Package : FLEET

: WC0917752

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 10 May 2024 **Tested** : 13 May 2024

Diagnosed : 13 May 2024 - Wes Davis **LUMBERTON FIRE DEPT** 600 NORTH CEDAR ST

LUMBERTON, NC US 28358

Contact: ANTHONY COLEMAN

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: