

Machine Id
687875
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 10W30 (42 QTS)

RECOMMENDATION

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		PCA0116600	PCA0061758	PCA0061726
Sample Date		Client Info		09 May 2024	21 Apr 2022	10 Mar 2022
Machine Age	mls	Client Info		0	216868	161517
Oil Age	mls	Client Info		0	0	0
Filter Age	mls	Client Info		0	0	0
Oil Changed		Client Info		N/A	Changed	Changed
Filter Changed		Client Info		Changed	Changed	Changed
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	7	25	17
Chromium	ppm	ASTM D5185m	>20	<1	2	1
Nickel	ppm	ASTM D5185m	>4	0	0	0
Titanium	ppm	ASTM D5185m		0	0	<1
Silver	ppm	ASTM D5185m	>3	0	<1	<1
Aluminum	ppm	ASTM D5185m	>20	6	12	10
Lead	ppm	ASTM D5185m	>40	0	0	0
Copper	ppm	ASTM D5185m	>330	2	9	3
Tin	ppm	ASTM D5185m	>15	0	<1	<1
Vanadium	ppm	ASTM D5185m		0	0	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE

CONTAMINATION












There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	6	3	5
Potassium	ppm	ASTM D5185m	>20	<1	7	7
Fuel		WC Method	>5	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	*ASTM D7844	>3	0.4	1.1	0.7
Nitration	Abs/cm	*ASTM D7624	>20	6.5	10.0	8.9
Sulfation	Abs/.1mm	*ASTM D7415	>30	17.7	21.4	20
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		1	2	<1
Boron	ppm	ASTM D5185m	2	17	4	3
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	50	63	60	63
Manganese	ppm	ASTM D5185m	0	<1	<1	<1
Magnesium	ppm	ASTM D5185m	950	868	991	967
Calcium	ppm	ASTM D5185m	1050	1055	1113	1118
Phosphorus	ppm	ASTM D5185m	995	997	954	1056
Zinc	ppm	ASTM D5185m	1180	1167	1168	1279
Sulfur	ppm	ASTM D5185m	2600	3324	2369	2498
Oxidation	Abs/.1mm	*ASTM D7414	>25	13.1	17.0	15.4
Base Number (BN)	mg KOH/g	ASTM D2896		8.2	6.5	8.8
Visc @ 100°C	cSt	ASTM D445	12.00	11.2	11.6	11.4

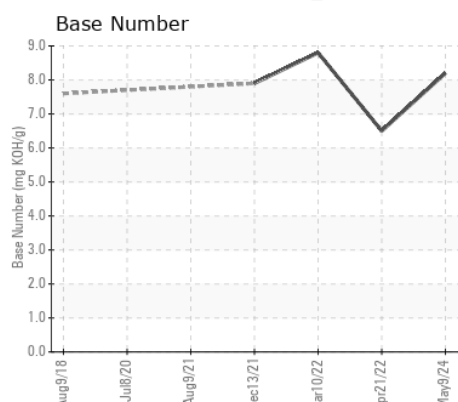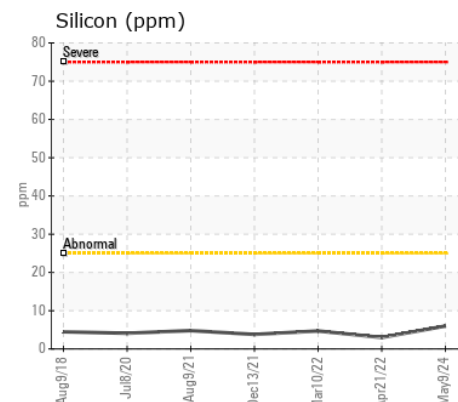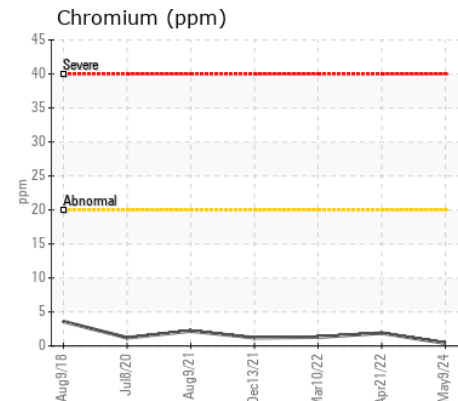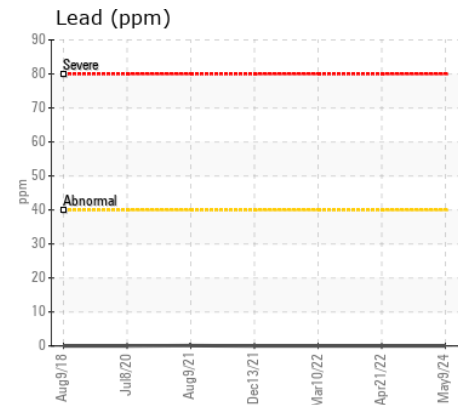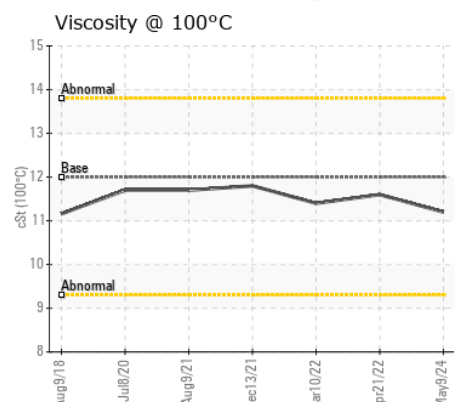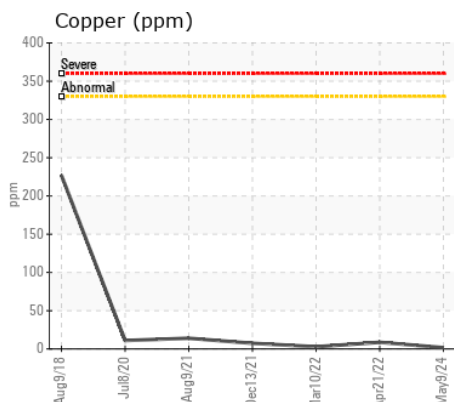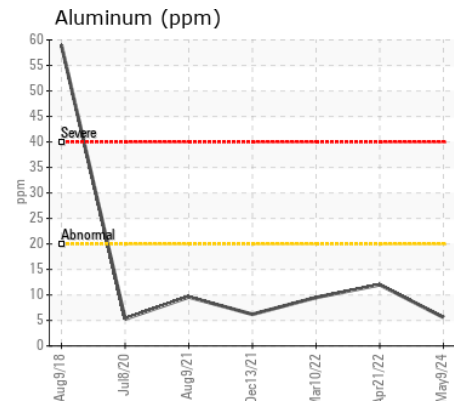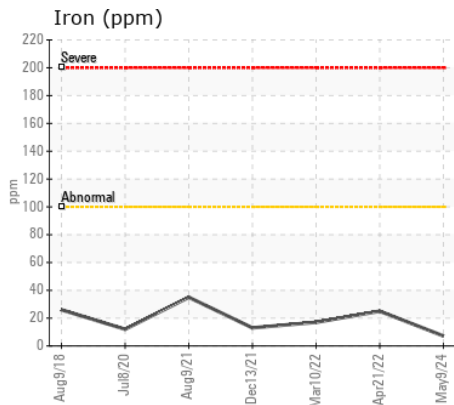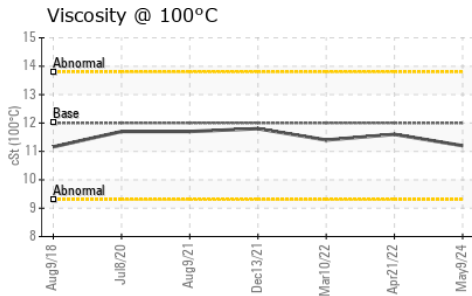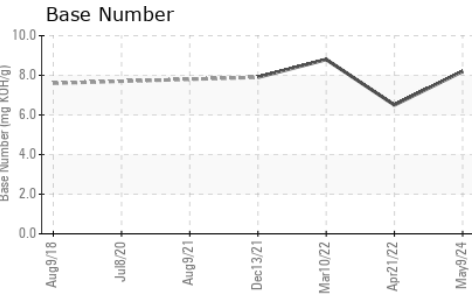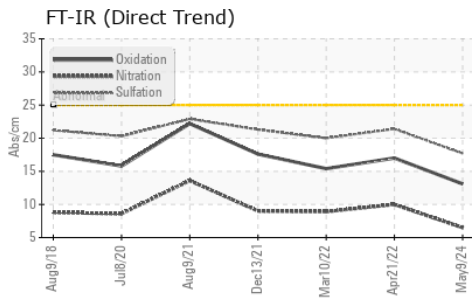

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0116600 **Received** : 22 May 2024
Lab Number : 06187298 **Tested** : 23 May 2024
Unique Number : 11044050 **Diagnosed** : 23 May 2024 - Wes Davis
Test Package : MOB 1 (Additional Tests: TBN)

MILLER TRUCK LEASING #115
 575 PROSPECT ST
 LAKEWOOD, NJ
 US 08701
 Contact: MARTIN RUCCI
 mrucci@millertransgroup.com
 T:
 F: (732)364-3682

Certificate L2367
 To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)