**WEAR** CONTAMINATION **FLUID CONDITION** 


**NORMAL NORMAL NORMAL** 

## Pillen Family Farms

LSTK 72
Component

**Diesel Engine** 

RECOMMENDATION							
	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. Please specify the component make and model with your next sample. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Number		Client Info		SBP0006845	SBP0006809	SBP0005334
	Sample Date		Client Info		21 May 2024	15 Apr 2024	21 Feb 2024
	Machine Age	mls	Client Info		12000	12000	12000
	Oil Age	mls	Client Info		0	0	0
	Filter Age	mls	Client Info		0	0	0
	Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status				NORMAL	NORMAL	NORMAL
WEAR	Iron	ppm	ASTM D5185m	>100	7	6	9
Metal levels are typical for a new component breaking in.	Chromium	ppm	ASTM D5185m	>20	<1	0	<1
	Nickel	ppm	ASTM D5185m	>4	0	0	<1
	Titanium	ppm	ASTM D5185m		0	0	0
	Silver	ppm	ASTM D5185m	>3	<1	0	0
	Aluminum	ppm	ASTM D5185m	>20	1	<1	3
	Lead	ppm		>40	<1	<1	<1
	Copper	ppm	ASTM D5185m	>330	0	0	<1
	Tin	ppm	ASTM D5185m	>15	0	<1	<1
	Vanadium	ppm	ASTM D5185m		0	0	0
	White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
	Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
CONTAMINATION	Silicon	ppm	ASTM D5185m	>25	3	3	5
	Potassium	ppm	ASTM D5185m	>20	3	2	6
There is no indication of any contamination in the oil.	Fuel		WC Method	>5	<1.0	<1.0	<1.0
	Water		WC Method	>0.2	NEG	NEG	NEG
	Glycol		WC Method		NEG	NEG	NEG
	Soot %	%	*ASTM D7844	>3	0.3	0.3	0.3
	Nitration	Abs/cm	*ASTM D7624	>20	6.4	6.2	5.8
	Sulfation	Abs/.1mm	*ASTM D7415	>30	18.6	18.5	18.0
	Silt	scalar	*Visual	NONE	NONE	NONE	NONE
	Debris	scalar	*Visual	NONE	NONE	NONE	NONE
	Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
	Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
	Odor	scalar	*Visual	NORML	NORML	NORML	NORML
	Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
FLUID CONDITION	Sodium	ppm	ASTM D5185m	>216	1	2	4
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.	Boron	ppm	ASTM D5185m	250	0	0	2
	Barium	ppm	ASTM D5185m	10	0	0	0
	Molybdenum	ppm	ASTM D5185m	100	62	63	64
	Manganese	ppm	ASTM D5185m		<1	0	0
	Magnesium	ppm	ASTM D5185m		1118	1081	1032
	Calcium	ppm	ASTM D5185m		1251	1177	1108
	Phosphorus	ppm	ASTM D5185m	1150	1194	1151	1115
	Zinc	ppm		1350	1497	1411	1336
	Sulfur	ppm	ASTM D5185m		4163	3974	3597
	Oxidation	Abs/.1mm	*ASTM D7414	>25	14.0	13.9	13.4
	Base Number (BN) Visc @ 100°C				8.4 13.6	8.6 13.6	8.9 13.7

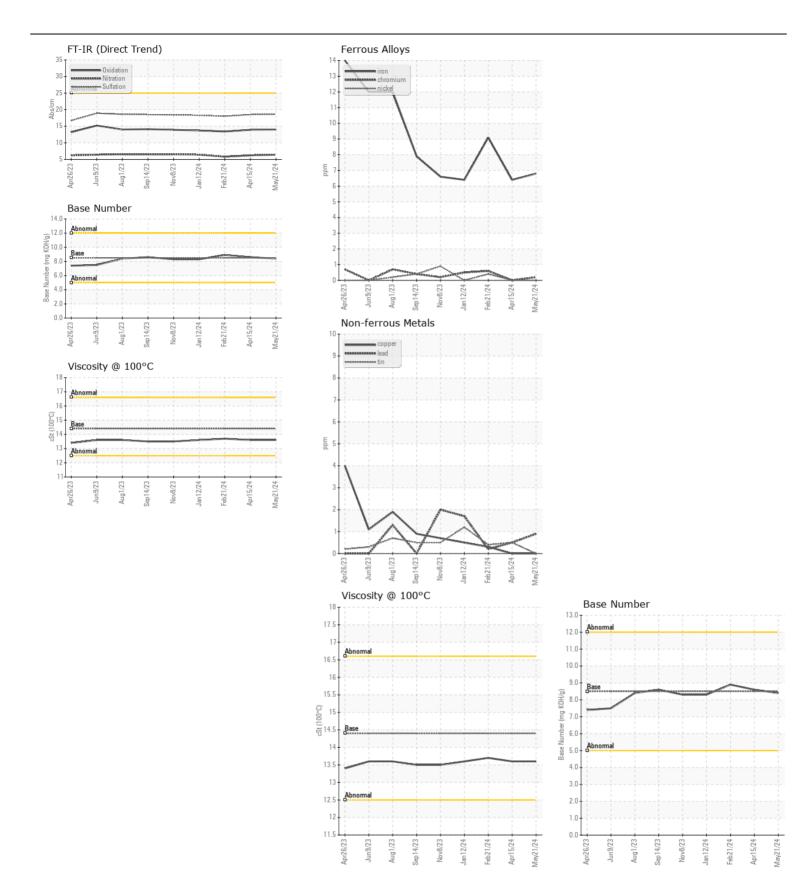





Certificate L2367

Laboratory

Sample No.

Lab Number : 06193304 Unique Number : 11050056 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : SBP0006845 Received

**Tested** Diagnosed

: 30 May 2024

: 28 May 2024

: 30 May 2024 - Wes Davis

US 61357 Contact: Troy Runge troyfr@pillenfamilyfarms.com T: (308)390-6733

Pillen Family Farms - 722828

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F:

26741 NE-91

Humphrey, NE