
**WEAR** CONTAMINATION **FLUID CONDITION**  **ABNORMAL** NORMAL **NORMAL** 

Machine Id

## **MANVEL E-1201**

Travel Fluid (not provided) ( QTS)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
No corrective action is recommended at this time. Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Number		Client Info		WC0941887		
	Sample Date		Client Info		29 May 2024		
	Machine Age	mls	Client Info		0		
	Oil Age	mls	Client Info		0		
	Filter Age	mls	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				ABNORMAL		
WEAR	Iron	ppm	ASTM D5185m	>500	4		
The copper level is abnormal. All other component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	0		
	Nickel	ppm	ASTM D5185m	>5	0		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		<1		
	Aluminum	ppm	ASTM D5185m	>100	2		
	Lead	ppm	ASTM D5185m	>10	3		
	Copper	ppm	ASTM D5185m	>60	<u> </u>		
	Tin	ppm	ASTM D5185m	>5	<1		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>150	3		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	2		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		3		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		39		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		2		
	Calcium	ppm	ASTM D5185m		254		
	Phosphorus	ppm	ASTM D5185m		196		
	Zinc	ppm	ASTM D5185m		7		
	Sulfur	ppm	ASTM D5185m		889		
	Visc @ 40°C	cSt	ASTM D445		31.5		



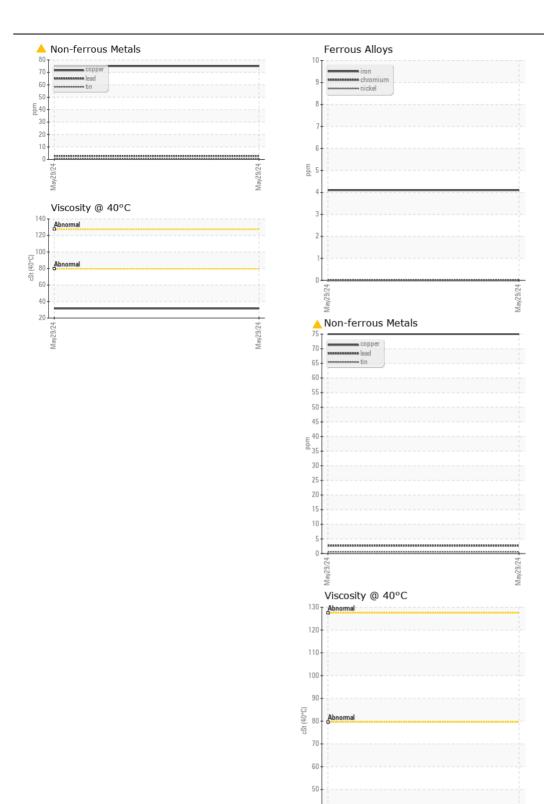



Certificate L2367

Laboratory Sample No.

Lab Number : 06194479 Unique Number : 11056602 Test Package : CONST

: WC0941887

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 29 May 2024 **Tested** : 31 May 2024 Diagnosed

: 31 May 2024 - Sean Felton

SIDDONS-MARTIN EMERGENCY GROUP

4401 REX RD FRIENDSWOOD, TX US 77546

Contact: DOUGLAS DLOUHY DDLOUHY@SIDDONS-MARTIN.COM

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: