



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
4368
 Component
Diesel Engine
 Fluid
MOBIL 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0909275	---	---
Sample Date		Client Info		26 Apr 2024	---	---
Machine Age	mls	Client Info		72533	---	---
Oil Age	mls	Client Info		0	---	---
Filter Age	mls	Client Info		0	---	---
Oil Changed		Client Info		Changed	---	---
Filter Changed		Client Info		Changed	---	---
Sample Status				NORMAL	---	---

WEAR

Metal levels are typical for a new component breaking in.

Iron	ppm	ASTM D5185m	>100	0	---	---
Chromium	ppm	ASTM D5185m	>20	0	---	---
Nickel	ppm	ASTM D5185m	>4	0	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m	>3	0	---	---
Aluminum	ppm	ASTM D5185m	>20	<1	---	---
Lead	ppm	ASTM D5185m	>40	0	---	---
Copper	ppm	ASTM D5185m	>330	0	---	---
Tin	ppm	ASTM D5185m	>15	0	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

CONTAMINATION












There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	0	---	---
Potassium	ppm	ASTM D5185m	>20	0	---	---
Fuel		WC Method	>5	<1.0	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	*ASTM D7844	>3	0.3	---	---
Nitration	Abs/cm	*ASTM D7624	>20	6.2	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	18.0	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m	>118	<1	---	---
Boron	ppm	ASTM D5185m		0	---	---
Barium	ppm	ASTM D5185m		0	---	---
Molybdenum	ppm	ASTM D5185m		58	---	---
Manganese	ppm	ASTM D5185m		0	---	---
Magnesium	ppm	ASTM D5185m		974	---	---
Calcium	ppm	ASTM D5185m		1109	---	---
Phosphorus	ppm	ASTM D5185m		1068	---	---
Zinc	ppm	ASTM D5185m		1275	---	---
Sulfur	ppm	ASTM D5185m		3741	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	13.6	---	---
Base Number (BN)	mg KOH/g	ASTM D2896		8.9	---	---
Visc @ 100°C	cSt	ASTM D445		14.0	---	---

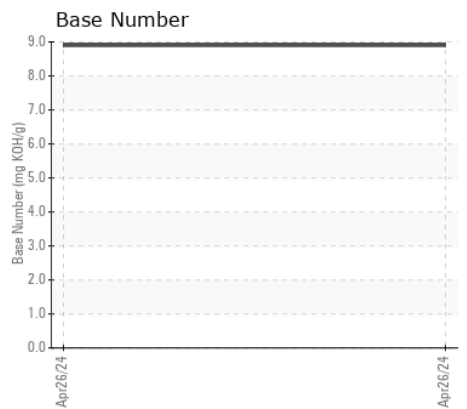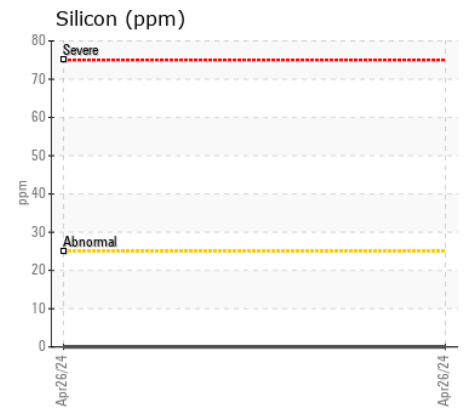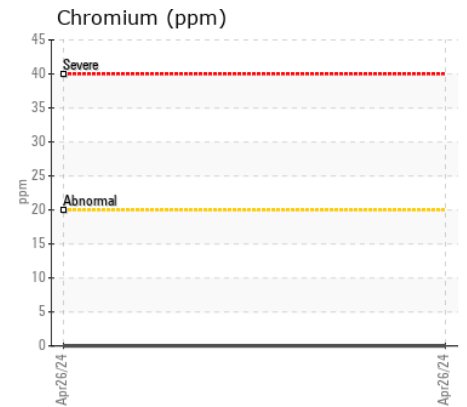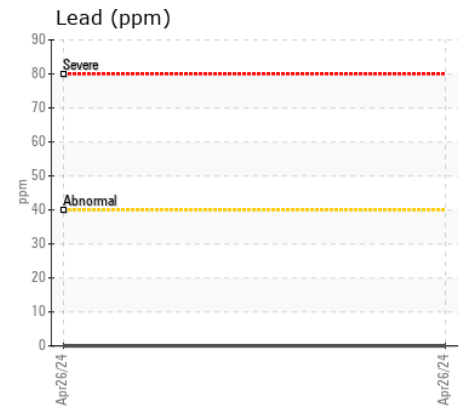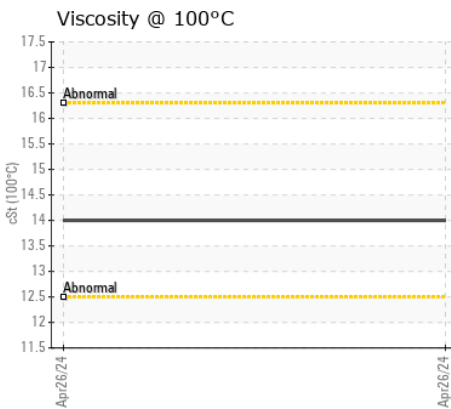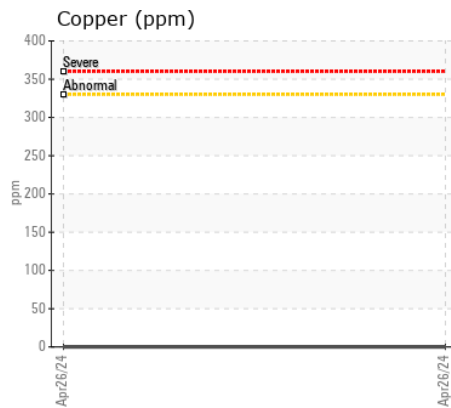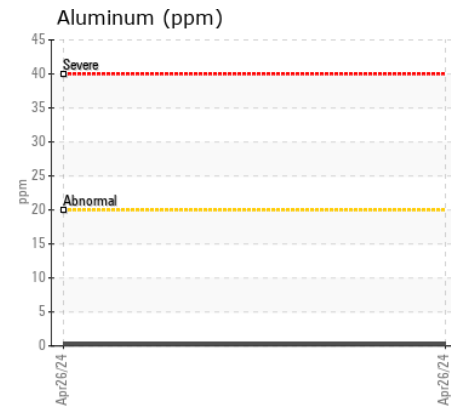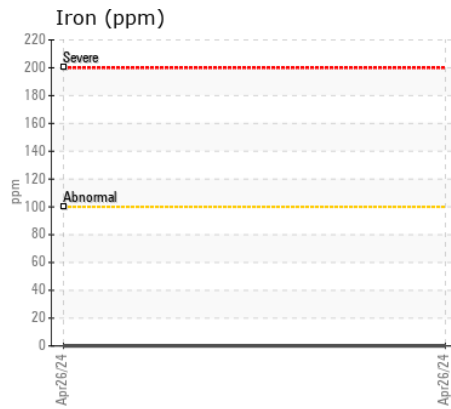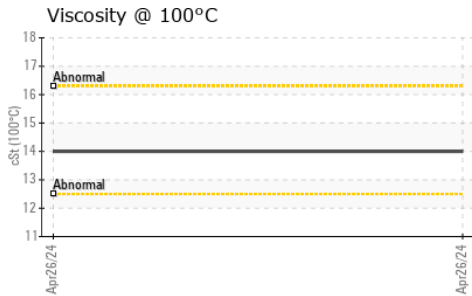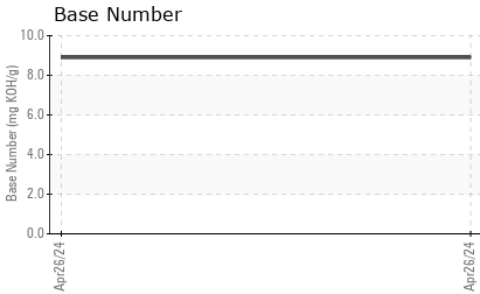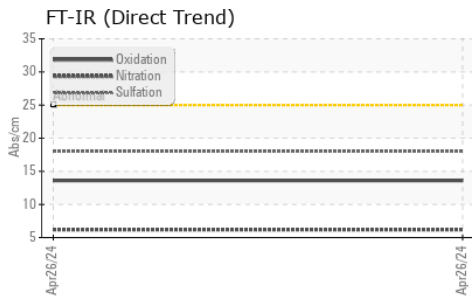

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0909275
Lab Number : 06197254
Unique Number : 11059377
Test Package : MOB 1 (Additional Tests: TBN)

Received : 03 Jun 2024
Tested : 03 Jun 2024
Diagnosed : 03 Jun 2024 - Wes Davis

CONCRETE SERVICE CO - FAY BLOCK
 161 BUILDERS BLVD
 FAYETTEVILLE, NC
 US 28301

Contact: BRYAN VANNIMAN
 bryanvanniman@fayblock.com

T: (800)326-9198

F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)