WEAR CONTAMINATION FLUID CONDITION


NORMAL


ABNORMAL


NORMAL


Machine Id 15425 Component Splitter Box

DECOMMEND ATION					(\	
RECOMMENDATION No corrective action is recommended at this time. Resample at the next service interval to monitor.	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		WC0913527		
	Sample Date		Client Info		07 Jun 2024		
	Machine Age	mls	Client Info		14607		
	Oil Age	mls	Client Info		0		
	Filter Age	mls	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				ABNORMAL		
WEAR	Iron	ppm	ASTM D5185m	>325	107		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>5	1		
	Nickel	ppm	ASTM D5185m	>10	3		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>5	0		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m	>30	<1		
	Tin	ppm	ASTM D5185m		0		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>20	154		
Elemental level of silicon (Si) above normal indicating ingress of seal material.	Potassium	ppm	ASTM D5185m	>20	3		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	MODER		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		4		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	400	161		
	Barium	ppm	ASTM D5185m	200	1		
	Molybdenum	ppm	ASTM D5185m	12	0		
	Manganese	ppm	ASTM D5185m		3		
	Magnesium	ppm	ASTM D5185m	12	0		
	Calcium	ppm	ASTM D5185m	150	16		
	Phosphorus	ppm	ASTM D5185m	1650	1083		
	Zinc	ppm	ASTM D5185m	125	2		
	Sulfur	ppm	ASTM D5185m	22500	27557		
	Visc @ 40°C	cSt	ASTM D445	109	96.7		

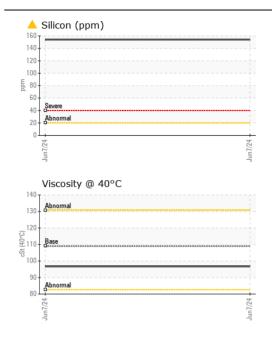

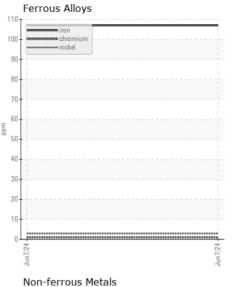

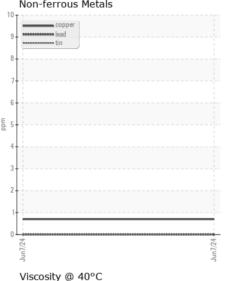

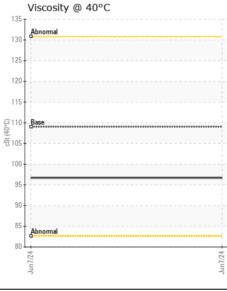



Certificate L2367

Laboratory Sample No.

: WC0913527 Lab Number : 06215038 Unique Number : 11087902 Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 19 Jun 2024 **Tested** : 20 Jun 2024

Diagnosed : 21 Jun 2024 - Sean Felton

MORRISVILLE, NC Contact: SCOTT SULLIVAN

ssullivan@sullivaneastern.com T: (919)484-8993

SULLIVAN EASTERN INC

2860 C SLATER RD

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (919)484-2136

US 27560