



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**BEECH 8EF**  
 Component  
**Left Jet Turbine**  
 Fluid  
**BP TURBO OIL 2380 (12 QTS)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GF0001777</b>	GF0001142	GF0000965
Sample Date		Client Info		<b>17 Jun 2024</b>	18 Sep 2023	01 Mar 2023
TSN	hrs	Client Info		<b>1464</b>	1250	1048
TSO	hrs	Client Info		<b>1250</b>	1250	1048
Oil Age	hrs	Client Info		<b>1464</b>	1250	1048
Filter Age	hrs	Client Info		<b>400</b>	202	1048
Oil Changed		Client Info		<b>Not Changd</b>	Not Changd	Not Changd
Filter Changed		Client Info		<b>N/A</b>	Not Changd	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>8	<b>0</b>	0	0
Chromium	ppm	ASTM D5185m	>2	<b>&lt;1</b>	0	0
Nickel	ppm	ASTM D5185m	>2	<b>0</b>	0	0
Titanium	ppm	ASTM D5185m	>2	<b>0</b>	0	0
Silver	ppm	ASTM D5185m	>2	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>2	<b>2</b>	0	0
Lead	ppm	ASTM D5185m	>3	<b>0</b>	0	0
Copper	ppm	ASTM D5185m	>3	<b>&lt;1</b>	0	0
Tin	ppm	ASTM D5185m	>2	<b>0</b>	<1	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	<1	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION





There is no indication of any contamination in the fluid.

Silicon	ppm	ASTM D5185m	>8	<b>1</b>	1	<1
Potassium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	3	0
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The condition of the fluid is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>0</b>	0	0
Boron	ppm	ASTM D5185m	0	<b>&lt;1</b>	0	0
Barium	ppm	ASTM D5185m	0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	0	<b>0</b>	0	0
Manganese	ppm	ASTM D5185m		<b>0</b>	<1	0
Magnesium	ppm	ASTM D5185m	0	<b>&lt;1</b>	0	0
Calcium	ppm	ASTM D5185m	0	<b>0</b>	0	0
Phosphorus	ppm	ASTM D5185m	2500	<b>2827</b>	2556	2520
Zinc	ppm	ASTM D5185m	0	<b>0</b>	0	<1
Sulfur	ppm	ASTM D5185m	0	<b>23</b>	0	0
Visc @ 40°C	cSt	ASTM D445	24.2	<b>24.5</b>	24.2	23.9

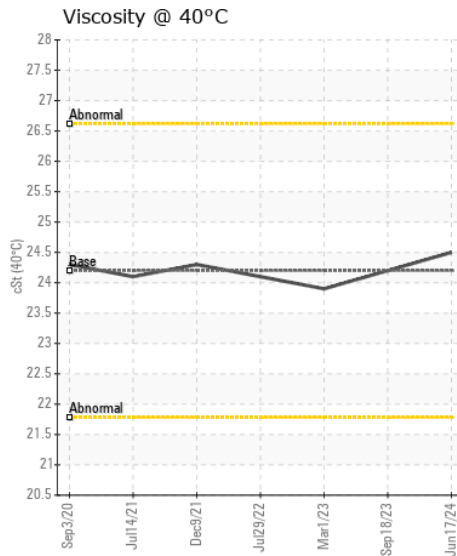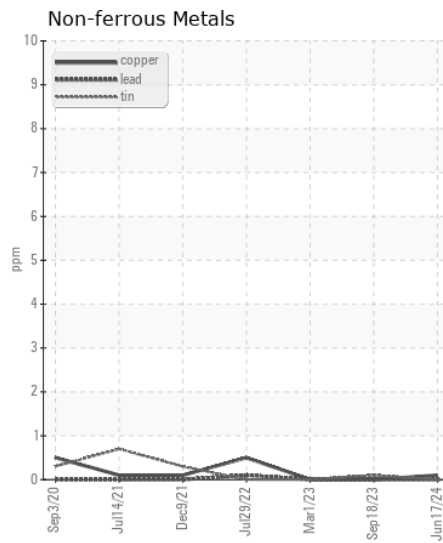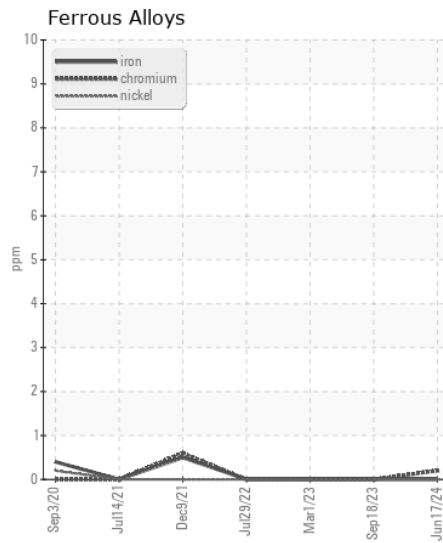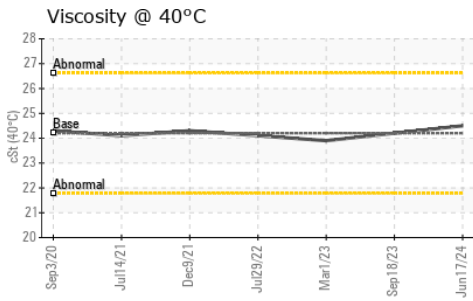

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : GF0001777  
**Lab Number** : 06216228  
**Unique Number** : 11089092  
**Test Package** : AVI 1

**Received** : 20 Jun 2024  
**Tested** : 21 Jun 2024  
**Diagnosed** : 23 Jun 2024 - Don Baldrige

**STEVENS AEROSPACE AND DEFENSE SYSTEMS, LLC**  
 1280 THUNDERBIRD DR  
 SMYRNA, TN  
 US 37167

Contact: PATRICK ISRAEL  
 pisrael@stevensaerospace.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (615)365-2132  
 F: (615)365-0966