



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**DEISTER 14032**  
 Component  
**Lower Gearbox**  
 Fluid  
**SHELL MORLINA OIL ISO 220 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>WC0851693</b>	WC0851705	WC0746925
Sample Date		Client Info		<b>14 Jun 2024</b>	22 Jan 2024	05 Sep 2023
Machine Age	hrs	Client Info		<b>32735</b>	31772	31020
Oil Age	hrs	Client Info		<b>0</b>	500	500
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>200	<b>25</b>	81	23
Chromium	ppm	ASTM D5185m	>10	<b>0</b>	<1	<1
Nickel	ppm	ASTM D5185m	>10	<b>&lt;1</b>	<1	0
Titanium	ppm	ASTM D5185m		<b>0</b>	<1	0
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>25	<b>2</b>	2	2
Lead	ppm	ASTM D5185m	>50	<b>&lt;1</b>	2	2
Copper	ppm	ASTM D5185m	>200	<b>10</b>	8	5
Tin	ppm	ASTM D5185m	>10	<b>&lt;1</b>	1	<1
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	<b>9</b>	8	6
Potassium	ppm	ASTM D5185m	>20	<b>3</b>	<1	<1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	LIGHT	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>2</b>	<1	0
Boron	ppm	ASTM D5185m		<b>2</b>	0	0
Barium	ppm	ASTM D5185m		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m		<b>0</b>	0	<1
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	1	<1
Magnesium	ppm	ASTM D5185m		<b>0</b>	<1	<1
Calcium	ppm	ASTM D5185m		<b>0</b>	2	0
Phosphorus	ppm	ASTM D5185m		<b>131</b>	32	28
Zinc	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Sulfur	ppm	ASTM D5185m		<b>6613</b>	7679	7544
Visc @ 40°C	cSt	ASTM D445	220	<b>203</b>	214	211

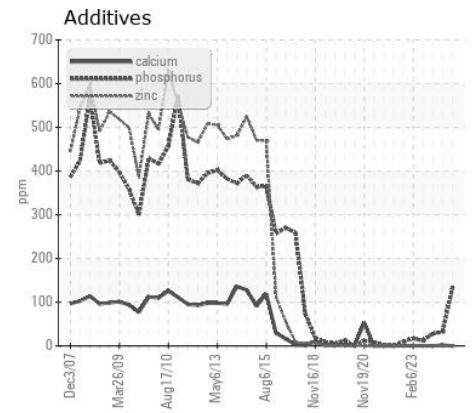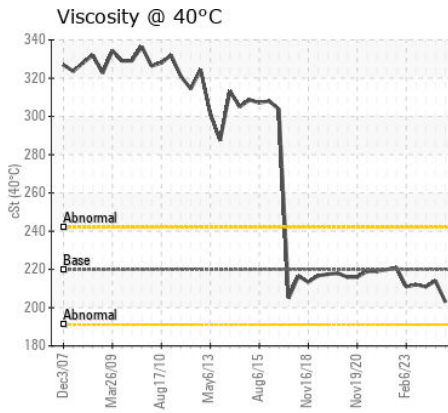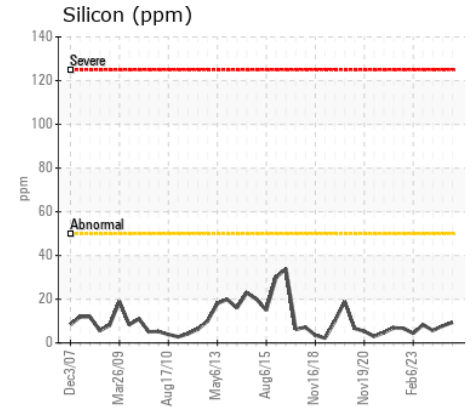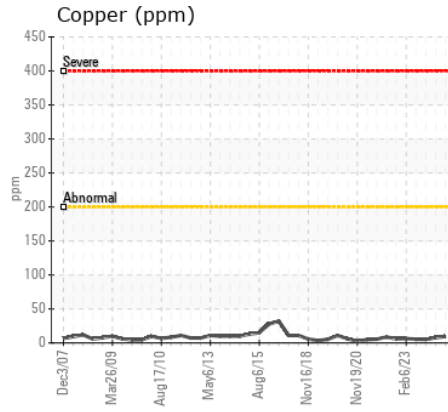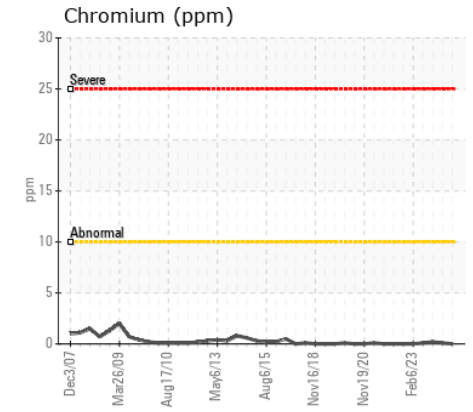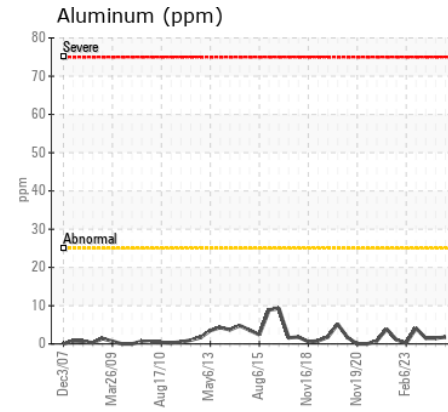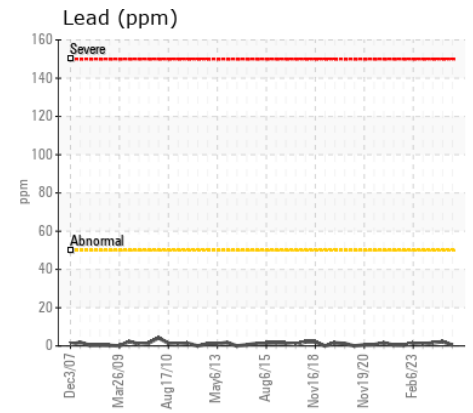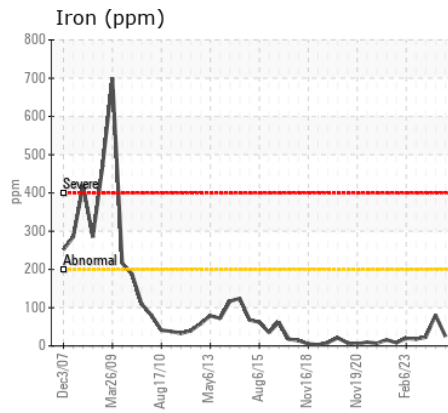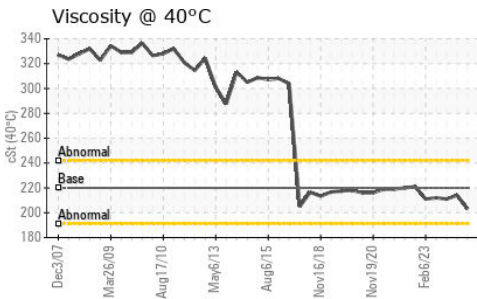

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : WC0851693  
**Lab Number** : 06217159  
**Unique Number** : 11090023  
**Test Package** : MOB 1

**Received** : 21 Jun 2024  
**Tested** : 24 Jun 2024  
**Diagnosed** : 24 Jun 2024 - Wes Davis

**WAKE STONE CORPORATION - BATTLEBORO**  
 NASH CO. QUARRY, 7379 N. HALIFAX RD.  
 BATTLEBORO, NC  
 US 27809  
 Contact: WAYNE HILL  
 waynehill@wakestonecorp.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
F: