
WEAR CONTAMINATION FLUID CONDITION **NORMAL NORMAL NORMAL**

[RSO-038391]

HITACHI 060320

Right Swing Drive

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP443963	VCP447620	
	Sample Date		Client Info		20 Jun 2024		
	Machine Age	hrs	Client Info		530	270	
	Oil Age	hrs	Client Info		0	0	
	Filter Age	hrs	Client Info		0	0	
	Oil Changed		Client Info		Not Changd	Changed	
	Filter Changed		Client Info		Not Changd	Not Changd	
	Sample Status				NORMAL	NORMAL	
WEAR	Iron	ppm	ASTM D5185m	>400	31	149	
	Chromium	ppm	ASTM D5185m		<1	2	
All component wear rates are normal.	Nickel	ppm	ASTM D5185m		0	0	
	Titanium	ppm	ASTM D5185m		0	0	
	Silver	ppm	ASTM D5185m		0	0	
	Aluminum	ppm	ASTM D5185m	>25	0	<1	
	Lead	ppm	ASTM D5185m	>50	0	0	
	Copper	ppm	ASTM D5185m	>200	12	2	
	Tin	ppm	ASTM D5185m	>10	0	0	
	Vanadium	ppm	ASTM D5185m		0	<1	
	White Metal	scalar	*Visual	NONE	NONE	NONE	
	Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
CONTAMINATION	Silicon	ppm	ASTM D5185m	>50	11	14	
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		<1	6	
	Water		WC Method		NEG	NEG	
	Silt	scalar	*Visual	NONE	NONE	NONE	
	Debris	scalar	*Visual	NONE	NONE	NONE	
	Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
	Appearance	scalar	*Visual	NORML	NORML	NORML	
	Odor	scalar	*Visual	NORML	NORML	NORML	
	Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	
FLUID CONDITION	Sodium	ppm	ASTM D5185m		1	2	
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	111	118	54	
The condition of the oil is acceptable for the time in service.	Barium	ppm	ASTM D5185m	0.0	<1	0	
	Molybdenum	ppm	ASTM D5185m	0.9	3	0	
	Manganese	ppm	ASTM D5185m	0.0	<1	4	
	Magnesium	ppm	ASTM D5185m	39	27	0	
	Calcium	ppm	ASTM D5185m	93	175	14	
	Phosphorus	ppm	ASTM D5185m	920	832	608	
	Zinc	ppm	ASTM D5185m	104	126	10	
	Sulfur	ppm	ASTM D5185m	20179	20084	20112	
	Visc @ 40°C	cSt	ASTM D445	333	263	189	

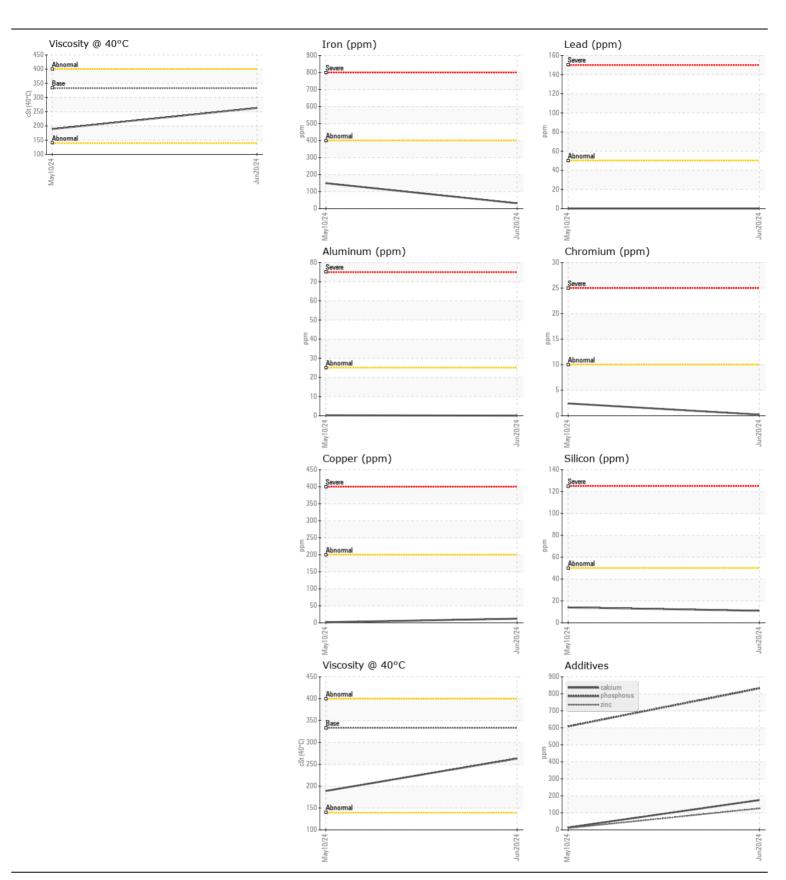





Certificate L2367

Laboratory Sample No.

: VCP443963 Lab Number : 06221601 Unique Number : 11099798 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 26 Jun 2024 **Tested** : 27 Jun 2024

Diagnosed : 28 Jun 2024 - Angela Borella SAIIA CONSTRUCTION LLC 4400 LEWISBURG RD

BIRMINGHAM, AL US 35207

Contact: STEPHANI BRITTON

To discuss this sample report, contact Customer Service at 1-800-237-1369. sbritton@saiia.com;doug.bogart@wearcheck.com * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (205)943-2268

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (205)943-2269