
**WEAR** CONTAMINATION **FLUID CONDITION** 

**NORMAL ABNORMAL ATTENTION** 

## [HERC RENTAL] **VOLVO A30G 753485**

**Drop Box** 

	85W-140 GL-		·····				
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP451245		
	Sample Date		Client Info		20 Jun 2024		
	Machine Age	hrs	Client Info		1123		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				ABNORMAL		
WEAR	Iron	ppm	ASTM D5185m	>500	59		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	<1		
	Nickel	ppm	ASTM D5185m	>10	0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>30	8		
	Lead	ppm	ASTM D5185m	>30	0		
	Copper	ppm	ASTM D5185m	>30	2		
	Tin	ppm	ASTM D5185m	>20	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	nnm	ASTM D5185m	. 50	16		
Moderate concentration of visible dirt/debris present in the oil.	Potassium	ppm	ASTM D5185m		1		
	Water	ppm	WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	▲ MODER		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	nnm	ASTM D5185m		4		
The oil viscosity is lower than normal. This plus the additive levels indicates the addition of a different brand, or type of oil. Confirm oil type.	Boron	ppm	ASTM D5185m	111	4 156		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		5		
	Manganese	ppm	ASTM D5185m		2		
	Magnesium	ppm	ASTM D5185m		0		
			ASTM D5185m		46		
	Calcium	DDIII					
	Calcium Phosphorus	ppm		920	_ 2267		
		ppm	ASTM D5185m ASTM D5185m		<ul><li>2267</li><li>43</li></ul>		
	Phosphorus		ASTM D5185m	104			

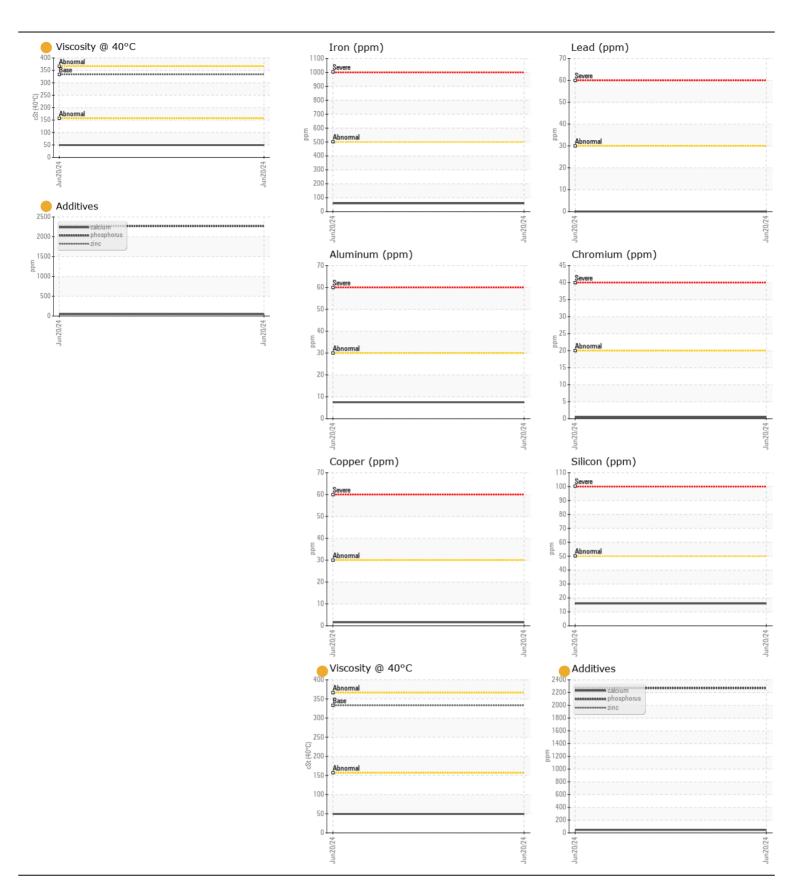



Certificate L2367

Laboratory Sample No.

Lab Number : 06221642 Unique Number : 11099839

: VCP451245 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 26 Jun 2024 **Tested** : 27 Jun 2024

Diagnosed : 28 Jun 2024 - Don Baldridge

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC 8418 PALM RIVER ROAD

TAMPA, FL US 33619

Contact: KENNY HANEY khaney@flaglerce.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (813)630-0077

F: (813)630-2233