WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL

Area


[X18706]

VOLVO A40G 353135

Drop Box

VOLVO SUPER GEAR OIL 75W-80-GO102 (--- GAL)

VOLVO SUPER GEAR OIL 75W	7-80-GO102	(G	AL)				
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP433027		
	Sample Date		Client Info		17 Jun 2024		
	Machine Age	hrs	Client Info		4110		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>500	393		
	Chromium	ppm	ASTM D5185m		4		
All component wear rates are normal.	Nickel	ppm	ASTM D5185m		2		
	Titanium	ppm	ASTM D5185m	7.10	<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>30	3		
	Lead	ppm	ASTM D5185m		<1		
	Copper	ppm	ASTM D5185m	>30	15		
	Tin	ppm	ASTM D5185m		0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>50	46		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	5		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	nnm	ASTM D5185m		7		
	Boron	ppm	ASTM D5185m		135		
The condition of the oil is acceptable for the time in service.	Barium	ppm	ASTM D5185m		<1		
	Molybdenum	ppm	ASTM D5185m		14		
	Manganese	ppm	ASTM D5185m		6		
	Magnesium	ppm	ASTM D5185m		2		
	Calcium	ppm	ASTM D5185m		13		
	Phosphorus	ppm	ASTM D5185m		2286		
	Zinc	ppm	ASTM D5185m		124		
	Sulfur	ppm	ASTM D5185m		28729		
	Visc @ 40°C	cSt	ASTM D445		48.3		
Report Id: APAREN IWLISCARI 06222606 (Generated: 06/28/2024 11:49:30) Rev: 1				Contact	(Location: WI	III DATIIC	E ADADE!

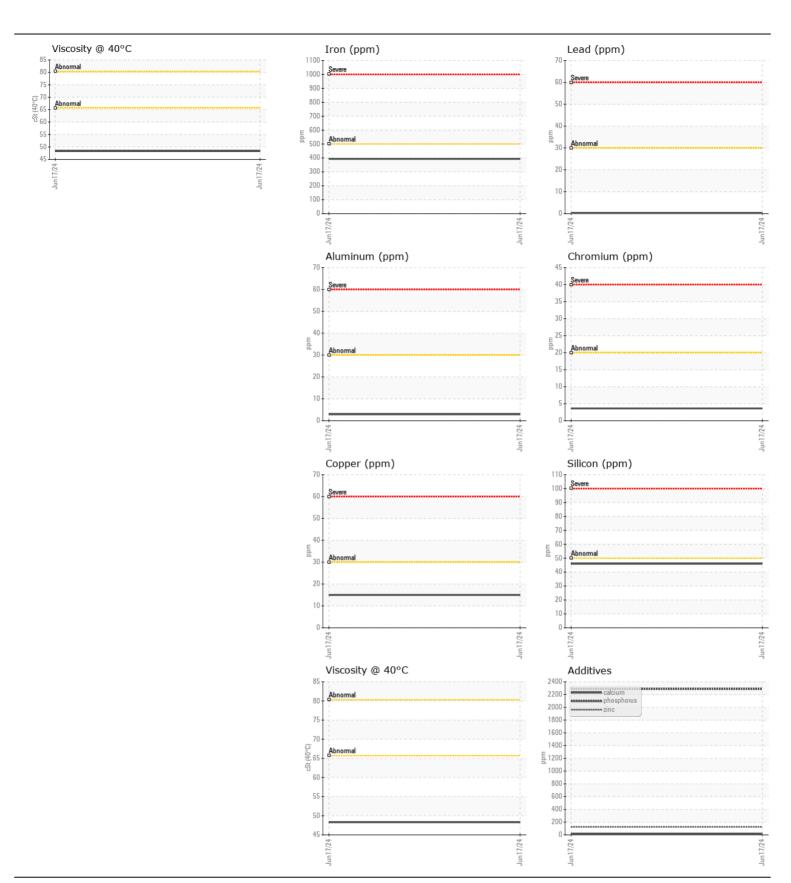



Certificate L2367

Laboratory Sample No.

: VCP433027 Lab Number : 06222606 Unique Number : 11100803 Test Package : MOB 1

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 27 Jun 2024 **Tested** : 28 Jun 2024

Diagnosed : 28 Jun 2024 - Wes Davis

BENTON, MS US 39039 Contact: WILL RATLIFF

will.ratliffjr@apac.com

T: (601)397-3696

APAC BENTON

393 OREILLY RD

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)