**WEAR** CONTAMINATION **FLUID CONDITION** 


**NORMAL NORMAL NORMAL** 


Machine Id


## **PIERCE TRUCK 1 - PIERCE**


Component Hydraulic System Fluid

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		WC0938753		
Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Date		Client Info		29 May 2024		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
VEAR	Iron	nnm	ASTM D5185m	>20	1		
	Chromium	ppm	ASTM D5185m		<1		
All component wear rates are normal.	Nickel	ppm	ASTM D5185m		<1		
	Titanium	ppm	ASTM D5185m	>10	<1		
	Silver	ppm	ASTM D5185m		<1		
	Aluminum	ppm	ASTM D5185m	>10	2		
	Lead	ppm	ASTM D5185m		- <1		
	Copper	ppm	ASTM D5185m		2		
	Tin	ppm	ASTM D5185m		<1		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>20	4		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		1		
	Water		WC Method		NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML NEG		
<u> </u>	Emulsified Water	scalar	*Visual	>0.1	NEG		
LUID CONDITION	Sodium	ppm	ASTM D5185m		0		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		<1		
	Barium	ppm	ASTM D5185m		1		
	Molybdenum	ppm	ASTM D5185m		1		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		5		
	Calcium	ppm	ASTM D5185m		100		
	Phosphorus	ppm	ASTM D5185m		614		
	Zinc	ppm	ASTM D5185m		867		
	Sulfur	ppm	ASTM D5185m		1628		
	Visc @ 40°C	cSt	ASTM D445		47.1		

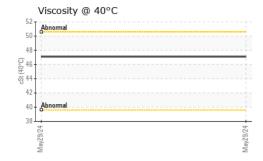

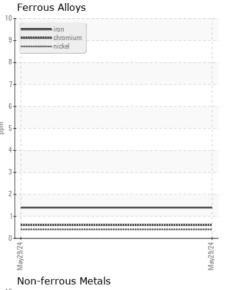

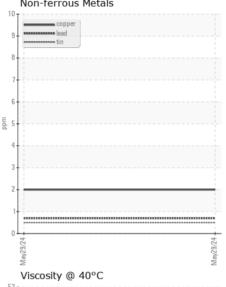

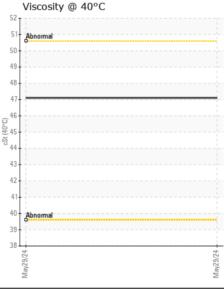



Certificate L2367

Laboratory

Sample No.

Lab Number : 06222744 Unique Number : 11100941

: WC0938753

Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 27 Jun 2024 **Tested** : 28 Jun 2024

Diagnosed : 28 Jun 2024 - Wes Davis NORTH LITTLE ROCK FIRE DEPT 723 MAPLE ST NORTH LITTLE ROCK, AZ

US 72114 Contact: B JONES

BJONES@NLR.AR.GOV T: (501)340-5377

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (501)340-5391