WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL


[W67292]

JOHN DEERE 750L 1T0750LXLPF453119

Left Inner Final Drive

JOHN DEERE HY-GARD HYD/TRANS (4 GAL)

JOHN DEERE HY-GARD HYD/TRANS (4 GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. (Customer Sample Comment: W67292)	Sample Number		Client Info		JR0216068		
	Sample Date		Client Info		27 Jun 2024		
	Machine Age	hrs	Client Info		1053		
	Oil Age	hrs	Client Info		1053		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR	PQ		ASTM D8184	>1250	20		
All component wear rates are normal.	Iron	ppm	ASTM D5185m	>750	25		
	Chromium	ppm	ASTM D5185m		<1		
	Nickel	ppm	ASTM D5185m	>10	<1		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>40	1		
	Lead	ppm	ASTM D5185m	>15	<1		
	Copper	ppm	ASTM D5185m	>40	1		
	Tin	ppm	ASTM D5185m	>10	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION There is no indication of any contamination in the oil.	Silicon	ppm	ASTM D5185m	>75	5		
	Potassium	ppm	ASTM D5185m		4		
	Water	le le	WC Method	>0.075	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.075	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m	<u>~51</u>	4		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		4		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		1		
	Magnesium	ppm	ASTM D5185m	145	103		
	Calcium	ppm	ASTM D5185m		3611		
	Phosphorus	ppm	ASTM D5185m		1116		
	Zinc	ppm	ASTM D5185m		1287		
	Sulfur	ppm	ASTM D5185m		4539		
	Visc @ 40°C	cSt	ASTM D445	57.0	53.9		

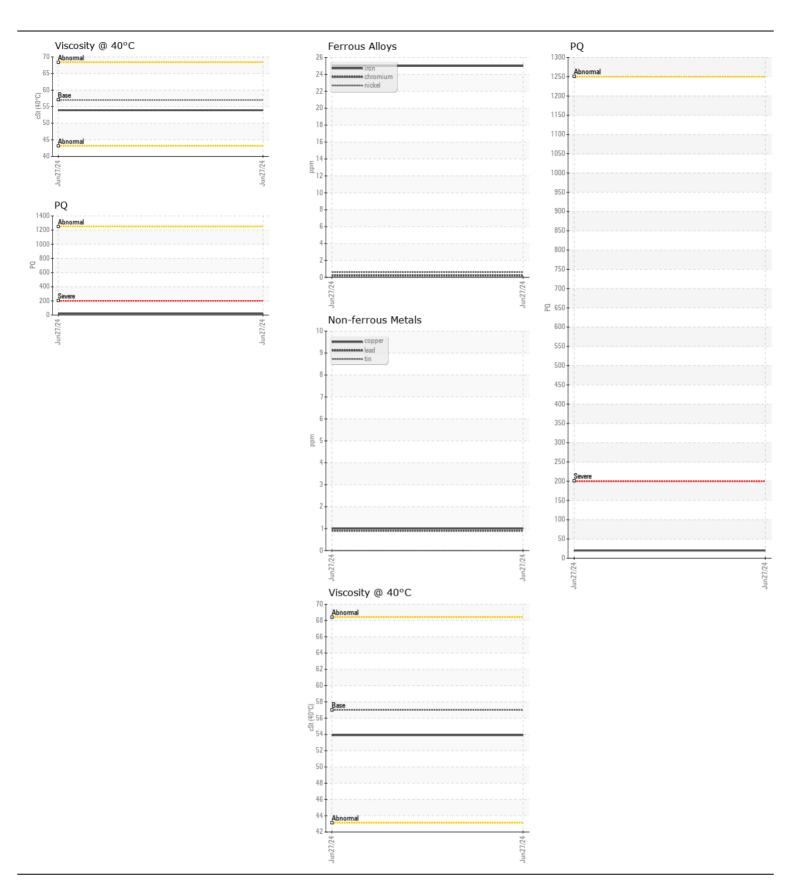





Laboratory Sample No.

: JR0216068 Lab Number : 06223701

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received **Tested** Unique Number : 11101898

: 01 Jul 2024 Diagnosed

: 01 Jul 2024 - Don Baldridge

: 28 Jun 2024

9550 STATESVILLE ROAD CHARLOTTE, NC US 28269

CARLTON'S BACKHOE

Contact: LEO

Test Package : CONST (Additional Tests: PQ) To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (704)547-0211 F: