

Machine Id NRL381 - BRIDGE Component Gearbox

{not provided} (--- GAL)

RECOMMENDATION

No corrective action is recommended at this time. We recommend an early resample to monitor this condition.

V	V	Ε	Α	R

The lead level is abnormal. All other component wear rates are normal.

CONTAMINATION

There is no indication of any contamination in the oil.

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		DC0036846		
Sample Date		Client Info		26 Jun 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Filter Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Filter Changed		Client Info		N/A		
Sample Status				ABNORMAL		
Iron	ppm	ASTM D5185m	>200	9		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
Lead	ppm	ASTM D5185m	>50	400		
Copper	ppm	ASTM D5185m	>200	2		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		<1		
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Silicon	ppm	ASTM D5185m	>50	4		
Potassium	ppm	ASTM D5185m	>20	2		
Water	ppin	WC Method	>0.2	- NEG		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
			>0.L			
Sodium	ppm	ASTM D5185m		284		
Boron	ppm	ASTM D5185m		3		
Barium	ppm	ASTM D5185m		<1		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		6		
Calcium	ppm	ASTM D5185m		1726		
Phosphorus	ppm	ASTM D5185m		703		
Zinc	ppm	ASTM D5185m		718		
Sulfur	ppm	ASTM D5185m		5558		
Vice @ 40°C				200		

Visc @ 40°C


cSt


ASTM D445

Contact/Location: JASON WILDE - CRAASHMA

208

WEAR ABNORMAL CONTAMINATION NORMAL FLUID CONDITION NORMAL

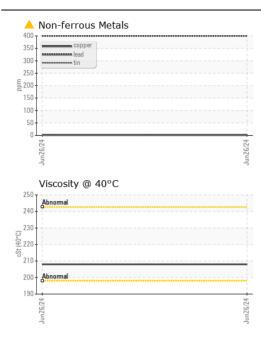

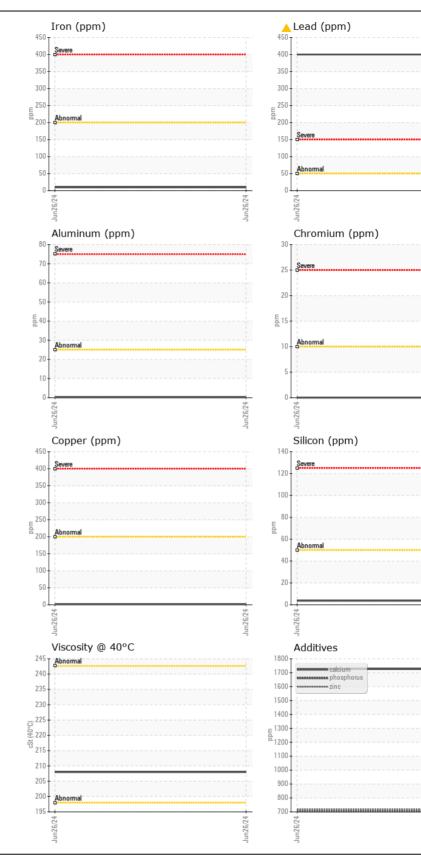

CRANEWORKS INC - MID-ATLANTIC Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. Received 11089 LEADBETTER ROAD : DC0036846 : 28 Jun 2024 Lab Number : 06223816 ASHLAND, VA Tested : 01 Jul 2024 Unique Number : 11102013 : 01 Jul 2024 - Don Baldridge US 23005 Diagnosed Test Package : MOB 1 Contact: JASON WILDE Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. jcwilde@vacraneworks.com * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: F: Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: JASON WILDE - CRAASHMA Page 2 of 2