



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	MARGINAL
FLUID CONDITION	NORMAL

Machine Id
ROSHARON T-1111
 Component
Diesel Engine
 Fluid
{not provided} (--- GAL)

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor. Please specify the component make and model with your next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0941949	---	---
Sample Date		Client Info		02 Jul 2024	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				MARGINAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	19	---	---
Chromium	ppm	ASTM D5185m	>20	<1	---	---
Nickel	ppm	ASTM D5185m	>4	0	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m	>3	0	---	---
Aluminum	ppm	ASTM D5185m	>20	5	---	---
Lead	ppm	ASTM D5185m	>40	0	---	---
Copper	ppm	ASTM D5185m	>330	2	---	---
Tin	ppm	ASTM D5185m	>15	0	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

CONTAMINATION









Light fuel dilution occurring. No other contaminants were detected in the oil.

Silicon	ppm	ASTM D5185m	>25	3	---	---
Potassium	ppm	ASTM D5185m	>20	16	---	---
Fuel	%	ASTM D3524	>5	▲ 2.1	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	*ASTM D7844	>3	0.3	---	---
Nitration	Abs/cm	*ASTM D7624	>20	8.1	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	19.9	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		7	---	---
Boron	ppm	ASTM D5185m		57	---	---
Barium	ppm	ASTM D5185m		0	---	---
Molybdenum	ppm	ASTM D5185m		40	---	---
Manganese	ppm	ASTM D5185m		0	---	---
Magnesium	ppm	ASTM D5185m		245	---	---
Calcium	ppm	ASTM D5185m		1819	---	---
Phosphorus	ppm	ASTM D5185m		967	---	---
Zinc	ppm	ASTM D5185m		1138	---	---
Sulfur	ppm	ASTM D5185m		3044	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	15.6	---	---
Base Number (BN)	mg KOH/g	ASTM D2896		7.2	---	---
Visc @ 100°C	cSt	ASTM D445		12.4	---	---

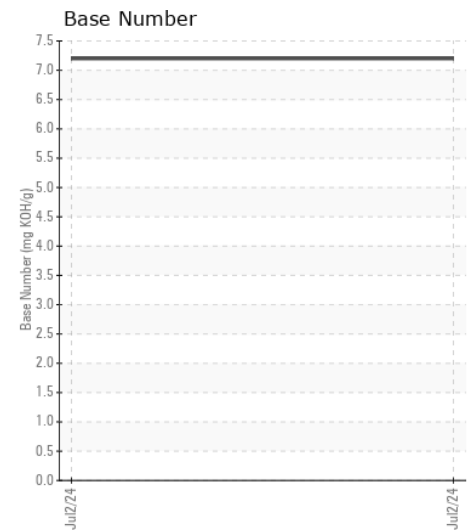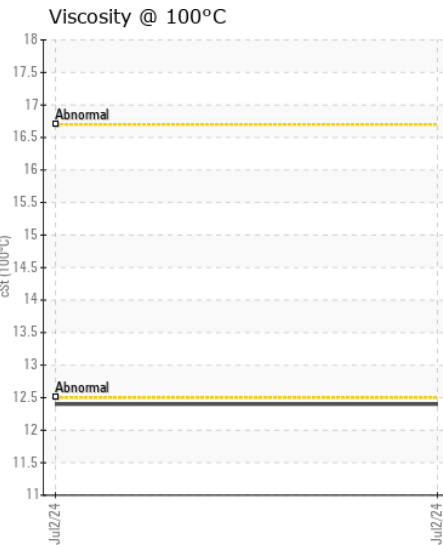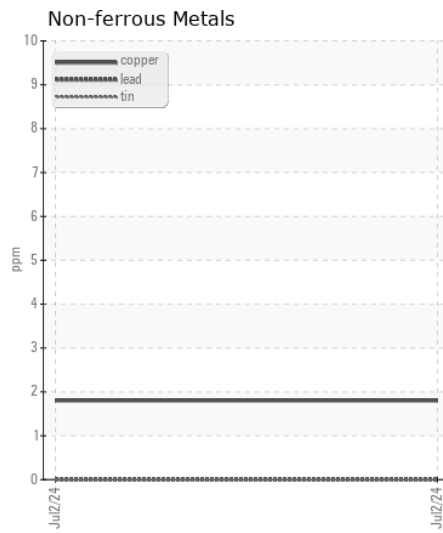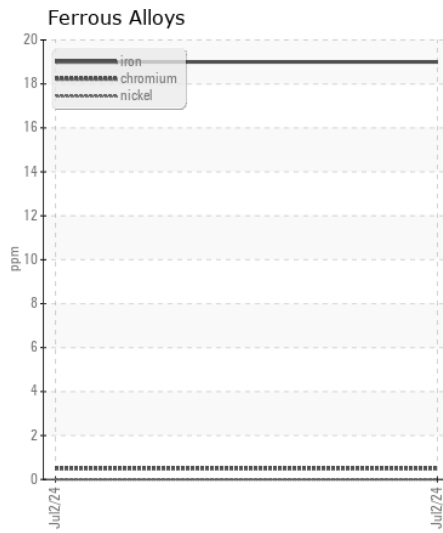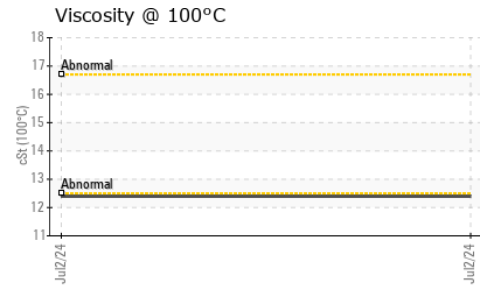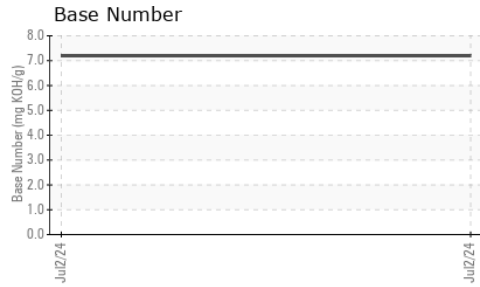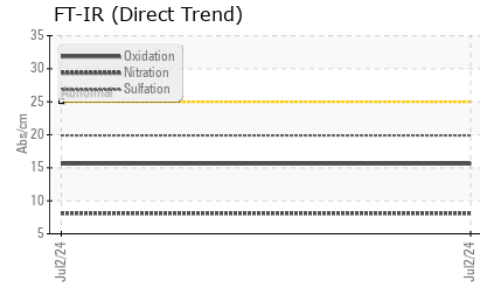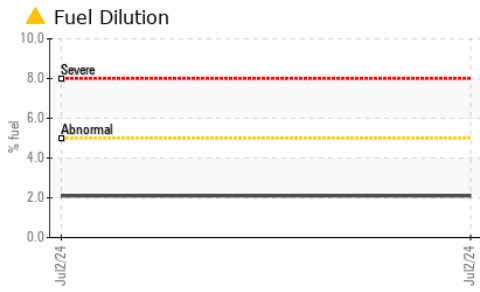

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0941949 **Received** : 03 Jul 2024
Lab Number : 06226991 **Tested** : 08 Jul 2024
Unique Number : 11110484 **Diagnosed** : 08 Jul 2024 - Wes Davis
Test Package : CONST (Additional Tests: FuelDilution, PercentFuel, TBN)

SIDDONS-MARTIN EMERGENCY GROUP
 4401 REX RD
 FRIENDSWOOD, TX
 US 77546
 Contact: DOUGLAS DLOUHY
 DDLOUHY@SIDDONS-MARTIN.COM

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: