



COOLANT REPORT

CORROSION	NORMAL
CONTAMINANTS	NORMAL
COOLANT CONDITION	NORMAL

Area

WCLSNC

Machine Id

QC COOL ELC NC 09012022

Component

Coolant

Fluid

CAT EXTENDED LIFE COOLANT (ELC) (--- GAL)

RECOMMENDATION

No corrective action is recommended at this time. The fluid is suitable for further service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0961106	WC0961104	WC0952339
Sample Date		Client Info		05 Jul 2024	03 Jul 2024	28 Jun 2024
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

CORROSION

All metal levels are normal indicating no corrosion in the cooling system.

Iron	ppm	ASTM D6130	>2	0	0	0
Aluminum	ppm	ASTM D6130	>2	0	<1	0
Copper	ppm	ASTM D6130	>2	0	0	0
Lead	ppm	ASTM D6130	>2	0	<1	0
Tin	ppm	ASTM D6130	>2	0	0	0
Zinc	ppm	ASTM D6130	>10	0	0	0

CONTAMINANTS








There is no indication of any contamination in the coolant.

Calcium	ppm	ASTM D6130	>5	0	0	0
Chlorine	ppm	ASTM D6130		0	2	1
Magnesium	ppm	ASTM D6130	>6	0	0	0
Total Dissolved Solids				295.5	245.0	362.0
Coolant Appearance		*Visual	Clear	normal	normal	normal

COOLANT CONDITION

Carboxylate test failed. Glycol and nitrite levels are acceptable. The pH level of this fluid is within the acceptable limits.

Boiling Point	°C	WC Method		225	225	225
Specific Gravity		*ASTM D1298		1.066	1.065	1.066
pH	Scale 0-14	ASTM D1287		8.13	8.16	8.14
Nitrites	ppm	AP-053:2009		824	712	824
Reserve Alkalinity	Scale 0-20	*ASTM D1121		---	---	---
Percentage Glycol	%	ASTM D3321		49.0	48.4	49.1
Freezing Point	°F	ASTM D3321		-33	-31	-33
Carboxylate				fail	fail	fail
Silicon	ppm	ASTM D6130	0	1	1	1
Phosphorus	ppm	ASTM D6130	0	0	0	2
Boron	ppm	ASTM D6130	0	0	0	0
Molybdenum	ppm	ASTM D6130	950	640	755	788
Sodium	ppm	ASTM D6130		3716	3904	4518
Potassium	ppm	ASTM D6130		9	8	4
Coolant Color		*Visual		Red	Red	Red

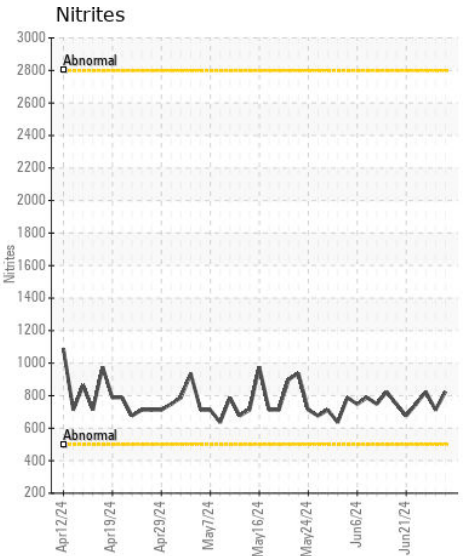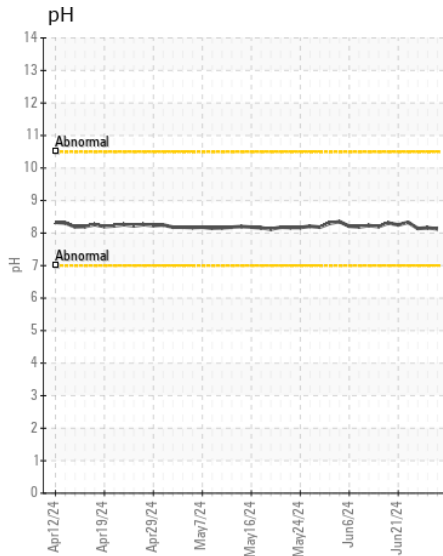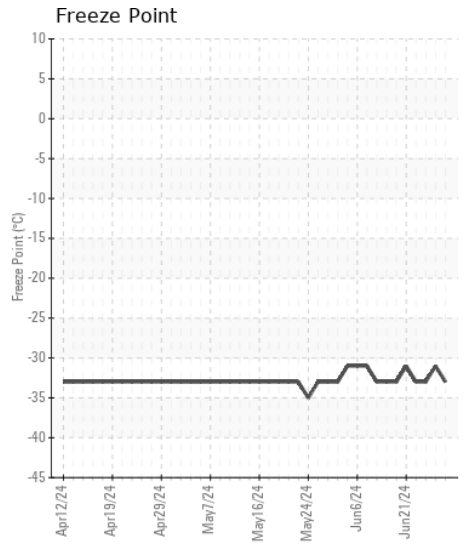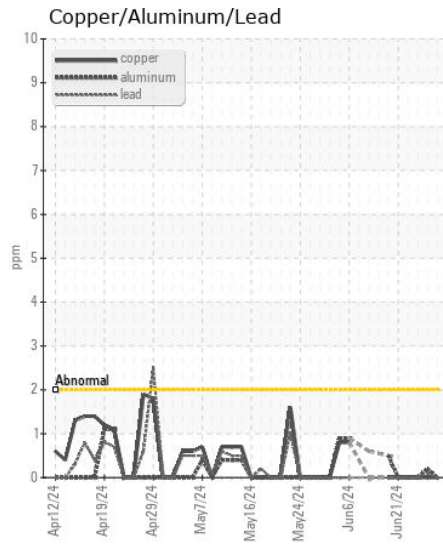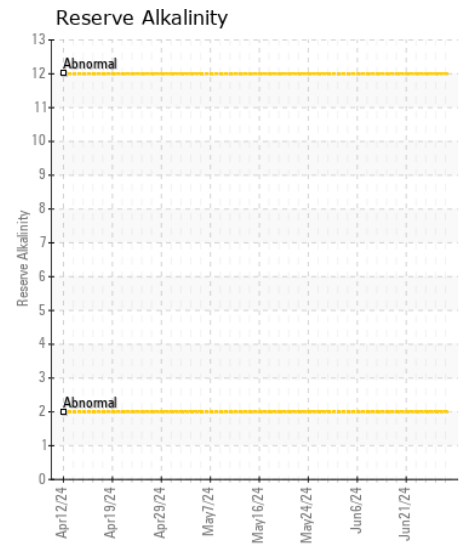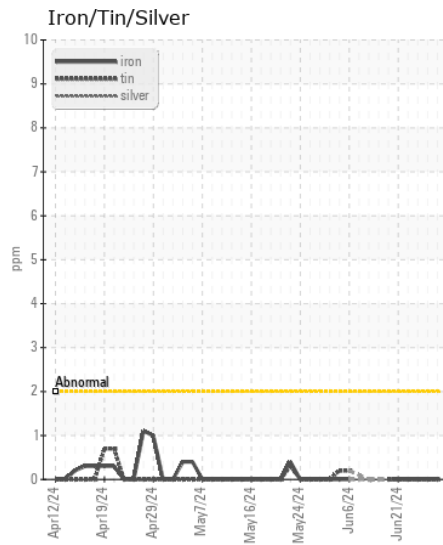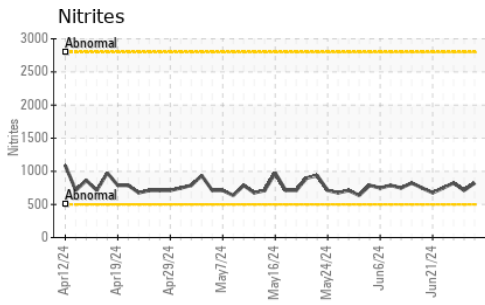

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0961106 **Received** : 05 Jul 2024
Lab Number : 06229075 **Tested** : 15 Jul 2024
Unique Number : 11112568 **Diagnosed** : 15 Jul 2024 - Sean Felton
Test Package : COOL- (Additional Tests: GlycolType, ICP)

WEARCHECK LUBRICATION SERVICES QA ACCOUNT
 501 Madison Ave
 Cary, NC
 US 27513
 Contact: WCLS CARY NC

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (919)379-4102
 F: (919)379-4050