



Area
G.LOPES CONSTRUCTION INC./Off-Road

Machine Id
BH65
Component
Coolant

Fluid
{not provided} (--- GAL)

RECOMMENDATION

The fluid is suitable for further service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		PCA0122473	---	---
Sample Date		Client Info		02 Jul 2024	---	---
Machine Age	hrs	Client Info		9111	---	---
Oil Age	hrs	Client Info		9111	---	---
Oil Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---








CORROSION

Total Dissolved Solids				661.5	---	---
Coolant Appearance		*Visual	Clear	normal	---	---

CONTAMINANTS

There is no indication of any contamination in the coolant.

Boiling Point	°C	WC Method		227	---	---
Specific Gravity		*ASTM D1298		1.075	---	---
pH	Scale 0-14	ASTM D1287		8.66	---	---
Nitrites	ppm	AP-053:2009		1652	---	---
Reserve Alkalinity	Scale 0-20	*ASTM D1121		---	---	---
Percentage Glycol	%	ASTM D3321		55.9	---	---
Freezing Point	°F	ASTM D3321		-47	---	---
Carboxylate				n/a	---	---
Coolant Color		*Visual		Red	---	---

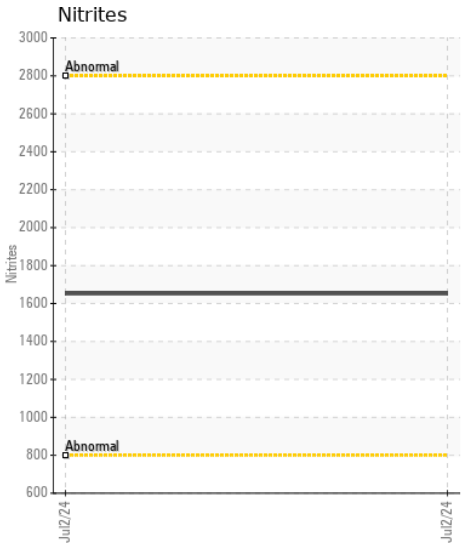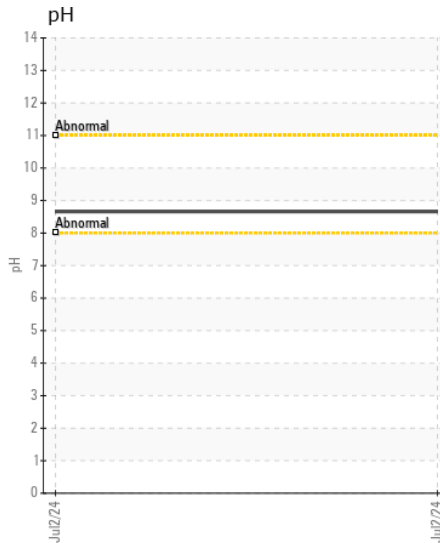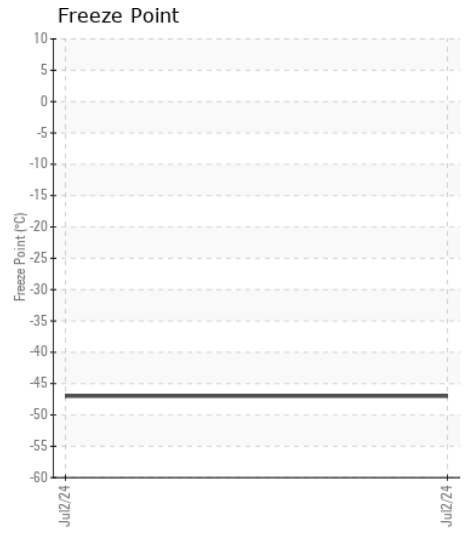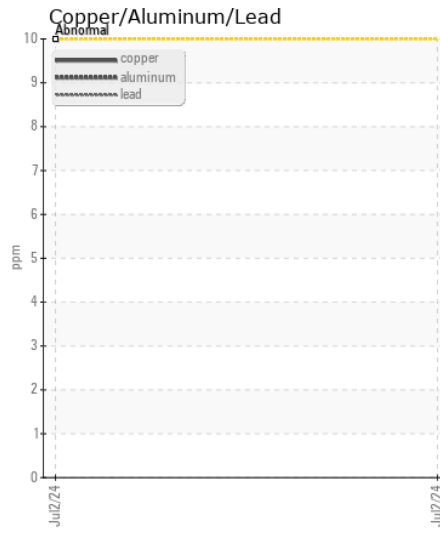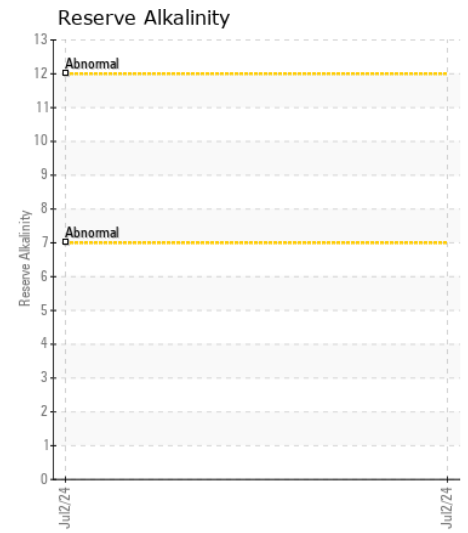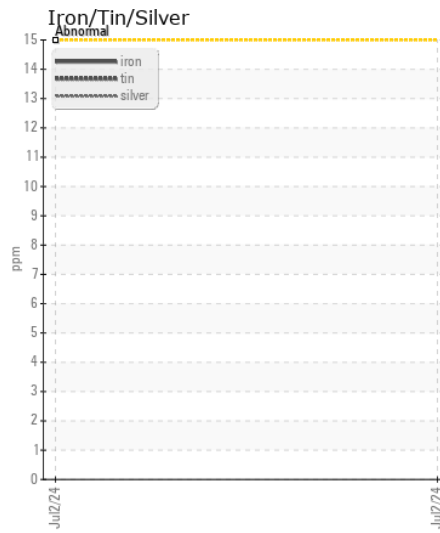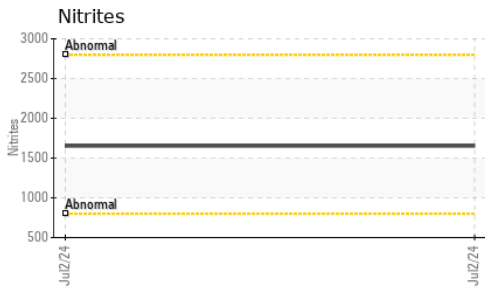

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0122473 **Received** : 08 Jul 2024
Lab Number : 06230708 **Tested** : 10 Jul 2024
Unique Number : 11114201 **Diagnosed** : 10 Jul 2024 - Jonathan Hester
Test Package : COOL- (Additional Tests: GlycolType)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

G LOPES CONSTRUCTION
 565 WINTHROP ST
 TAUNTON, MA
 US 02780
 Contact: BUTCH MCGRATH
 bmcgrath@glopes.com

T:
F: