



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
OSHKOSH MIXER 4429
Component
Diesel Engine
Fluid
MOBIL 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0917200	WC0909272	---
Sample Date		Client Info		03 Jun 2024	01 Mar 2024	---
Machine Age	mls	Client Info		18508	14497	---
Oil Age	mls	Client Info		0	0	---
Filter Age	mls	Client Info		0	0	---
Oil Changed		Client Info		Changed	Changed	---
Filter Changed		Client Info		Changed	Changed	---
Sample Status				NORMAL	NORMAL	---

WEAR

Metal levels are typical for a new component breaking in.

Iron	ppm	ASTM D5185m	>100	6	9	---
Chromium	ppm	ASTM D5185m	>20	<1	<1	---
Nickel	ppm	ASTM D5185m	>4	0	0	---
Titanium	ppm	ASTM D5185m		<1	0	---
Silver	ppm	ASTM D5185m	>3	<1	0	---
Aluminum	ppm	ASTM D5185m	>20	2	<1	---
Lead	ppm	ASTM D5185m	>40	0	<1	---
Copper	ppm	ASTM D5185m	>330	<1	<1	---
Tin	ppm	ASTM D5185m	>15	<1	0	---
Vanadium	ppm	ASTM D5185m		<1	<1	---
White Metal	scalar	*Visual	NONE	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	---

CONTAMINATION












There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	3	3	---
Potassium	ppm	ASTM D5185m	>20	2	0	---
Fuel		WC Method	>5	<1.0	<1.0	---
Water		WC Method	>0.2	NEG	NEG	---
Glycol		WC Method		NEG	NEG	---
Soot %	%	*ASTM D7844	>3	0.2	0.3	---
Nitration	Abs/cm	*ASTM D7624	>20	6.6	6.2	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	18.1	17.7	---
Silt	scalar	*Visual	NONE	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	---

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m	>118	0	3	---
Boron	ppm	ASTM D5185m		2	3	---
Barium	ppm	ASTM D5185m		0	0	---
Molybdenum	ppm	ASTM D5185m		58	54	---
Manganese	ppm	ASTM D5185m		0	0	---
Magnesium	ppm	ASTM D5185m		953	874	---
Calcium	ppm	ASTM D5185m		1100	1021	---
Phosphorus	ppm	ASTM D5185m		1107	916	---
Zinc	ppm	ASTM D5185m		1282	1085	---
Sulfur	ppm	ASTM D5185m		3178	3277	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	13.8	13.6	---
Base Number (BN)	mg KOH/g	ASTM D2896		8.9	8.9	---
Visc @ 100°C	cSt	ASTM D445		14.3	13.9	---

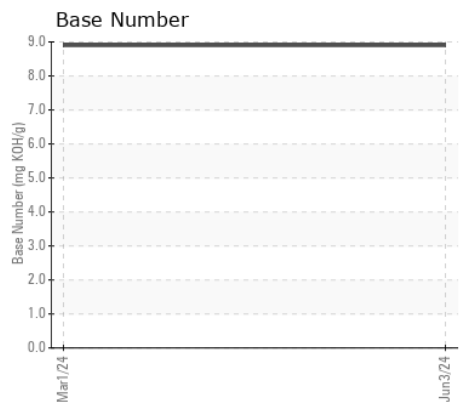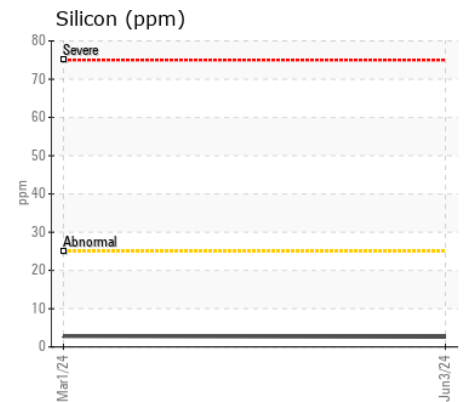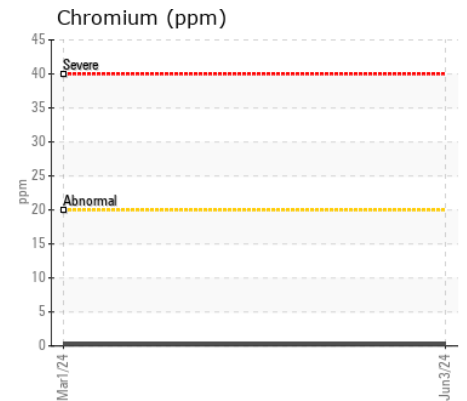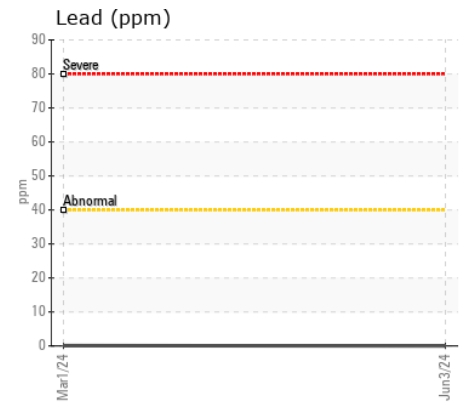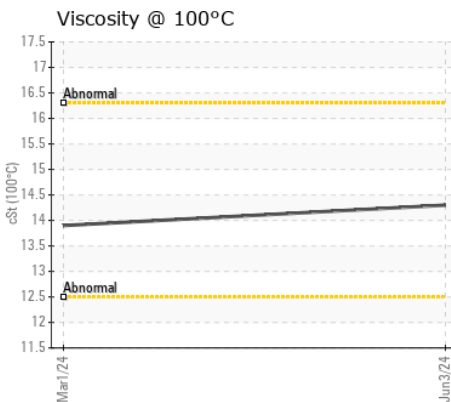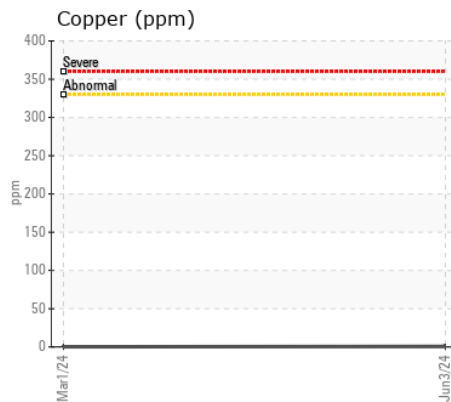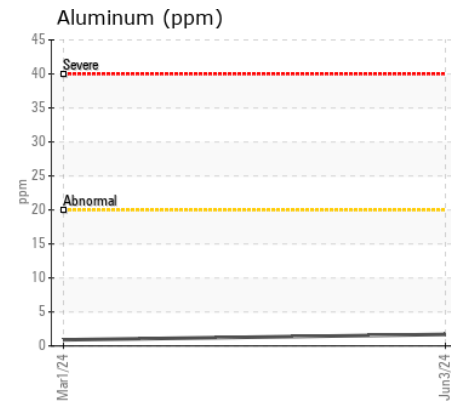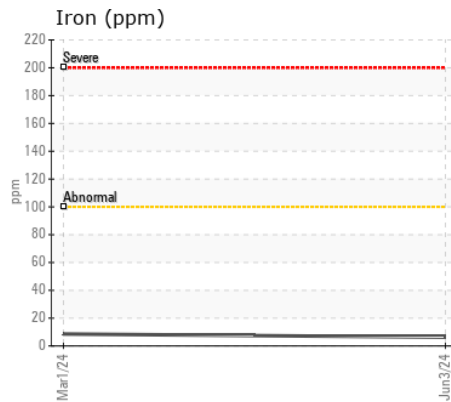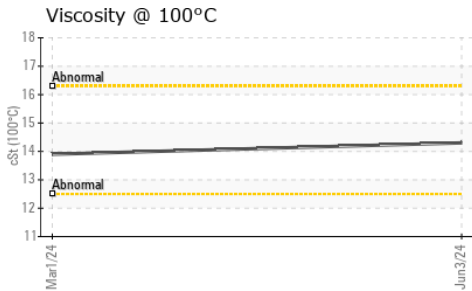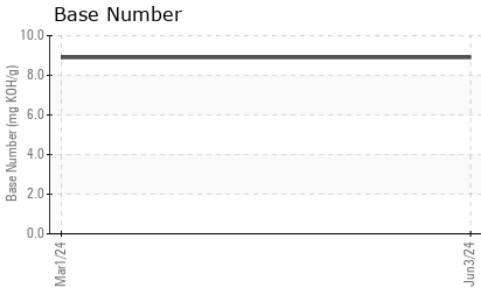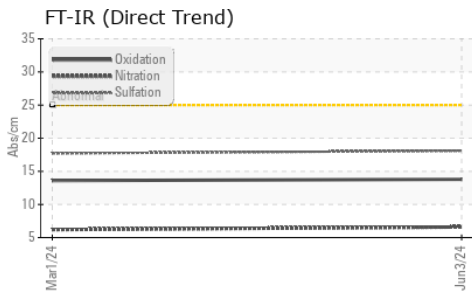

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0917200
Lab Number : 06233001
Unique Number : 11116494
Test Package : MOB 1 (Additional Tests: TBN)

Received : 11 Jul 2024
Tested : 11 Jul 2024
Diagnosed : 11 Jul 2024 - Wes Davis

CONCRETE SERVICE CO - FAY BLOCK
 161 BUILDERS BLVD
 FAYETTEVILLE, NC
 US 28301

Contact: BRYAN VANNIMAN
 bryanvanniman@fayblock.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (800)326-9198

F: