



RAPPORT D'ANALYSE D'HUILE

USURE	NORMAL
CONTAMINATION	NORMAL
ÉTAT DU FLUIDE	NORMAL

Secteur
[49252]
 Identité de la machine
ONAN G210958882
 Composant
Moteur diesel
 Fluide
NOT GIVEN (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is SAE 40 Diesel Engine Oil. Please confirm the oil type and grade, and specify the brand of the oil on your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Numéro d'échant.		Client Info		CU0021650	---	---
Date d'échant.		Client Info		13 Nov 2023	---	---
Âge d la Machine	hrs	Client Info		0	---	---
Âge de l'huile	hrs	Client Info		0	---	---
Âge du filtre	hrs	Client Info		0	---	---
Huile changée		Client Info		N/A	---	---
Filtre changé		Client Info		N/A	---	---
Statut de l'échant.				NORMAL	---	---

USURE

All component wear rates are normal.

Fer	ppm	ASTM D5185(m)	>100	4	---	---
Chrome	ppm	ASTM D5185(m)	>20	0	---	---
Nickel	ppm	ASTM D5185(m)	>4	0	---	---
Titane	ppm	ASTM D5185(m)		0	---	---
Argent	ppm	ASTM D5185(m)	>3	<1	---	---
Aluminium	ppm	ASTM D5185(m)	>20	2	---	---
Plomb	ppm	ASTM D5185(m)	>40	<1	---	---
Cuivre	ppm	ASTM D5185(m)	>330	14	---	---
Étain	ppm	ASTM D5185(m)	>15	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---

CONTAMINATION










There is no indication of any contamination in the oil.

Silicium	ppm	ASTM D5185(m)	>25	5	---	---
Potassium	ppm	ASTM D5185(m)	>20	<1	---	---
Essence		WC Method	>5	<1.0	---	---
Glycol		WC Method		NEG	---	---
% de suie	%	ASTM D7844*	>3	0	---	---
Nitration	Abs/cm	ASTM D7624*	>20	8.0	---	---
Sulfatation	Abs/.1mm	ASTM D7415*	>30	20.6	---	---
Eau émulsifiée	scalar	Visual*	>0.2	NEG	---	---

ÉTAT DU FLUIDE

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		4	---	---
Bore	ppm	ASTM D5185(m)		44	---	---
Baryum	ppm	ASTM D5185(m)		<1	---	---
Molybdène	ppm	ASTM D5185(m)		44	---	---
Manganèse	ppm	ASTM D5185(m)		<1	---	---
Magnésium	ppm	ASTM D5185(m)		822	---	---
Calcium	ppm	ASTM D5185(m)		1136	---	---
Phosphore	ppm	ASTM D5185(m)		739	---	---
Zinc	ppm	ASTM D5185(m)		849	---	---
Soufre	ppm	ASTM D5185(m)		1982	---	---
Oxydation	Abs/.1mm	ASTM D7414*	>25	18.9	---	---
Visc 100°C	cSt	ASTM D7279(m)		13.7	---	---

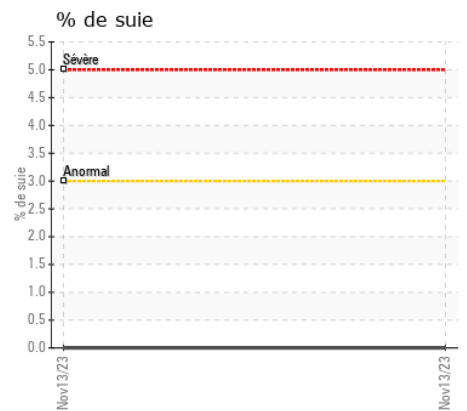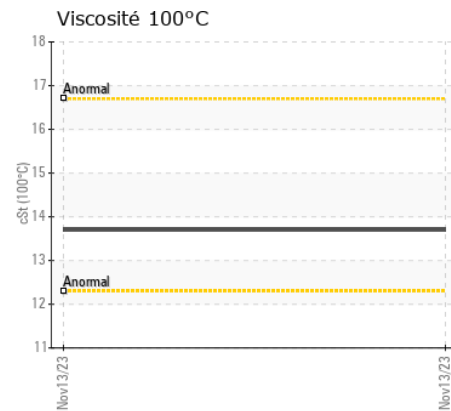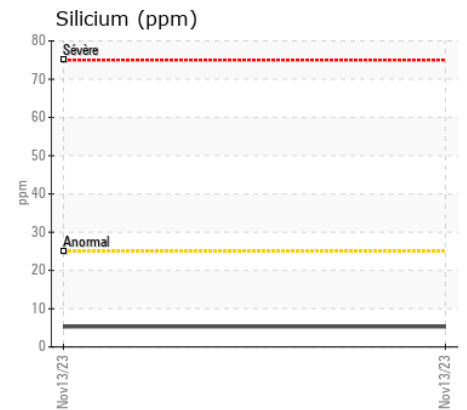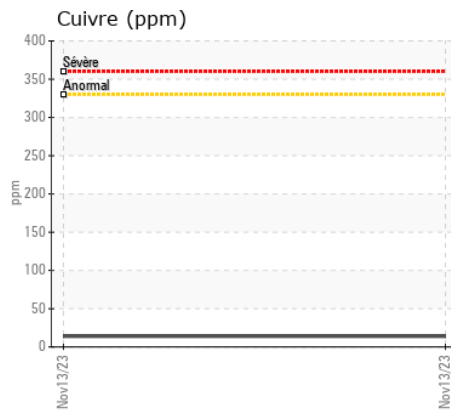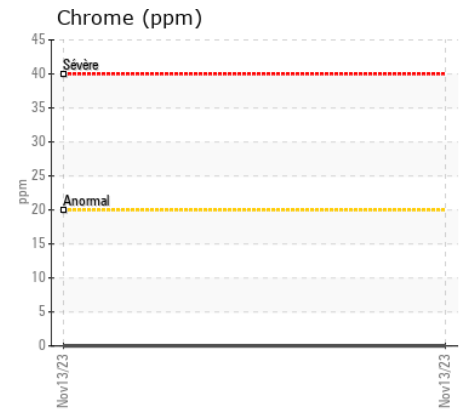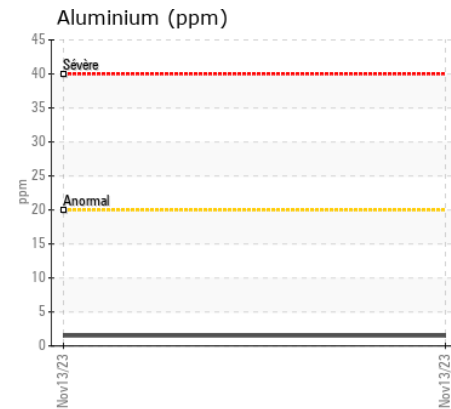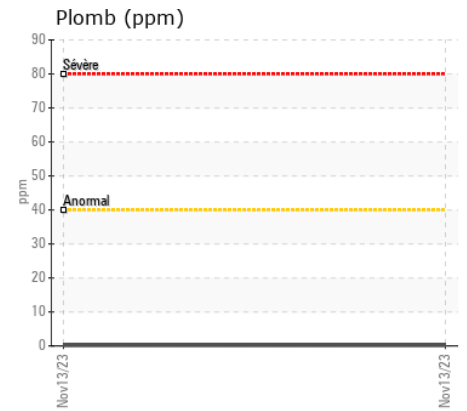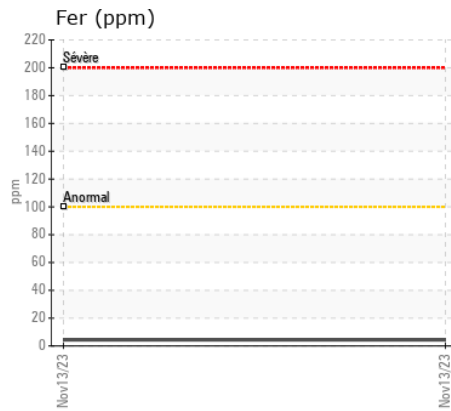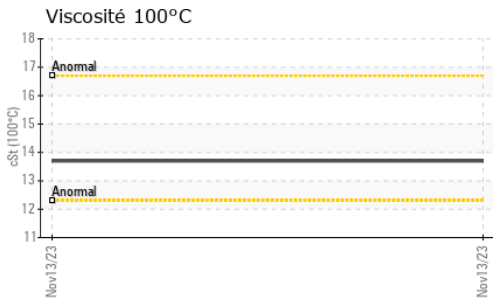

Laboratoire : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **CUMMINS EASTERN CANADA INC.**
N° d'échantillon : CU0021650 **Reçu** : 14 Nov 2023 122 CLYDE AVENUE
N° de laboratoire : 02596108 **Diagnostiqué** : 14 Nov 2023 MOUNT PEARL, NL
Numéro unique : 5681188 **Diagnostiqueur** : Kevin Marson CA A1N 4S3
Analyse : MOB 1

Pour discuter ce rapport, contacter le service à la clientèle au 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

La validez de los resultados y la interpretación se basan en la muestra y la información proporcionada.

Contact: JUANITA BRANTON
JUANITA.BRANTON@CUMMINS.COM

T: (709)747-0157
F: (709)747-1084