



RAPPORT D'ANALYSE D'HUILE

USURE	NORMAL
CONTAMINATION	NORMAL
ÉTAT DU FLUIDE	NORMAL

Secteur

[207751]

Identité de la machine

WORKBOAT

Composant

Moteur diesel

Fluid

DIESEL ENGINE OIL SAE 40 (--- LTR)

RECOMMENDATION

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) DIESEL ENGINE OIL SAE 40. Please confirm. Please specify the component make and model with your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Numéro d'échant.		Client Info		CU0022121	---	---
Date d'échant.		Client Info		13 Mar 2024	---	---
Âge d la Machine	hrs	Client Info		6600	---	---
Âge de l'huile	hrs	Client Info		0	---	---
Âge du filtre	hrs	Client Info		0	---	---
Huile changée		Client Info		N/A	---	---
Filtre changé		Client Info		N/A	---	---
Statut de l'échant.				NORMAL	---	---

USURE

All component wear rates are normal.

Fer	ppm	ASTM D5185(m)	>100	7	---	---
Chrome	ppm	ASTM D5185(m)	>20	0	---	---
Nickel	ppm	ASTM D5185(m)	>4	<1	---	---
Titane	ppm	ASTM D5185(m)		0	---	---
Argent	ppm	ASTM D5185(m)	>3	0	---	---
Aluminium	ppm	ASTM D5185(m)	>20	2	---	---
Plomb	ppm	ASTM D5185(m)	>40	10	---	---
Cuivre	ppm	ASTM D5185(m)	>330	<1	---	---
Étain	ppm	ASTM D5185(m)	>15	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---

CONTAMINATION











There is no indication of any contamination in the oil.

Silicium	ppm	ASTM D5185(m)	>25	4	---	---
Potassium	ppm	ASTM D5185(m)	>20	15	---	---
Essence		WC Method	>5	<1.0	---	---
L'eau		WC Method	>0.2	NEG	---	---
Glycol	%	ASTM D7922*		0.0	---	---
% de suie	%	ASTM D7844*	>3	0	---	---
Nitration	Abs/cm	ASTM D7624*	>20	8.9	---	---
Sulfatation	Abs/.1mm	ASTM D7415*	>30	20.9	---	---
Eau émulsifiée	scalar	Visual*	>0.2	NEG	---	---

ÉTAT DU FLUIDE

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>216	9	---	---
Bore	ppm	ASTM D5185(m)	250	7	---	---
Baryum	ppm	ASTM D5185(m)	10	0	---	---
Molybdène	ppm	ASTM D5185(m)	100	64	---	---
Manganèse	ppm	ASTM D5185(m)		0	---	---
Magnésium	ppm	ASTM D5185(m)	450	1062	---	---
Calcium	ppm	ASTM D5185(m)	3000	1252	---	---
Phosphore	ppm	ASTM D5185(m)	1150	1012	---	---
Zinc	ppm	ASTM D5185(m)	1350	1254	---	---
Soufre	ppm	ASTM D5185(m)	4250	2415	---	---
Oxydation	Abs/.1mm	ASTM D7414*	>25	19.1	---	---
Visc 100°C	cSt	ASTM D7279(m)	14.4	13.3	---	---

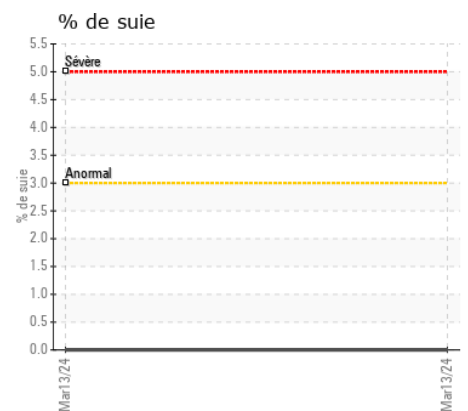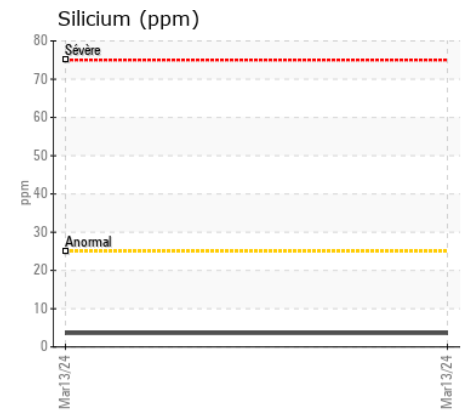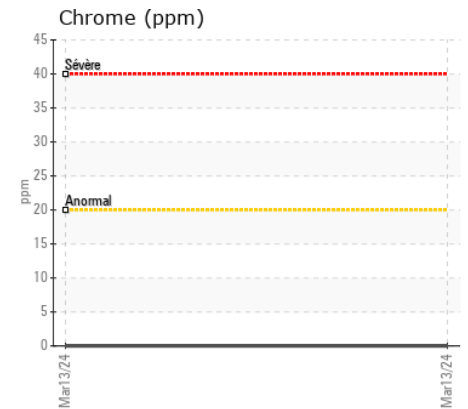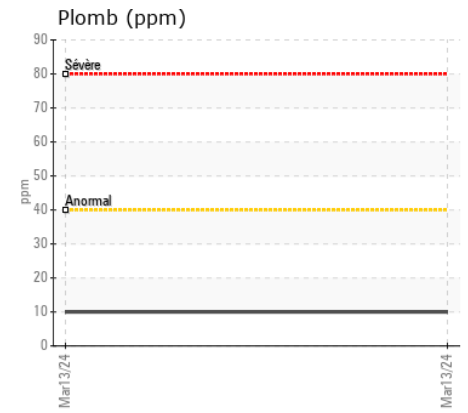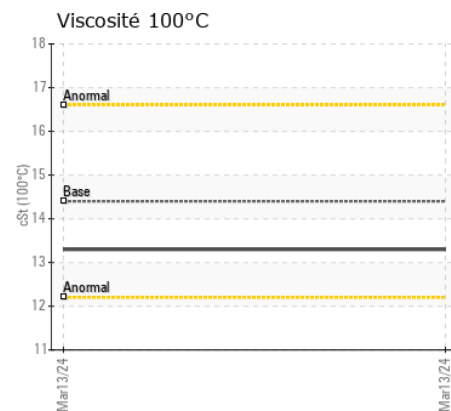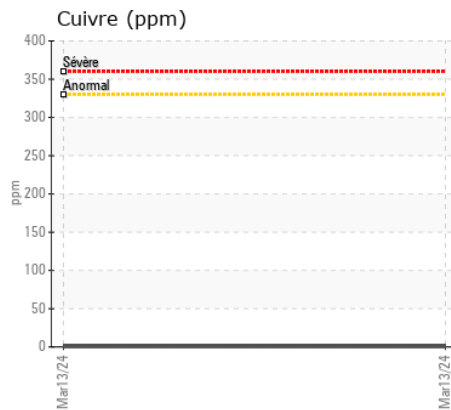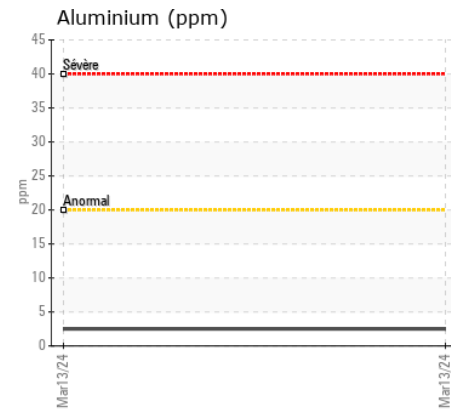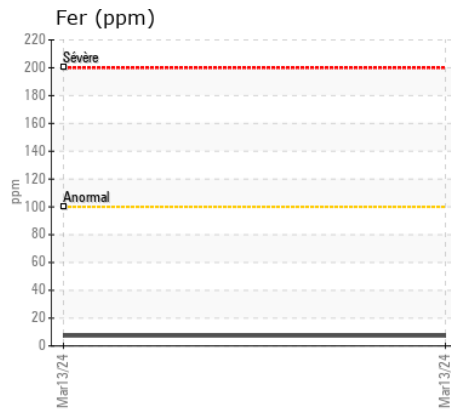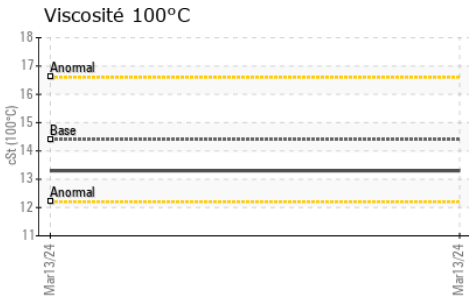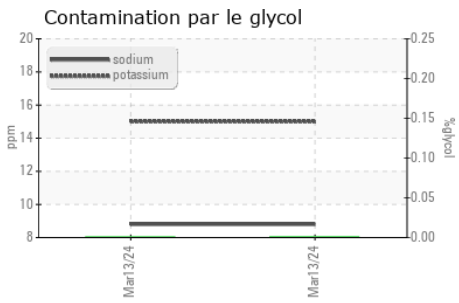

ISO 17025:2017
Accredited
Laboratory

Laboratoire : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
N° d'échantillon : CU0022121 **Reçu** : 21 Mar 2024
N° de laboratoire : 02623659 **Tested** : 21 Mar 2024
Numéro unique : 5748778 **Diagnostiqué** : 21 Mar 2024 - Wes Davis
Analyse : MOB 1 (Additional Tests: Glycol)

Pour discuter ce rapport, contacter le service à la clientèle au 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

La validez de los resultados y la interpretación se basan en la muestra y la información proporcionada.

CUMMINS CANADA ULC
 7200 TRANS CANADA HWY.
 POINTE CLAIRE, QC
 CA H9R 1C2
 Contact: Francois Brault
 Francois.Brault@cummins.com
 T: (514)695-8410
 F: (514)695-5246