


WEST HOT OIL SYSTEM


Customer: PTRHTF10004	System Information	Sample Information
ADM VITAMIN E PLANT	System Volume: 2200 gal	Lab No: 02245910
3700 EAST DIVISION STREET	Bulk Operating Temp: 550F / 288C	Analyst: Joe Goecke
DECATUR, IL 62526 USA	Heating Source:	Sample Date: 10/11/18
Attn: Rick Cluck	Blanket:	Received Date: 10/18/18
Tel: (217)451-7770	Fluid: PETRO CANADA PURITY FG HEAT TRANSFER FLUID	Completed: 10/22/18
E-Mail: ricky.cluck@adm.com	Make: AMERICAN	To discuss this report contact Joe
		Goecke at (859)543-0092


Recommendation: Sample looks very good. continue to use and resample in 90 days. All key parameters close to normal.


Comments: COC Flash Point is abnormally low.


Sample Date	Received Date	Fluid Age	Sample Location	Flash Point (COC)	Water (KF)	Viscosity (40°C)	Acid Number	Solids	GCD 10%	GCD 50%	GCD 90%	GCD % < 335°C
	mm/dd/yy			°F/°C	ppm	cSt	mg/KOH/ g	%wt	°F/°C	°F/°C	°F/°C	%
10/11/18	10/18/18	Oy		378 / 192	11.9	31.2	0.20	0.039	719 / 382	795 / 424	894 / 479	0.00
07/31/18	08/08/18	0y	B24 HOT OIL PUMP	277 / 136	2.2	<mark>24.4</mark>	0.01	0.075	621 / 327	796 / 425	913 / 489	10.52
04/26/18	05/04/18	0y		259 / 126	0.00	24.7	0.048	0.050	628 / 331	798 / 426	912 / 489	10.05
03/22/18	03/29/18	0y		282 / 139	7.1	24.8	0.053	0.007	645 / 341	805 / 430	908 / 487	8.80
01/30/18	02/05/18	0y		349 / 176	4.2	25.1	0.02	0.035	646 / 341	803 / 429	920 / 493	8.76
12/18/17	12/27/17	0y		271 / 133	9.1	25.2	0.03	0.040	644 / 340	798 / 425	907 / 486	8.86
		Baseline	Data	459 / 237		37.12	0.90		721 / 383	807 / 431	892 / 478	1.5

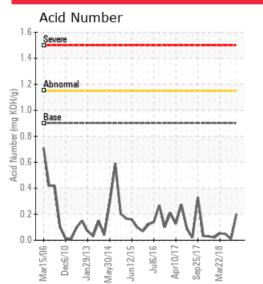

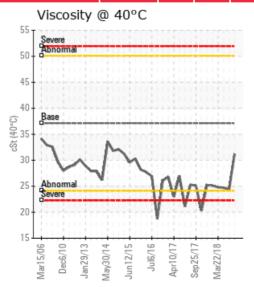





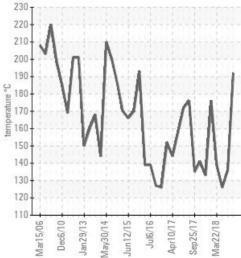


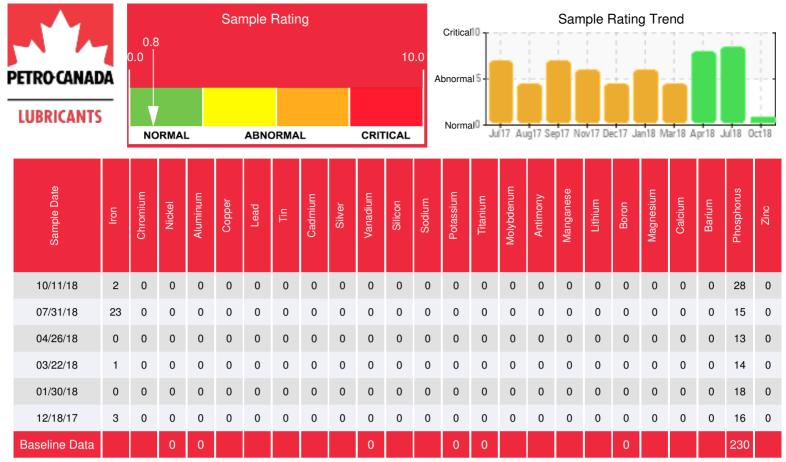

Elemental anaysis results (above) in parts per million (ppm). [10,000 ppm = 1.0%]

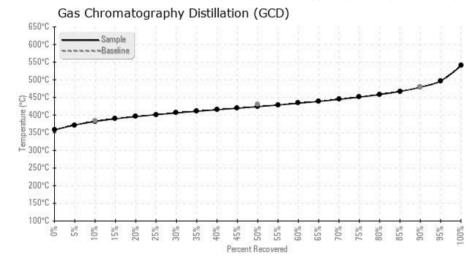



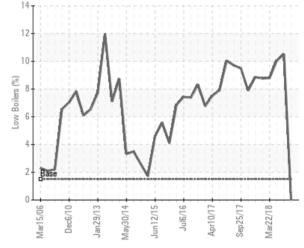

Historical Comments

07/31/18	Low boilers continue to rise over 10.5% and flash point is low at 136 C. The viscosity has dropped a slight amount and the 10% Distillation point has dropped to very low temp. Oil should be scheduled for a change within the next 60-90 days. (GCD) 10% Distillation Point is severely low. COC Flash Point is severely low. (GCD) % < 335°C is marginally high. (GCD) 90% Distillation Point is marginally high.
04/26/18	Flash point continues to drop into a very low level. Low boilers have crossed the 10% level. The system should be changed in the 60-90 days. Viscosity remains low as well. (GCD) 10% Distillation Point is severely low. COC Flash Point is severely low. (GCD) % < 335°C is marginally high. (GCD) 90% Distillation Point is marginally high.
03/22/18	Flash point dropped again to critical level. Light ends have held steady with no increase and viscosity has remained steady although on the lower end. With all parameters except flash staying steady continue to use and resample in 60 days. Possible change later this year on 3 rd or 4 th Quarter. COC Flash Point is severely low. (GCD) 10% Distillation Point is abnormally low. (GCD) % < 335°C is marginally high.
01/30/18	Low boilers and viscosity have remained steady with no major changes. Flash point has seen a significant increase and although this is still low much better than previous sample. Suitable for continued use resample at next scheduled interval. COC Flash Point is severely low. (GCD) 90% Distillation Point is abnormally high. (GCD) 10% Distillation Point is abnormally low. (GCD) % < 335°C is marginally high.
12/18/17	Sample remained very stable from last report. A slight drop in Flash point but a rise in viscosity indicates some stability. Low boilers had slight rise but less than 10. Continue to use and sample at next regular interval. COC Flash Point is severely low. (GCD) 10% Distillation Point is abnormally low. (GCD) % < 335°C is marginally high.

Petro-Canada makes no representation or warranty of any kind, either express or implied, as to the accuracy or completeness of the analysis and assumes no responsibility and shall have no liability whatsoever with respect to such analysis, or a party's use of it. Petro-Canada is a division of HollyFrontier Corporation.