

[LSD: 10-03-52-17W5] TOURMALINE WOLF LAKE

Customer: PTRHTF20039

BRENNTAG CANADA INC 3124-54TH AVENUE SE

CALGARY, AB T2C 0A8 Canada

Attn: Adam Duval

Tel:

E-Mail: aduval@brenntag.ca

System Information

System Volume: 5000 ltr

Bulk Operating Temp: 455F / 235C

Heating Source:

Blanket:

Fluid: PETRO CANADA PETRO-THERM

Make:

Sample Information


Lab No: 02367852 Analyst: Terry Veenstra Sample Date: 07/17/20 Received Date: 07/30/20 Completed: 08/06/20


Terry Veenstra

terry.veenstra@petrocanadalsp.com

Recommendation: GCD @ 10% is low indicating the presence of low boilers. AS per our email from you the gas blanket is in place with approximately 200-220 Kpa N2. As part of good system maintenance, regularly vent off the system to eliminate low boilers from the system. This should also restore your flash point of the fluid. Resample in 6 months.

Comments: (GCD) 10% Distillation Point is severely low. COC Flash Point is severely low. (GCD) % < 335°C is abnormally high. (GCD) 90% Distillation Point is marginally high.

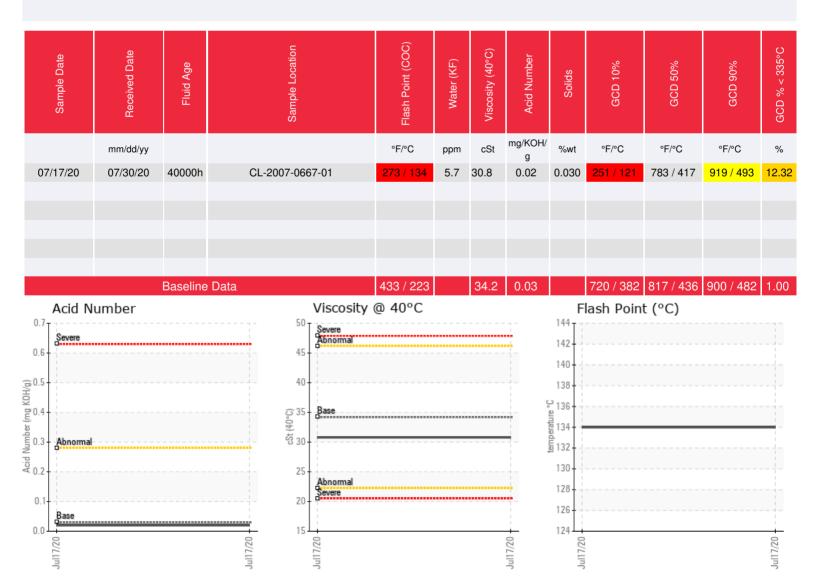

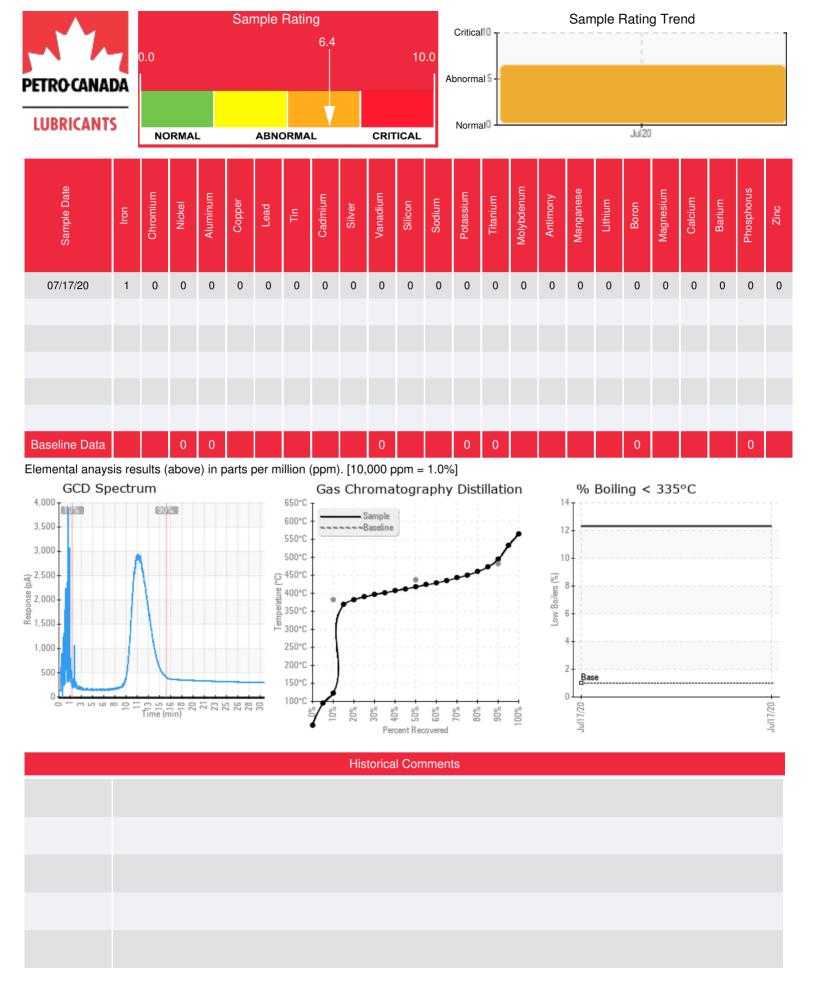

Petro-Canada makes no representation or warranty of any kind, either express or implied, as to the accuracy or completeness of the analysis and assumes no responsibility and shall have no liability whatsoever with respect to such analysis, or a party's use of it. Petro-Canada is a division of HollyFrontier Corporation.